

Component List

■ Standard

ITEM	MODEL	QTY
Main Unit	3910-01	1
Power Card	-	1
Standard Inlet	3910-06	1
Isokinetic Suction Probe	3910-07	1
Zero Filter	3910-04	2
Tygon Tube (2M)	-	1
Printer Paper (Dust Free Paper)	3910-05	2
Measurement Software	-	1
Operation Manual	-	1
Test Certificate	-	1
AC adapter(GS60A15)	3910-08	1
USB flash drive – 16GB	-	1
Lithium-ion Battery(Li202SX-7800)	3910-09	1

■ Optional Extras

ITEM	MODEL	QTY
Carrying Case	3910-01	1
Lithium-ion Battery	3910-09	1
Battery Charger	3910-10	1
Air Velocity Probe	6531	1
Temperature and Humidity Probe		
Differential Pressure Sensor	C264 100Pa	1
Differential Pressure Sensor Cable	3900-02	1
Contact Output Cable	3900-03	1

■ Consumables

ITEM	MODEL	QTY
Zero Filter (w/t joint and tube (70cm))	3910-04	1
Printer Paper (Dust Free Paper)	3910-05	1
Standard Inlet	3910-06	1
Isokinetic Suction Probe	3910-07	1

For more information on consumables, please contact your distributor or your KANOMAX service center.

Laser Classification

This instrument is classified as a Class 1 Laser Product in accordance with the following standards:

- EN60825-1: 2007
- I EC60825-1: 2007

CLASS 1 LASER PRODUCT
EN60825-1 : 2007

* Class 1 Laser:

Lasers that are considered to be safe under reasonably foreseeable conditions of operation, including the use of optical instruments for intrabeam viewing.

Laser Safety Instruction



Danger - This instrument employs a laser inside the unit as the light source of the sensor. Never open/close the case of the unit or disassemble the optical sensor inside the unit.

Wave Length	775-800nm
Maximum Output	80mW



Caution - Use of controls, adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.

Important Safety Information

In this manual, warning types and classifications are defined as follows.

[Classification]



WARNING: To Prevent Serious Injury or Death

Indicates a potentially hazardous situation which, if not avoided, may result in serious injury or death.



CAUTION: To Prevent Damage to the Product

Indicates a potentially hazardous situation which, if not avoided, may result in damage to the product that may void the product warranty.

[Description of Symbols]



△ Indicates the condition (including danger) that requires caution. The subject of each caution is illustrated inside the triangle (e.g., the symbol shown to the left is high temperature caution).



⊘ Indicates prohibition. Do not take the prohibited action shown inside or near this symbol. (e.g., The symbol shown to the left prohibits disassembly.)



• Indicates a mandatory action. A specific action is described near the symbol.

 WARNING	
 Do not modify/disassemble	<ul style="list-style-type: none"> ⊘ Do not disassemble, modify or repair the instrument. A 3B laser diode is used as the optical source inside the instrument. Therefore, never attempt to disassemble the instrument as it is extremely dangerous. Also, disassembling the unit may result in short circuit or malfunction.
 Handle Properly	<ul style="list-style-type: none"> ⊘ Use the instrument properly by carefully following this operation manual. Misuse of the instrument may result in electric shock, fire, damage to the instrument, etc.
	<ul style="list-style-type: none"> ⊘ If any abnormal noise, unusual odor or smoke is emitted, or any liquid enters into the instrument, turn the power off immediately, remove the battery and disconnect the power cable. It may result in electric shock, fire, or damage to the instrument. Contact your distributor or your KANOMAX service center for repair.

WARNING



Prohibited
Installation

- ⊠ Do not use this instrument in an ambient temperature of 35 °C or greater. Do not expose this instrument under water or any liquid or moisture.
 - The performance may deteriorate significantly.
 - Also, dielectric degradation may occur, which may result in short circuit or fire.



- ⊠ Unplug the power cord when the instrument is not in use.
 - Failure to observe the above may result in electric shock, fire or damage to internal circuitry.
- ⊠ Install the instrument where you can pull the power cord out anytime.
- ⊠ When using the power cord, and AC adapter, ensure there is no dust on the power plug. The AC outlet used must be within the specified power requirement of 100 ~ 240V, and with protective earthing contact.
 - Failure to observe the above may result in fire.
- ⊠ When using a power cord (3 x 0.75mm²) or an AC adapter, make sure to use the one provided with this instrument.
 - Other commercially available cords may have different voltage specifications and polarity, which could result in short circuit, fire or damage to the instrument.
- ⊠ When charging the batteries by the instrument, do not insert or pull the batteries out.
 - Failure to observe this may result in damage to battery or internal circuitry.
- ⊠ Dispose the battery according to local law or regulation. In case of explosion, don't throw the battery to fire. Don't expose the battery under any high temperature, such as radiator, direct sunlight. Don't crack or try to disassemble the battery.

CAUTION



Handle Properly

- ⊠ Remove battery when the instrument will not be used for an extended period of time.
 - Also, do not leave a discharged battery inside the instrument.
 - Failure to observe the above may result in battery leakage and damage to the instrument.



Prohibition

- ⊠ Do not perform measurements in environments exceeding the specified temperature and RH levels of the instrument.
 - The instrument should not be exposed to direct sunlight for prolonged periods.
 - The instrument may not function properly outside the specified environment. (10~35°C, 20~85%RH, with no condensation)



Prohibition

- ⊠ Do not wipe the instrument with volatile solvents.
 - The body may be deformed or deteriorated. Use a soft dry cloth to remove stains. If stains persist, soak the cloth in a neutral detergent or water and wipe the instrument with the cloth. Never use volatile solvents such as thinner or benzene.



Prohibition

- ⊠ Do not subject the instrument to strong shock. Do not place heavy objects on the instrument or sensor.
 - Failure to observe the above may cause damage to the instrument.



Prohibition

- ⊠ Do not move the main unit or the probe from a cold place to a warm place quickly. It will cause condensation.
- Even when used in an environment within the specified operating temperature and humidity, a sudden temperature change may cause condensation. Condensation generated on the sensor may cause inaccurate measurements. Condensation on metal parts may cause rusting and lead to a malfunction.



- ⊠ Do not touch the instrument when it is electrically charged.

..... Failure to observe the above may affect the measurement value and cause damage to the instrument circuitry.



Handle Properly

- ⊠ Do not let the instrument suck in highly concentrated particles that exceed the specification level.

..... Failure to observe the above may contaminate the instrument. As a result the instrument may fail to obtain zero count. In order to check the performance under highly concentrated environments, make sure to attach the filter to the inlet.

If you accidentally let the instrument suck in highly concentrated particles, attach the filter to the inlet and brush inside the instrument while the pump is running.



Prohibition

- ⊠ Do not dispose of the instrument as household waste.

..... Please note that the disposal of the instrument and the batteries should be in line with your local or national legislation. For details, please contact your local distributor.

Table of Contents

1. Part Names and Functions.....	1
1.1 General Outline.....	1
1.2 Airborne Particle Counter.....	1
2. Getting Started.....	3
2.1 Power Supply.....	3
2.2 Zero Check.....	4
2.3 Isokinetic Suction Probe.....	4
2.4 Consumables.....	5
2.4.1 Printer Paper Replacement.....	5
2.4.2 Zero Filter Replacement.....	5
2.4.3 Isokinetic Suction Probe Replacement.....	5
3. Display Description and Operation Procedure.....	6
3.1 Boot Screen.....	6
3.2 Log-In.....	7
3.2.1 Log-In Display.....	7
3.2.2 User.....	7
3.2.3 Authentication.....	8
3.2.4 Log.....	8
3.3 Initial Screen.....	9
3.3.1 Initial Screen.....	9
3.3.2 Screen Change – Initial Screen.....	14
3.4 MONITOR.....	15
3.5 MODE.....	16
3.5.1 SINGLE.....	16
3.5.2 CONTINUOUS.....	19
3.5.3 INTERVAL.....	20
3.5.4 STATS.....	22
3.5.5 STANDARD.....	24
3.5.6 PRESET.....	27
3.5.7 REMOTE.....	27
3.6 START.....	28
3.6.1 SINGLE, CONTINUOUS, INTERVAL.....	28
3.6.2 STATS.....	30
3.6.3 STANDARD.....	35
3.6.4 Interlocking Operations.....	41
3.6.5 Saving Data.....	44
3.6.6 In Case that Measurement is Interrupted.....	45
3.7 FILE.....	47
3.8 MENU.....	49
3.8.1 Measuring.....	49
3.8.2 Setting.....	56
3.8.3 Other.....	59
3.8.4 LOG OUT.....	64
3.8.5 EXIT.....	64

4. PC Applications.....	65
4.1 User Management.....	65
4.2 Remote Console.....	65
4.3 Create Schedule.....	65
4.4 Remote Measurement.....	66
5. Connecting Option Sensors.....	67
6. Printing Examples.....	68
6.1 Printing Example for Each Measurement Mode.....	68
6.1.1 SINGLE.....	68
6.1.2 CONTINUOUS.....	68
6.1.3 INTERVAL.....	69
6.1.4 STATS.....	70
6.1.5 STANDARD.....	71
7. Battery Charge.....	72
7.1 Charging Battery.....	72
8. Main Specifications.....	73
9. Troubleshooting.....	74
10. Warranty and After-sales Service.....	76

1. Part Names and Functions

1.1 General Outline


This Airborne Particle Counter is a light scattering laser particle counter using semiconductor laser radiation as a light source. This counter is used to detect ultrafine airborne particles in a cleanroom or other environment equivalent to a cleanroom. Mainly this counter is used as a monitoring measurement equipment to monitor the cleanliness in a cleanroom.

By using option sensors, air velocity, temperature, humidity and differential pressure can be measured simultaneously.

Each measurement value is displayed on the LCD screen and can be stored in the internal memory of the instrument and be printed out by the internal printer. As for the power supply, either an AC adapter (100-240V) or batteries can be used.

1.2 Airborne Particle Counter

FRONT

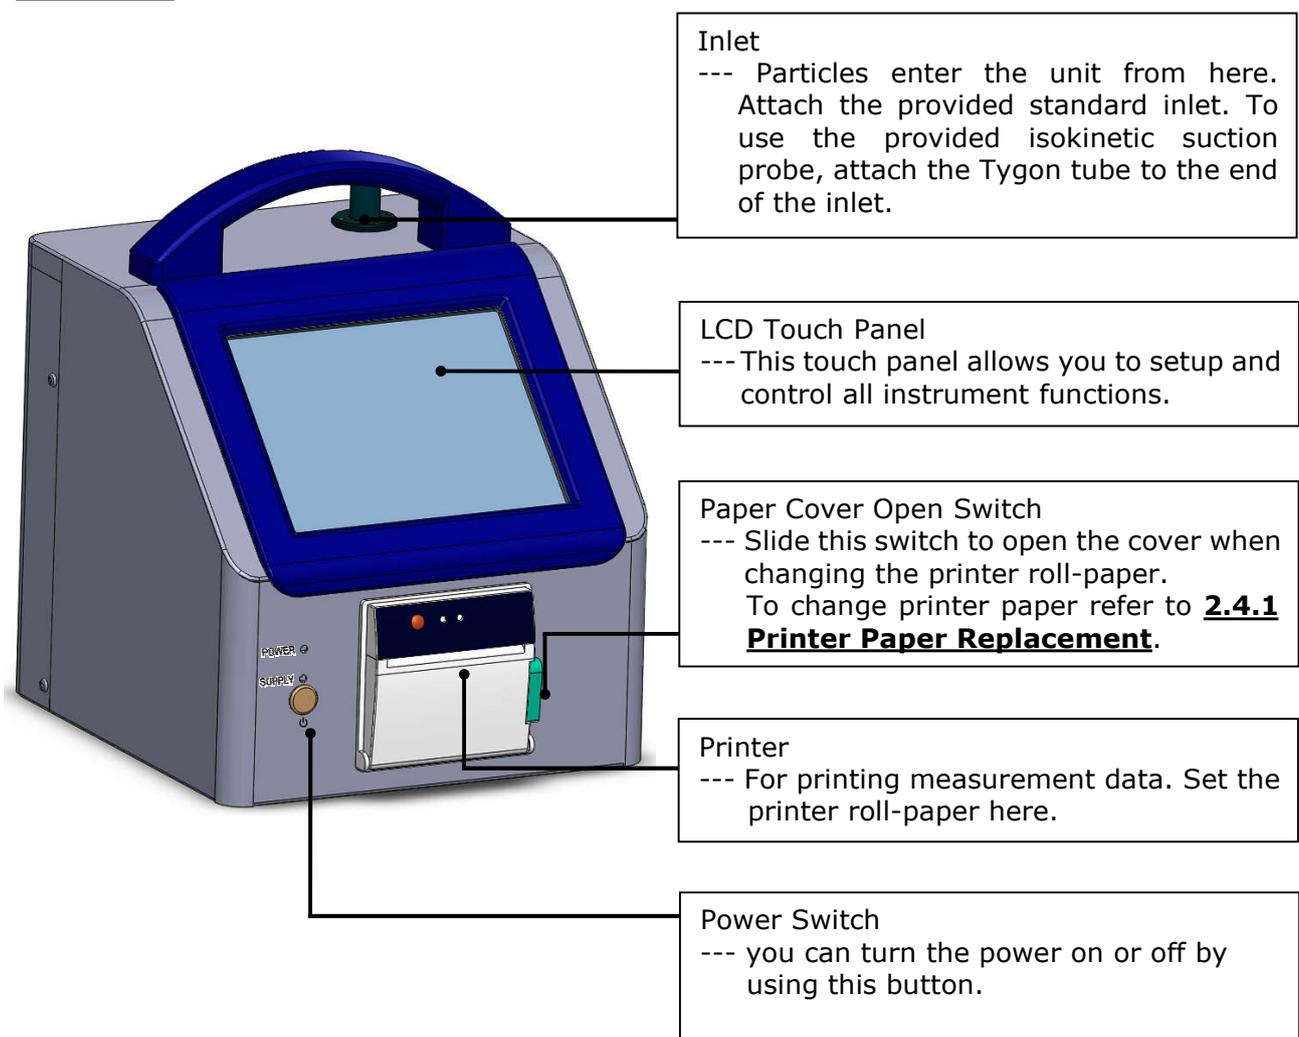

BACK

Optional Sensor Connecting Terminal
 --- Terminals where optional sensors can be connected. Refer to **5. Connecting Option Sensors** for details.


Sampling Air Exhaust Port
 --- Filtered sample air is exhausted at this port.
 Do not block the port as it may result in damage to the instrument.

Upper: SERVICE PORT1 Connector (Service only.)
 Middle: SERVICE PORT2 Connector (Service only.)
 Lower: USB Connector
 --- Insert a USB flash drive to store measurement data.
 To be used to transfer measurement data and other files to be processed on PCs.

MEMORY CARD Insertion Slot
 ---Insert the MMC card to store measurement data.

ETHERNET Connector
 ---To be used when controlling the instrument by the software. For details, refer to the operation manual for the software.

DC-IN
 ---This is an inlet to supply DC power to the instrument. Connect the provided AC adapter here. Connect the provided AC adapter here. Make sure to connect AC adapter with an AC output with protective earthing

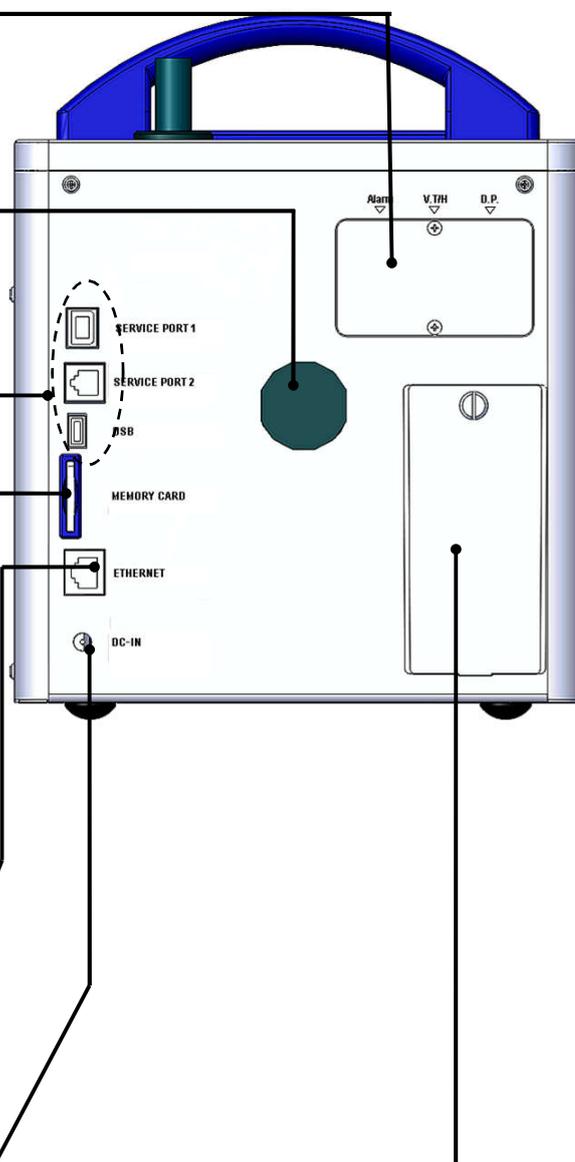

Battery Compartment
 --- Insert rechargeable battery here. Refer to **2.1 Power Supply** for how to install the battery.

2. Getting Started

2.1 Power Supply

Supply power to the main unit.

There are two ways to supply power; using the or a battery.

-- AC Adapter --

Plug the DC output of the AC adapter into the connecting port of this equipment. Then connect the AC adapter to an AC outlet within AC 100-240V output.

Only the provided AC adapter is allowed.

Output voltage DC 15V



Polarity of output voltage ... $\ominus \bullet \oplus$

-- Battery --

Charge the battery by the instrument and then connecting the provided AC adapter.

Refer to **7. Battery** for charging the battery.

You can also charge the battery with the optional charger.

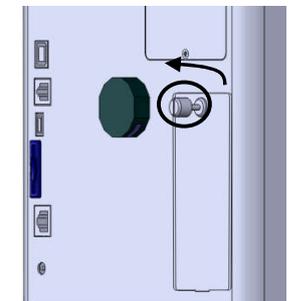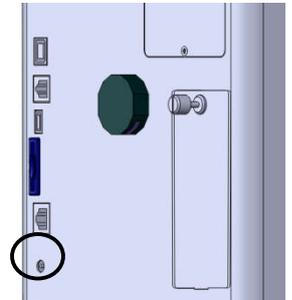

Open the battery compartment cover on the rear of the instrument.

Loosen the screw on the cover to open it.

Connect the battery to the connector inside the compartment.

Insert the battery as shown to the right picture (the connector end should go to the rear of the compartment).


The cover back and tighten the screw to fix the cover.



When you insert the AC adapter, the Power state LED will light up and show red color. And when the batteries are charging, the red LED will blink.

After pressing the POWER switch on the front of the instrument, you will hear a beep sound and the green LED (UP) will light up. If the power is supplied by the AC line, the Power state LED is red and if supplied by battery, the LED is yellow.

Several seconds later, the initial screen appears automatically. Refer to **3. Display Description and Operation Procedure** for the details about the operation screen.

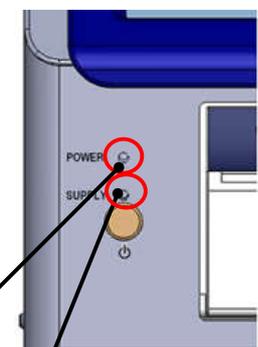

System LED:
Indicates
ON/OFF of
the unit.

Power State LED

2.2 Zero Check

If the internal optical system is dirty, you may not be able to perform an accurate measurement.

To confirm the cleanliness of the internal optical system, perform a Zero Check before measuring.

Remove the rubber cap that is mounted on the inlet on the upper side of the main unit.

Next, attach the zero filter to the inlet using the supplied Tygon tube.

The length of the tube is not critical. However, make sure that the tube is not bent. (Approx. 60cm)


Follow the above procedure in order to prevent particles from entering the instrument.

Perform a measurement for one minute and then perform a Zero Check.

(Refer to **3.4 MONITOR** for the operation procedure.)

Perform a Zero Check at least once a day.

It is recommended a Zero Check be done before and after each measurement.

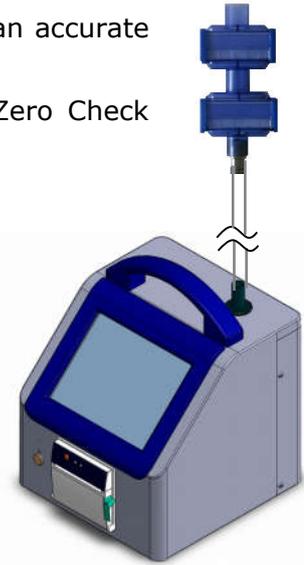


2.3 Isokinetic Suction Probe

Use the Isokinetic Suction Probe to ensure the sampling air velocity is equivalent to the operating environment air velocity. This allows you to perform a measurement without significantly disturbing the normal air flow.

Attach the Isokinetic Suction Probe to the standard inlet by using the provided Tygon tube.

When using the Tygon tube, cut the tube to the most suitable length for your measurement requirements.

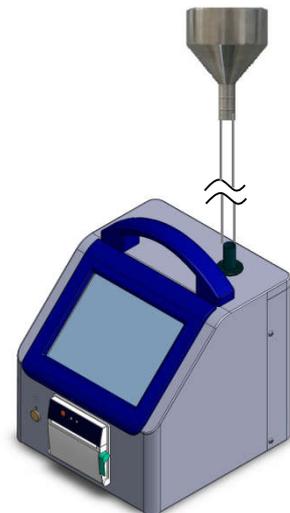


2.4 Consumables

2.4.1 Printer Paper Replacement

When the provided printer paper runs out, please purchase new printer paper (dust free paper), Model 3910-05.

Installing printer paper

1. Press the Paper Cover Open Button to open the paper cover.
2. Place the paper as shown in the picture below.
3. Pull the top of the paper so that a slight portion is sticking out of the printer when the cover is closed.

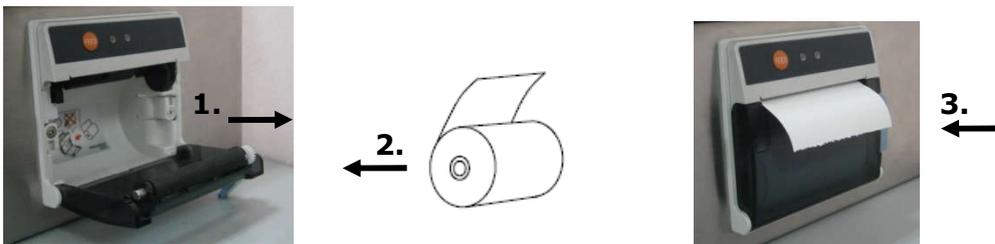

2.4.2 Zero Filter Replacement

If the performance of the provided zero filter is deteriorated, please purchase a new Zero Filter. To replace a Zero Filter, refer to **2.2 Zero Check**.


2.4.3 Isokinetic Suction Probe Replacement

If the provided Isokinetic Suction Probe is damaged or lost or any air leak is detected, please purchase a new Isokinetic Suction Probe, Model 3910-07.

To replace an Isokinetic Suction Probe, please refer to **2.3 Isokinetic Suction Probe**.

3. Display Description and Operation Procedure

3.1 Boot Screen

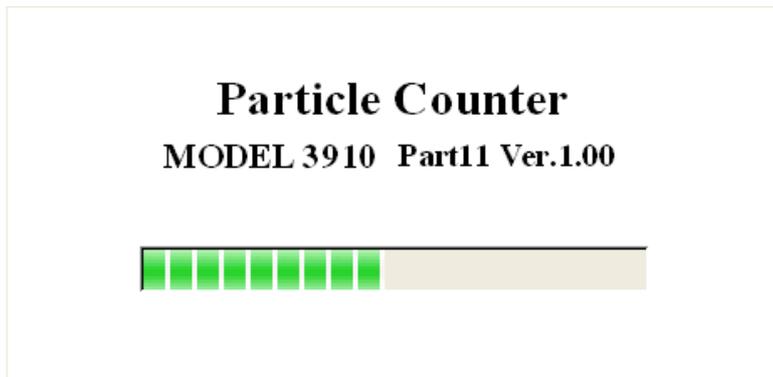

A few seconds after the instrument is turned ON, the screen shown to the left will be displayed.

Please wait for a few moments, while the system is initialized.

3.2 Log-In

3.2.1 Log-In Display

The screenshot shows an 'Authentication' window. At the top, it says 'Authentication'. Below that, there are two input fields: 'USER:' with the text 'administrator' and 'PASSWORD:'. Below the input fields is a numeric keypad (1-0, CLR), a QWERTY keyboard (Q-BS), and a row of function buttons: CAPS, SPACE, SWITCH, ShutDown (red), and OK (green).

Type your user ID and password in the field and press [OK] button.

Press [Shut Down] button to turn off the instrument.

[CAPS] button: To type upper case letters

[SWITCH] button: Jump to next field

[CLR] button: Clear input

[BS] button: Back space, delete the preceding character

3.2.2 User

The instrument manages the usage log based on user ID, manage users from the user setting display (Refer to **User Management**).

User information consists of User name, User ID, Password, and Qualification.

User name: a user name with up to 40 characters

User ID: a user ID with up to 16 characters.

Password: The instrument recognizes users with the combination of user ID and Password. Passwords need to be 4 to 16 alphanumeric characters. Passwords expire every 180 days, after which the user ID will be invalid until a new password is set.

Qualification: Each user is granted authorization to perform certain operations. For example, if a user has authorization for [Change Measurement Setting] operation, the user cannot change the measurement settings. If the current logged in user does not have the authorization to carry out a certain operation, the button for that operation is deactivated. Even if a user has authorization, the user will need to enter his/her user name and password every time before initiating an action that requires authorization.

The administrator can reset passwords for any users in case of a lost or forgotten password (Refer to **3.8.3. Other - User Management**).

If the administrator forgets his/her password, nobody can operate the instrument. Kanomax strongly recommend registering multiple administrator users on the instrument.

3.2.3 Authentication

The screenshot shows an 'Authentication' dialog box. At the top, the title 'Authentication' is centered. Below the title, there are two input fields: 'USER:' with the text 'administrator' and 'PASSWORD:' which is empty. Below the input fields is a numeric keypad with buttons for digits 1-0 and a 'CLR' button. Below the numeric keypad is an alphanumeric keypad with buttons for letters Q-Z, '+', and '/', and a 'BS' button. At the bottom of the dialog are four buttons: 'CAPS', 'SPACE', 'SWITCH', and 'CANCEL', followed by a green 'OK' button.

Logging in and certain activities require user authentication.

User ID and password are required when a user logs in the instrument.

Only a password is required for other activities.

If a user fails to log in three times, the user ID will become invalid.

3.2.4 Log

The instrument saves a history of operations, error messages, and alarms in the log file.


The operation log stores the time, User ID, operation detail, result, and parameter of the occurrence.

A user can review logs on the "Log Maintenance" screen (**Authentication required**).

(Please refer [3.8.3 Other](#) for details on the operation log.)

3.3 Initial Screen


3.3.1 Initial Screen

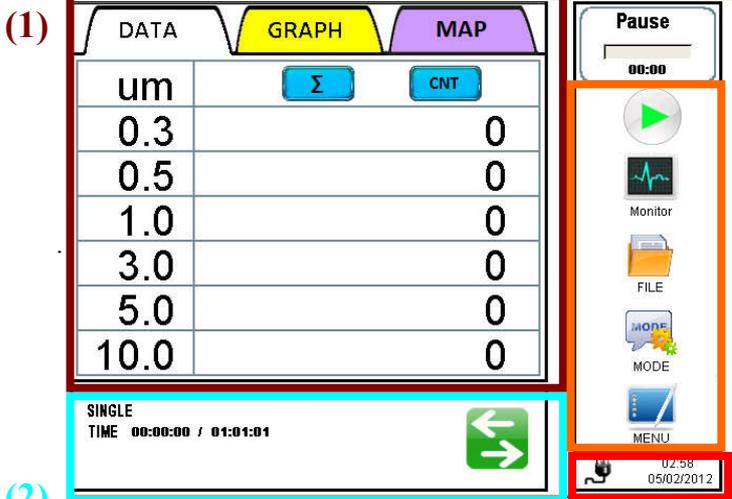


After the instrument is booted up and a user has logged in, the initial screen shown to the left will be displayed.

(2) All operations can be started from this screen.


When the measurement parameters are displayed, you can tap the "switch" button to show the ambient parameters if an option sensor is attached.

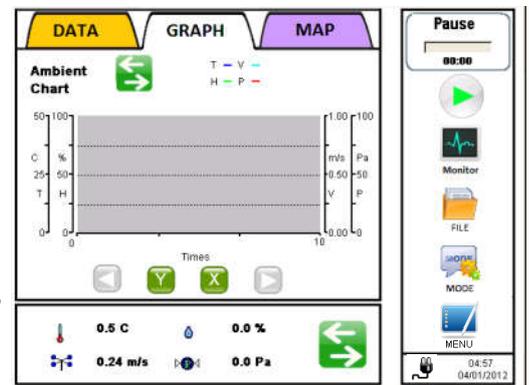

Tap the title to switch between data, graph and map.

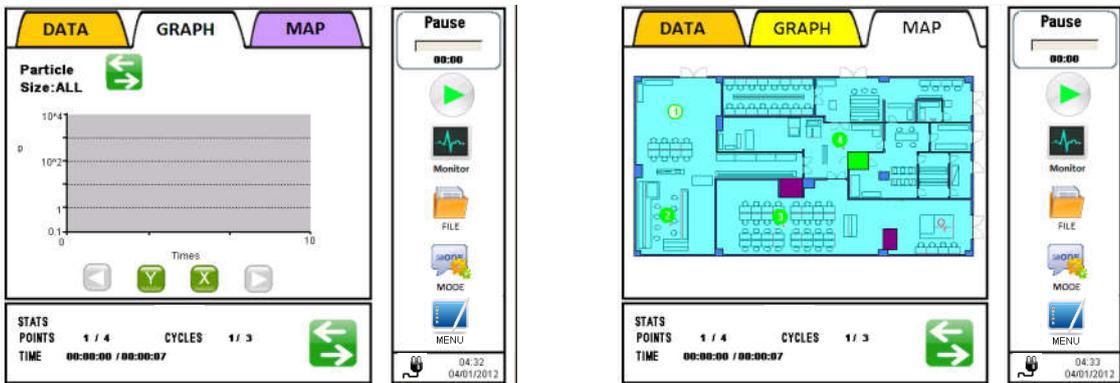

When a chart is displayed, users can change the particle chart to the ambient chart by tapping the button.

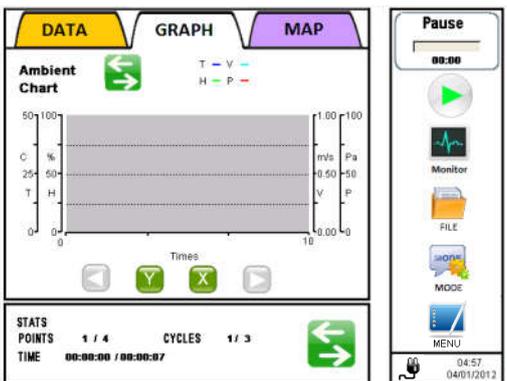

- (1) Data Display: Displays numeric value, chart and map.
- (2) Measurement Condition/ Environment Data: Displays measurement mode, measurement setting and measurement status/
Displays the current status when using option sensors.
- (3) Status Display: Displays the status of power source, pump, LD error, over count.
- (4) START:  Starts measuring in the configured mode. This button becomes "STOP" button after sampling starts. Tap "STOP" button to stop sampling.
- MONITOR:  Performs a measurement and displays a measurement value. This mode does not save measurement results. The measurement display value is updated every second.
-  Selects measurement mode. Select either "SINGLE", "CONTINUOUS", "INTERVAL", "STATS", "STANDARD" or "REMOTE" mode. Configures advanced settings in items such as INTERVAL, SAMPLE T. and CYCLES can be set in each mode. In "PRESET" loads stored measurement setting file.
- FILE:  Loads, prints and deletes stored measurement data.
- MENU:  Configures chart settings, alarm settings and system settings.

<Icons in the Status Display>



Indicates if the instrument is powered by the AC power cord or a battery. If it's battery-powered, the remaining battery level is also shown.



Indicates a pump error status. If the pump is operating abnormally, this icon will be shown.



Indicates an LD error status. If the LD is operating abnormally, this icon will be shown.



Indicates if the measurement count per second exceeds the maximum measurable concentration.



Indicates if an instrument Alarm error is occurring. Tap this icon to cancel the Alarm sound.



Switches between Total display and Single display.



 is displayed when Total display is selected.  is displayed when Single display is selected.


The range of indicated data is as follows:

Channel	Total Display	Single Display
0.3um	$X \geq 0.3\text{um}$	$0.3\text{um} \leq X < 0.5\text{um}$
0.5um	$X \geq 0.5\text{um}$	$0.5\text{um} \leq X < 1.0\text{um}$
1.0um	$X \geq 1.0\text{um}$	$1.0\text{um} \leq X < 3.0\text{um}$
3.0um	$X \geq 3.0\text{um}$	$3.0\text{um} \leq X < 5.0\text{um}$
5.0um	$X \geq 5.0\text{um}$	$5.0\text{um} \leq X < 10.0\text{um}$
10.0um	$X \geq 10.0\text{um}$	$X \geq 10.0\text{um}$


* X: detected particle count

The numeric value will be indicated in black when Total display is set and in gray when Single display is set.


<Charts >

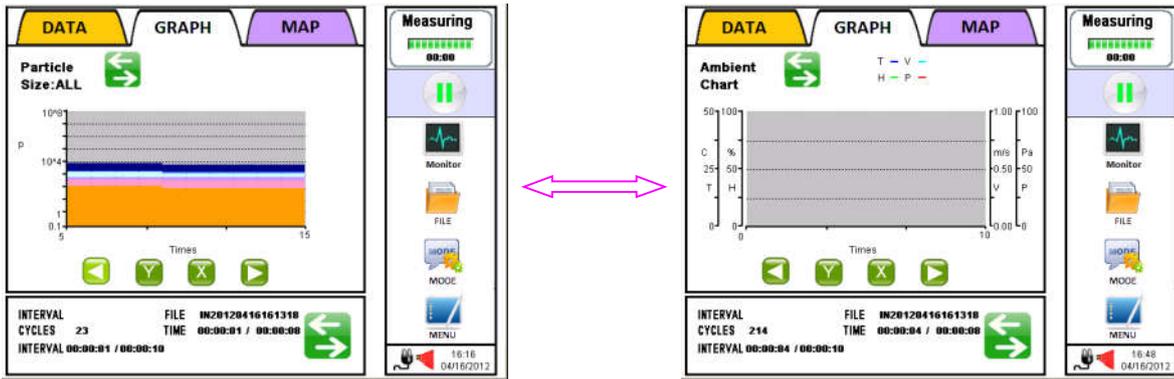


 : Switches the display between the particle chart and the OP sensor chart on the GRAPH screen.

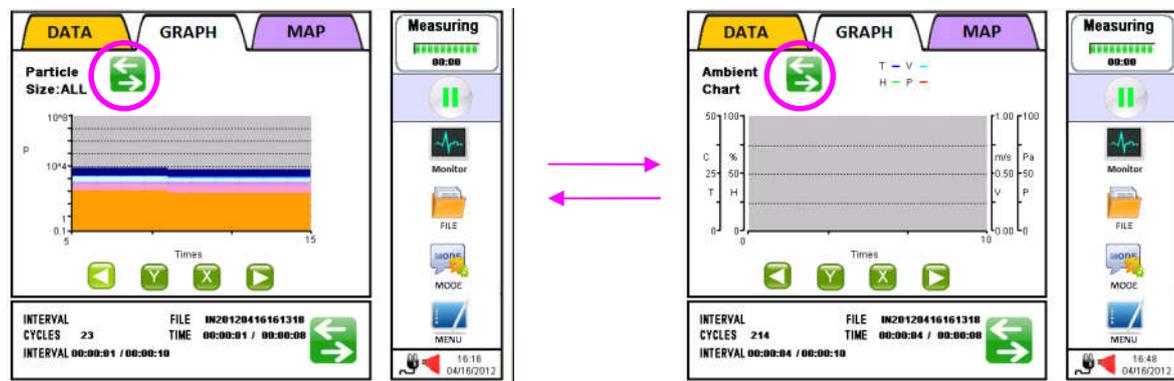

 : Scrolls the chart to the left (half of the display can be scrolled at a time).

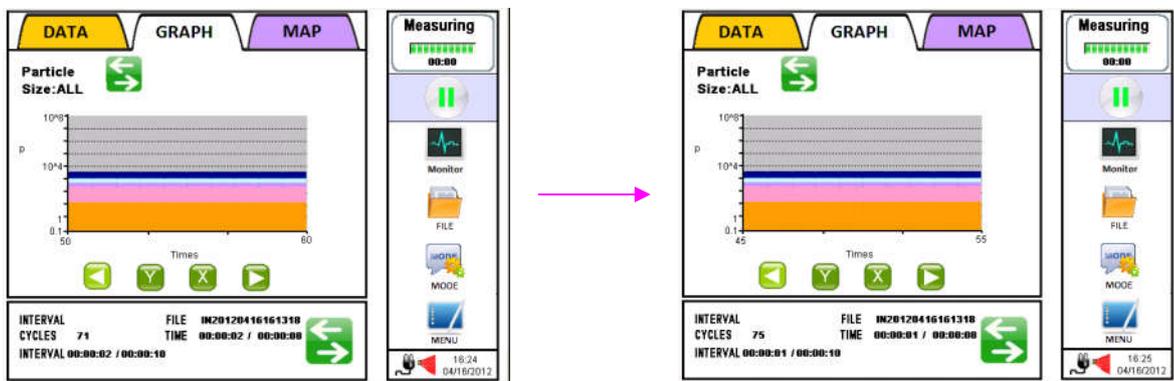


 : Scrolls the chart to the right (half of the display can be scrolled at a time).

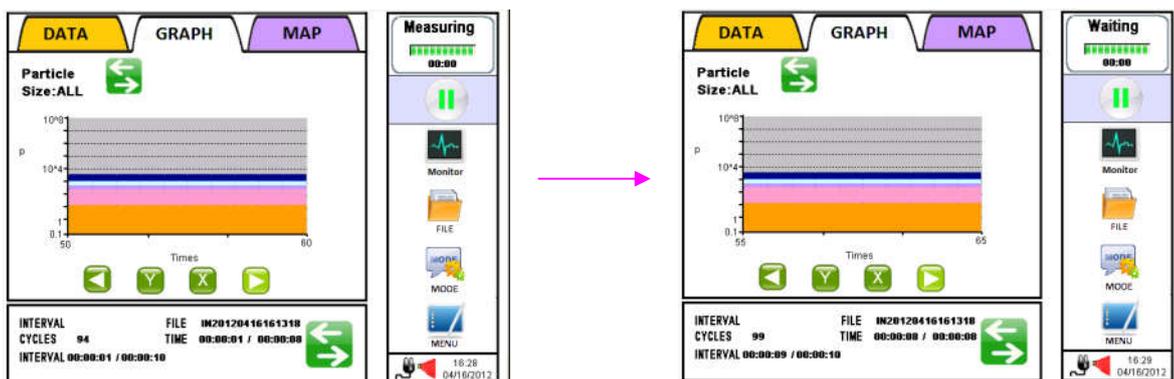


Y : Sets the range of the Y axis.

Particle Graph (Example) :

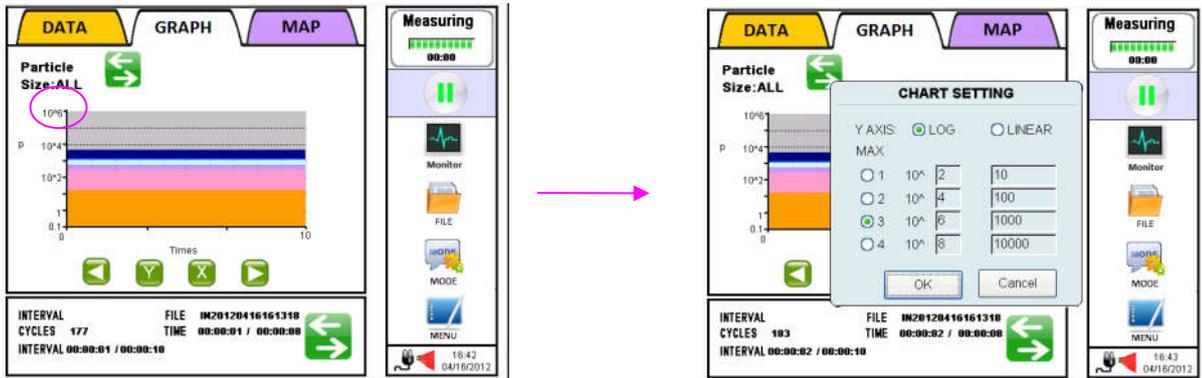


Select either LOG or LINEAR for the Y axis. Select the maximum scale value from four options. For setting the four maximum values, please refer to 3.8.1 MEASURING – CHART SETTING. In the display shown above, LOG is selected for the scale of the Y axis and the maximum scale value of the Y axis is set to 10 to the sixth.

Option Sensor Graph (Example) :

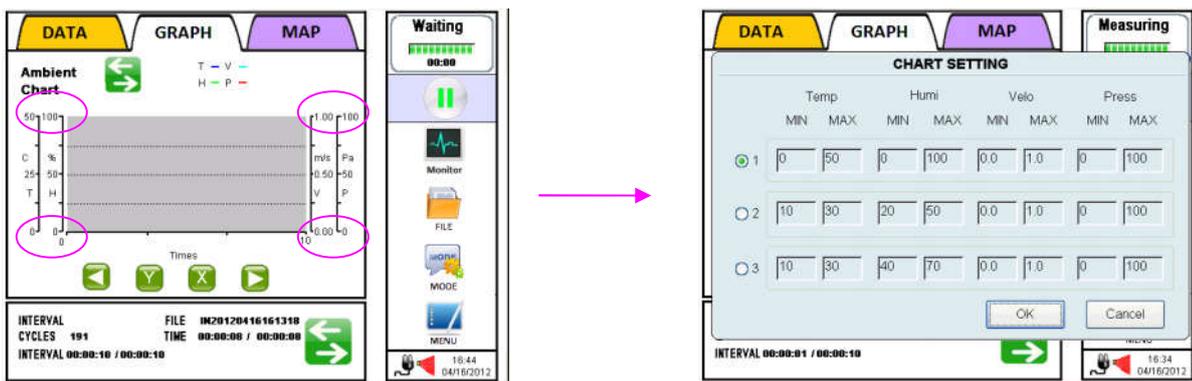


Select one of the three combinations of minimum and maximum scale values of the Y axis for each sensor. For setting the combination of minimum and maximum values, please refer to 3.8.1 MEASURING – CHART SETTING.

X : Sets the range of the X axis.

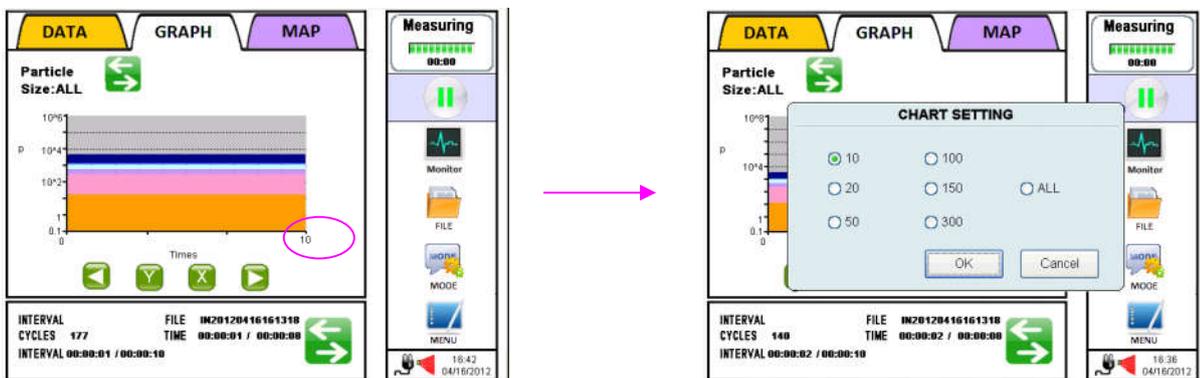


10	Sets the maximum scale value of the X axis to 10.
20	Sets the maximum scale value of the X axis to 20.
50	Sets the maximum scale value of the X axis to 50.
100	Sets the maximum scale value of the X axis to 100.
150	Sets the maximum scale value of the X axis to 150.
300	Sets the maximum scale value of the X axis to 300.
ALL	Displays all data.



3.3.2 Screen Change – Initial Screen

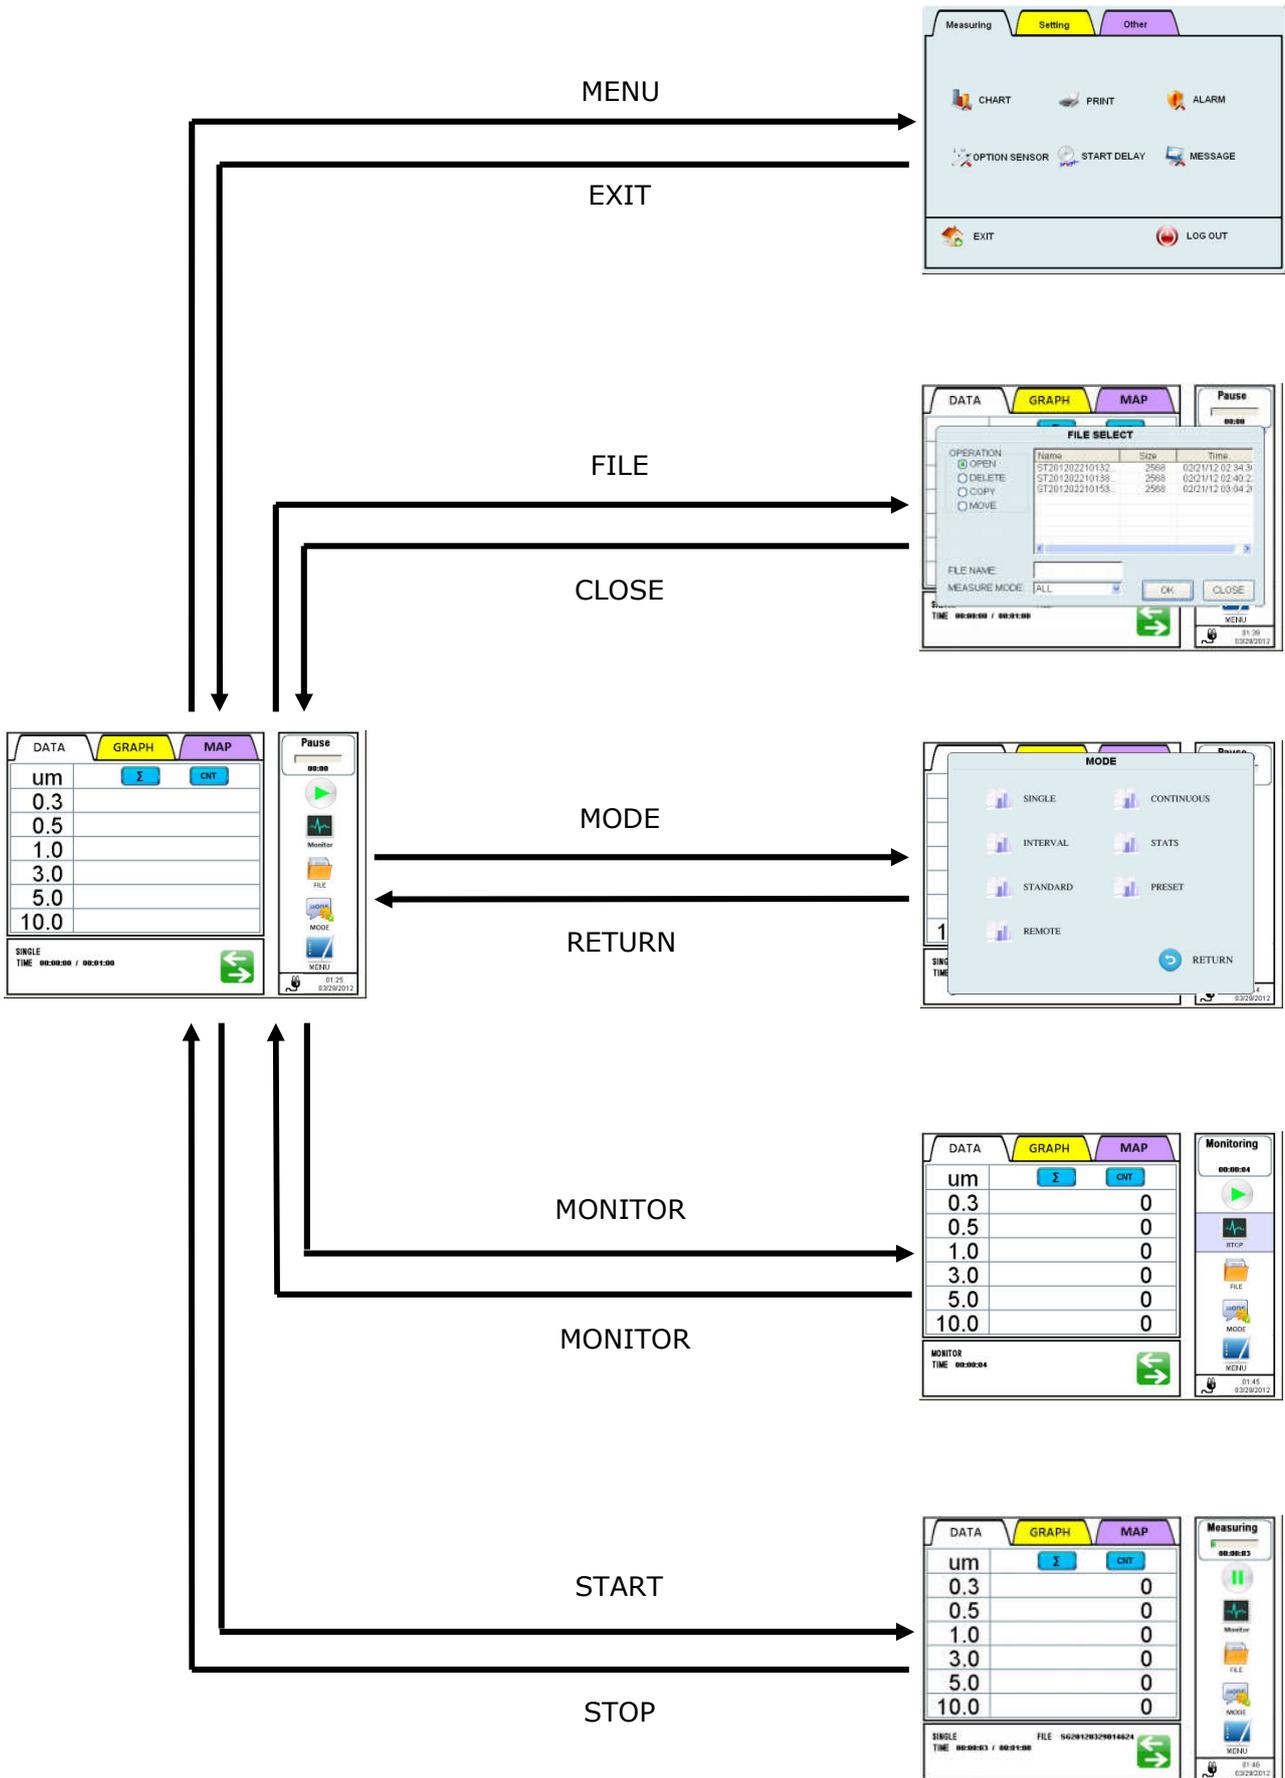


3.4 MONITOR

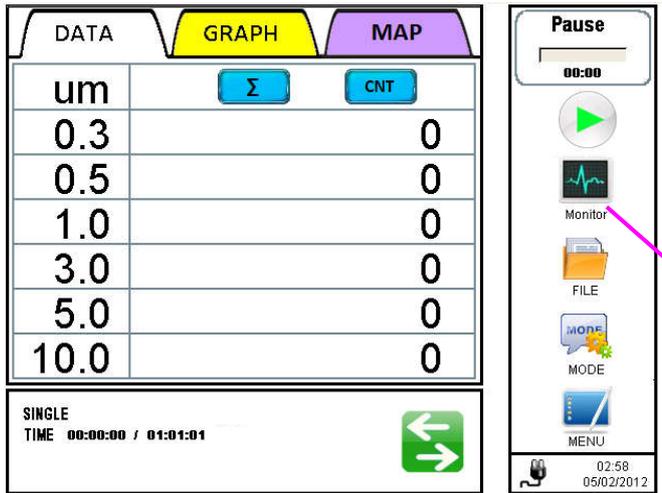

Tap [MONITOR] on the initial screen to start monitoring. Sampling will start in 10 seconds after the pump starts operating.

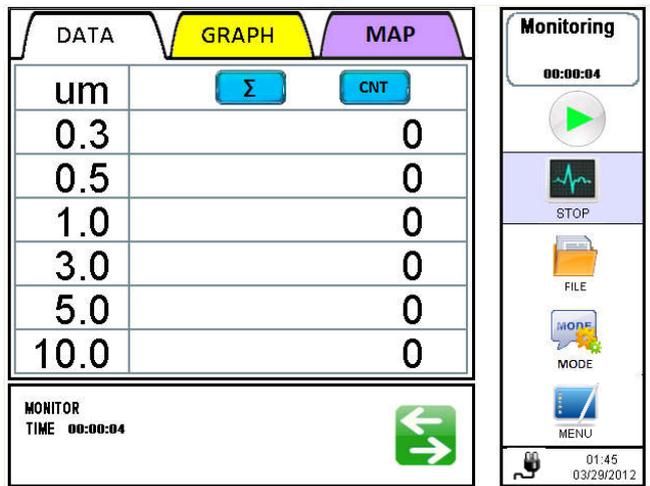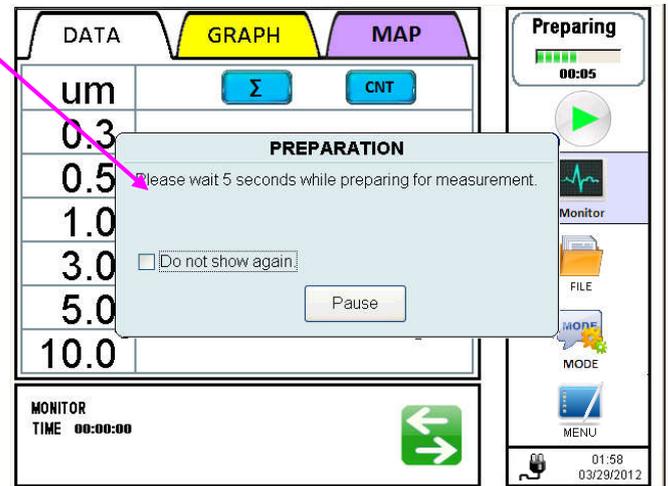

- * Note that if the pump is already operating, sampling will start immediately when you tap [MONITOR].
- * Note that the instrument is capable of 180 hours of continuous operation.

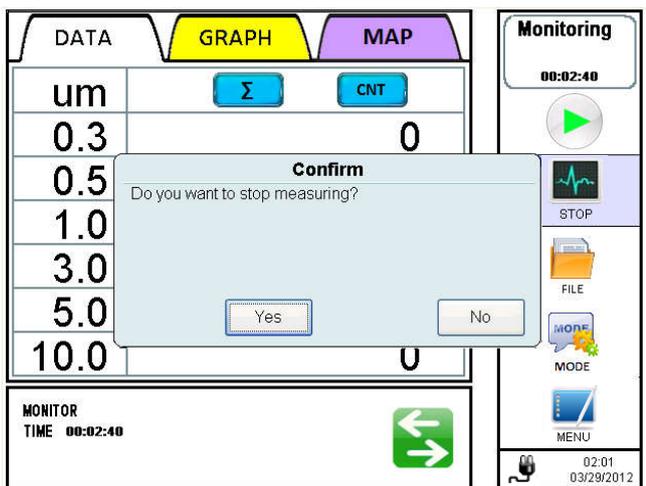


While measuring, tap [MONITOR] again. A dialog will be displayed asking you if you want to stop monitoring. Tap [Yes] to stop monitoring.

Note that you cannot save measurement data or display the chart when you are monitoring in this mode.

3.5 MODE

Tap [MODE] to display the mode selection window.

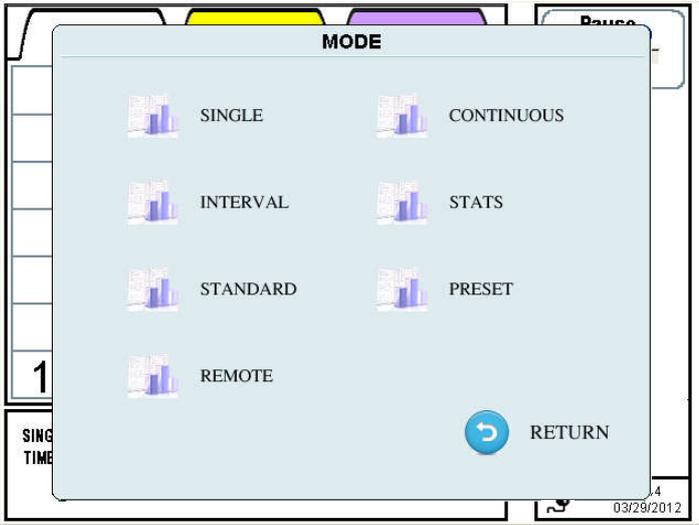

***User needs to have the authorization (Change Measurement Mode) to change measurement mode.**

In the Mode setting screen you can configure measurement settings in each mode.

Select a mode from below and tap it; "SINGLE", "CONTINUOUS", "INTERVAL", "STATS", "STANDARD", "PRESET", "REMOTE".

You can set items such as INTERVAL, SAMPLE T., CYCLES, MANUAL STOP, AUTO SAVE, AUTO PRINT and START DELAY. Please note that the setting items vary depending on the measurement mode.

*Note that the instrument is capable of 180 hours of continuous operation in every measurement mode.

3.5.1 SINGLE


[Measurement Flow]

Perform a measurement once within the pre-set time frame.

Example: If the setting is as follows:

- INTERVAL: N/A
- SAMPLE T.: 00:00:15
- CYCLES: N/A


A 15 second sampling is performed.

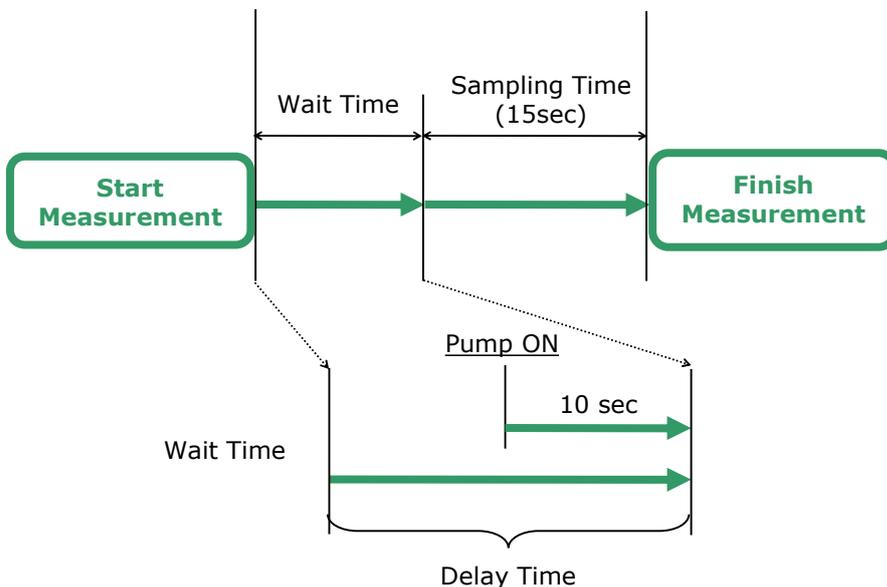

* Delay Time: Set Delay Time in START DELAY screen (Refer to **3.8.1**).


[Delay Time]

You can set Delay Time in the START DELAY screen. Please refer to [3.8.1](#) for details. Below is a breakdown of the Wait Time.

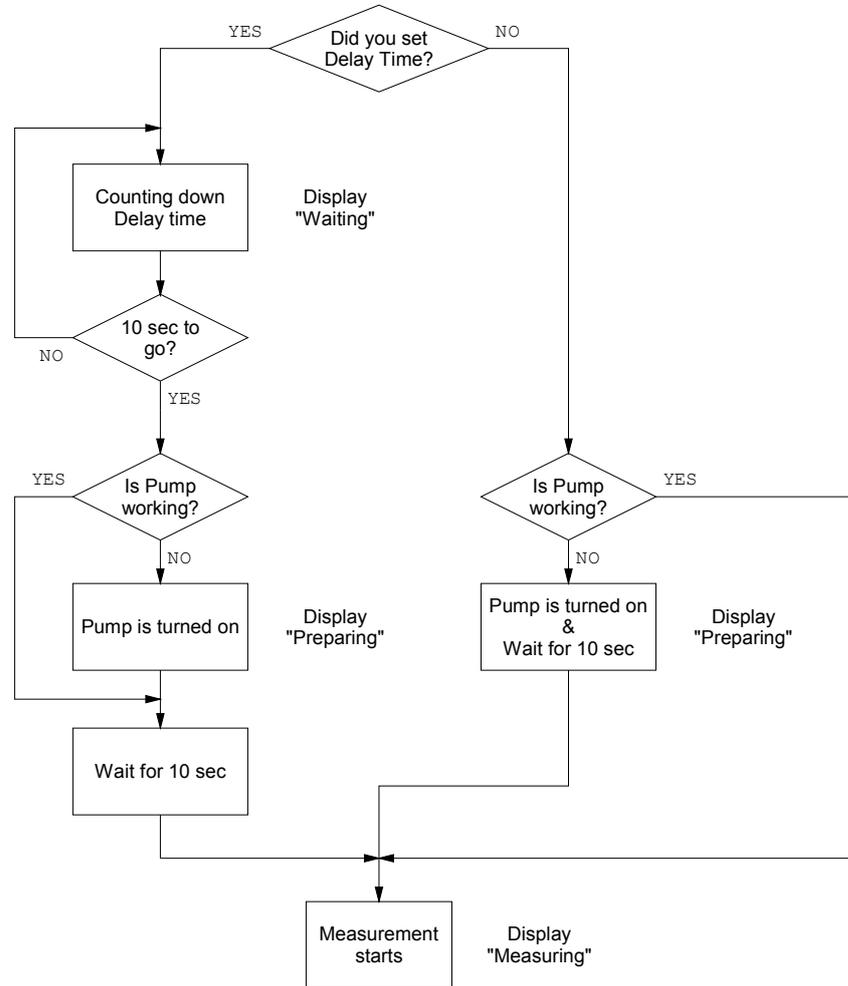

[Measurement Settings]


Tap [SINGLE] to open the [MEASURE SETTING] dialogue box.

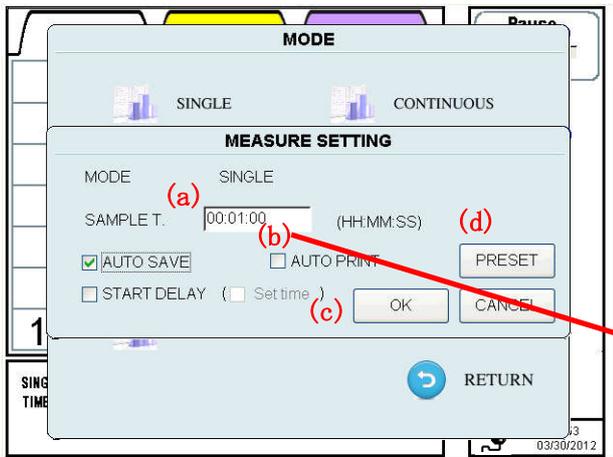

[SAMPLE T.] (Sampling Time).

Tap the entry field (a) to display a numeric keypad.

Enter "hours", "minutes" and "seconds" on the numeric keypad and tap [OK] (b).

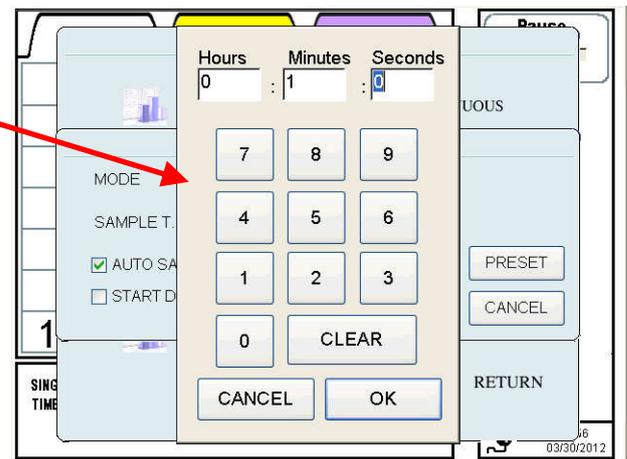

Check "AUTO SAVE" to store the data automatically.



Check "AUTO PRINT" to print the data automatically.

Check "START DELAY" to use a delay time prior to a measurement.

Check "Set time" to set the time when you want to start a measurement.

Tap [OK] (c) to save and activate the settings (**Authentication required**).

[PRESET]

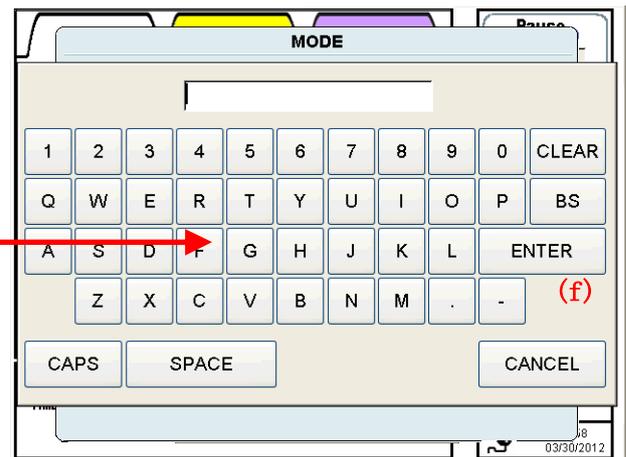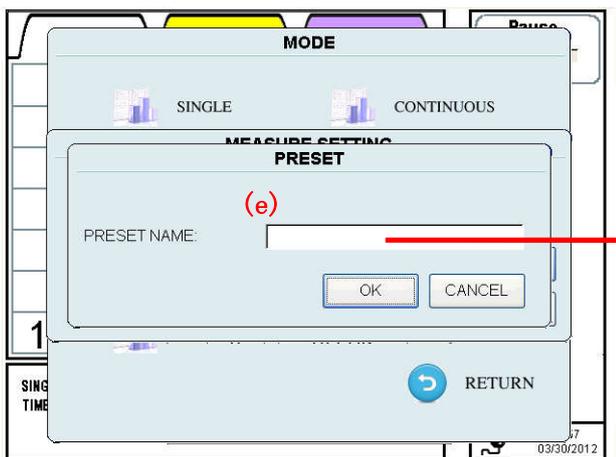

Tap [PRESET] (d) on "MEASURE SETTING" dialog box to display a window asking you to input PRESET NAME.

Tap the entry field (e) to display the keyboard. Enter the file name and tap [Enter] (f).

Tap [OK] to save the current settings on the USB flash drive (**Authentication required**).

* In the future you can automatically load the configuration saved here as a PRESET. Refer to **3.5.6 PRESET**.

3.5.2 CONTINUOUS



[Measurement Flow]

Start/Stop measuring manually.

Example: If the setting is as follows:

INTERVAL : N/A
 SAMPLE T. : N/A
 CYCLES : N/A

A continuous measurement is performed until you manually stop it.

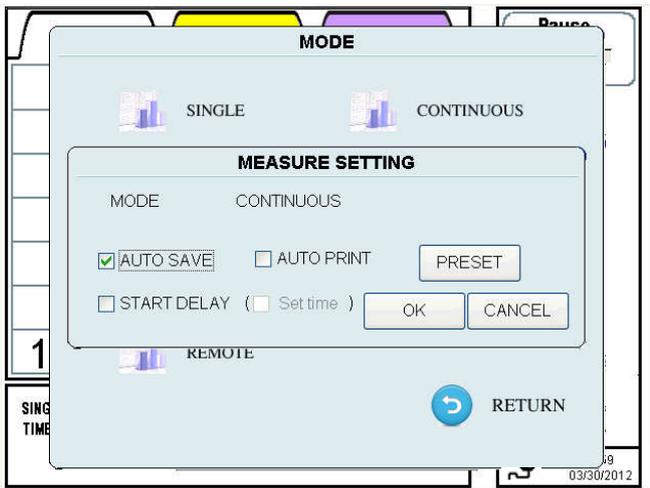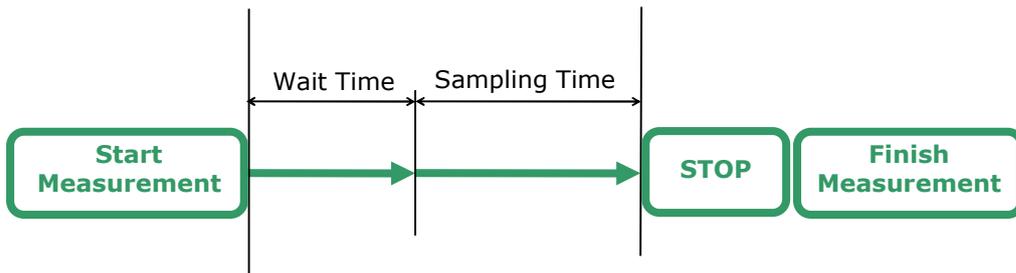

[Measurement Settings]


Check "AUTO SAVE" to store the data automatically.

Check "AUTO PRINT" to print the data automatically.

Check "START DELAY" to use a delay time prior to a measurement.

Check "Set time" to set the time when you want to start a measurement.

Tap [OK] to save and activate the current settings (**Authentication required**).

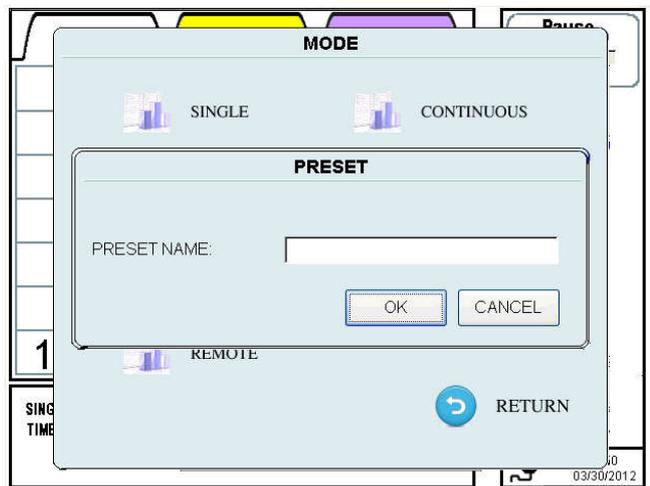

[PRESET]

Tap [PRESET] to display a window asking you to input "PRESET NAME".

Tap the entry field to display the keyboard. Enter the file name and tap [Enter].

Tap [OK] to save the current settings on the USB flash drive (**Authentication required**).

* In the future you can load the configuration saved here as a PRESET. Refer to **3.5.6 PRESET**.

<Input PRESET NAME>

3.5.3 INTERVAL

[Measurement Flow]

Configure INTERVAL, SAMPLE T and CYCLES, and repeat measuring.

Example: If the setting is as follows:

INTERVAL: 00:01:00


SAMPLE T.: 00:00:15

CYCLES: 20


A total of 20 measurements are performed at one minute intervals.

Note: Sampling time is 15 seconds and standby time is 45 seconds.

Measurement Flow

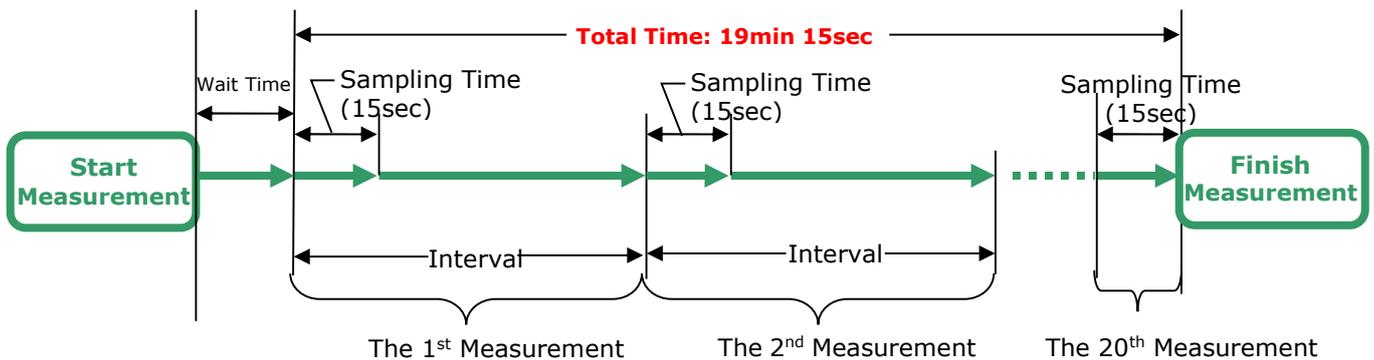

If the time period between two samplings is 10 seconds or longer, the pump will be turned OFF after a sampling is finished. Then the pump will be turned ON again 10 seconds before the next sampling starts.

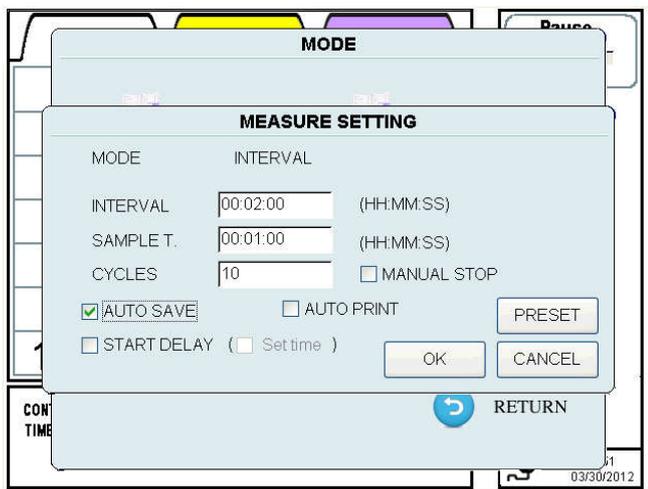

[Measurement Settings]

You can set INTERVAL, SAMPLE T., CYCLES and MANUAL STOP.

To set INTERVAL and SAMPLE T, tap the entry field to display a numeric keypad. Enter "hours", "minutes" and "seconds", and tap [OK].

Tap the entry field for CYCLES to display a numeric keypad. Tap the value you want to enter and tap [Enter].

Check "MANUAL STOP" to continue measuring until you stop measuring regardless of the CYCLES setting.


Check "AUTO SAVE" to store the data automatically.

Check "AUTO PRINT" to print the data automatically.

Check "START DELAY" to use a delay time prior to a measurement.

Check "Set time" to set the time when you want to start a measurement.

Tap [OK] to save and activate the settings (**Authentication required**).

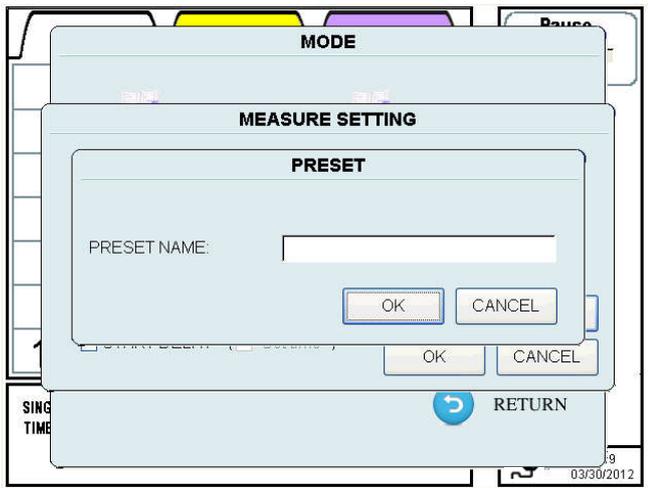

<Input PRESET NAME>

[PRESET]

Tap [PRESET] to display a window asking you to input "PRESET NAME".

Tap the entry field to display the keyboard. Enter the file name and tap [Enter].

Tap [OK] to save the current settings on the USB flash drive (**Authentication required**).

* In the future you can automatically load the configuration saved here as a PRESET. Refer to **3.5.6 PRESET**.


3.5.4 STATS

[Measurement Flow]

Configure SAMPLE T., CYCLES and SAMPLE POINT, and repeat measuring.

In STATS mode, INTERVAL and SAMPLE T. are configured with the same value. Measurements are repeated according to the CYCLES settings in each SAMPLE POINT.

As for the measurement condition, you can configure the settings.

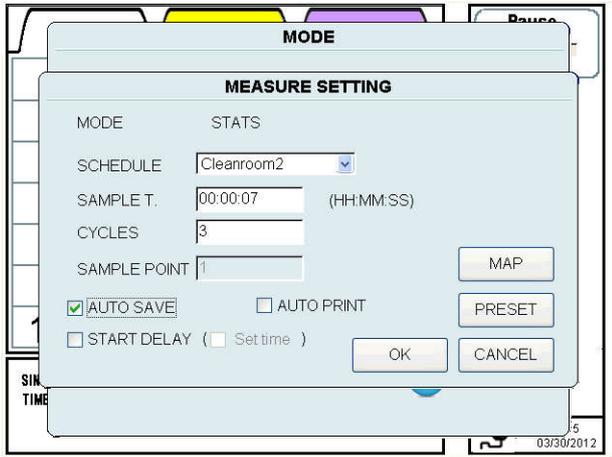

<MEASURE SETTING>


Check "AUTO SAVE" to store the data automatically.

Check "AUTO PRINT" to print the data automatically.

Check "START DELAY" to use a delay time prior to a measurement.

Check "Set time" to set the time when you want to start a measurement.

Tap [OK] to save and activate the settings (**Authentication required**).

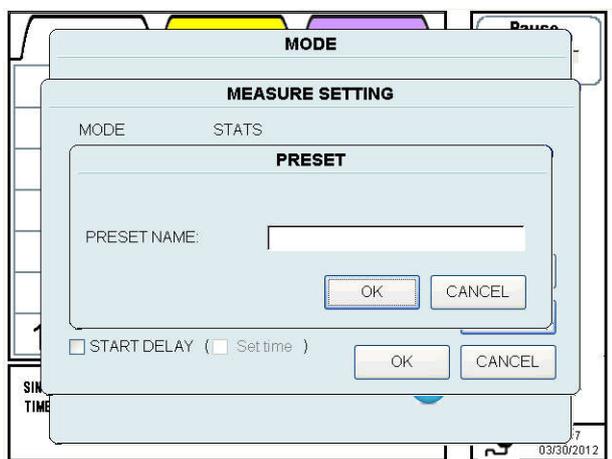

<Input PRESET NAME>

[Measurement Settings]

If there are any MAP files saved, they are displayed in the dropdown list of SCHEDULE. When measuring by using a MAP file, select a FILE from the list.

Tap the entry field for "SAMPLE T". to display a numeric keypad. Enter "hours", "minutes" and "seconds" on the numeric keypad and tap [OK].

Tap the entry field of "CYCLES" to display a numeric keypad. Enter a value and tap [ENTER].

Once a MAP file is loaded, you cannot change the settings for SAMPLE POINT. (The configured number of measurement points in the MAP file will be applied.)

When a MAP file is not loaded, tap an entry field of "SAMPLE POINT" to display a numeric keypad. Enter a value and tap [ENTER].


[PRESET]

Tap "PRESET" to display a window asking you to input "PRESET NAME".

Tap the entry field to display the keypad. Enter the file name and tap [Enter].

Tap [OK] to save the current settings on the USB flash drive (**Authentication required**).

* In the future you can automatically load the configuration saved here as a PRESET. Refer to **3.5.6 PRESET**.

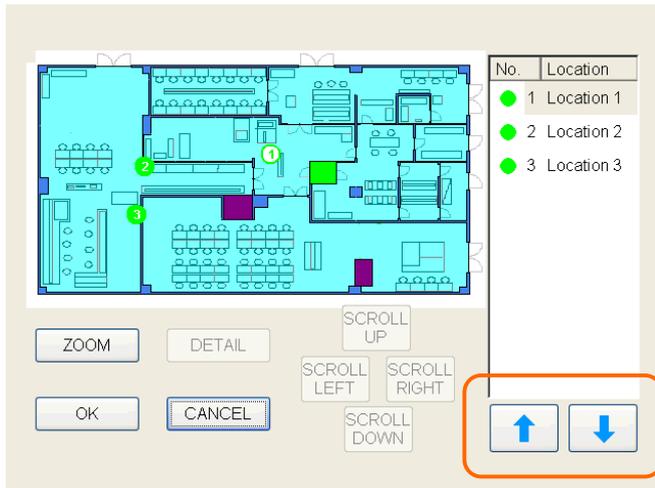


When a MAP file is specified in "SCHEDULE" on the "MEASURE SETTING" screen, tap [MAP] to display a MAP.

You can change the location order.

Tap the Location to be changed.

Use the  and  buttons to change the order.

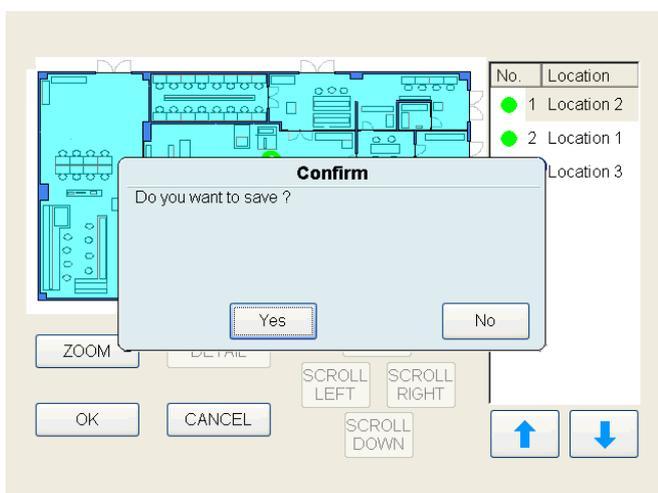

Tap [OK]. Then a window will be displayed asking if you want to save the new order of the Location. Tap [Yes] or [No] (**Authentication required**).

Tap [Yes] to set the changes and go back to "MEASURE SETTING" screen.

Tap [No] to go back to MAP screen.

Tap [CANCEL] to discard the changes and go back to "MEASURE SETTING" screen.

3.5.5 STANDARD

[Measurement Flow]


You can perform a measurement which complies with 7 measurement standards as follows:

- ISO14644-1 (International Standard) Refer to ISO14644-1.
- ISO 14644-1 SEQUENTIAL SAMPLING (International Standard) Refer to ISO14644-1.
- FEDERAL STANDARD (m) (The US Standard) Refer to FEDERAL STANDARD 209E.
- FEDERAL STANDARD (ft) (The US Standard)
- BRITISH STANDARD (British Standard) Refer to BS-5295.
- EC GMP (European Standard) Refer to EC GMP.
- GB/T 16292-1996 (Chinese Standard) Refer to GB/T 16292-1996.

You can set [SAMPLE T.], [CYCLES], and [SAMPLE POINT] to repeat measurements.

INTERVAL and SAMPLE T. are configured with the same value. Measurements are repeated according to the CYCLES setting in each SAMPLE POINT.

After the all the measurements are finished, the results are evaluated according to the selected standard.

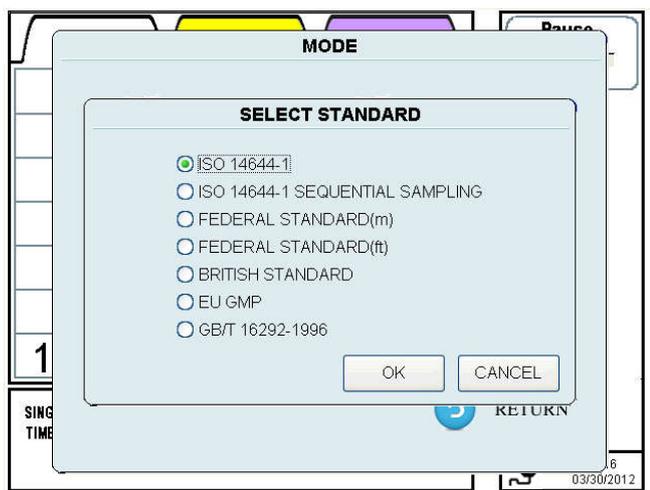


Tap [STANDARD] to open the SELECT STANDARD window to select a measurement standard to be applied in the STANDARD mode.

Select and set one of the above measurement standards.

Tap [OK] to display the MEASURE SETTING screen to configure measurement settings.

Tap [CANCEL] to go back to [MODE] screen.

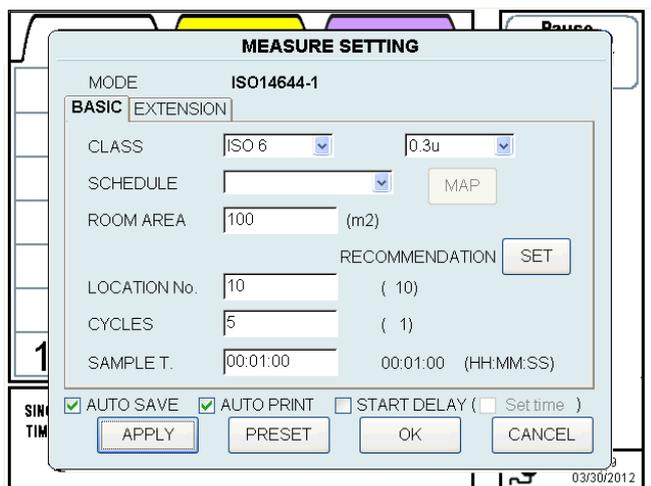


[Measurement Settings]

The setting items for CLASS and items in the EXTENSION tab varies depending on the STANDARD settings you configured.

In the BASIC tab;
Configure the settings of CLASS, SCHEDULE, ROOM, LOCATION, CYCLES and SAMPLE T.

- CLASS:** Set the cleanliness level of the cleanroom to be measured. After configuring this setting, the appropriate particle size for the configured CLASS can be selected.
- SCHEDULE:** You can load a MAP file. If you select the file, the MAP function will be activated and the MAP will be displayed.
- ROOM:** Input the size of the room to be measured.
- LOCATION:** Input the number of measurement points.
- CYCLES:** Input the measurement cycles.
- SAMPLE T.:** Input the sampling time.

The numeric value shown next to the each entry field is the recommended value based on CLASS, ROOM and AIR DIRECTION (in EXTENTION tab). Tap [SET] to use the recommended value.

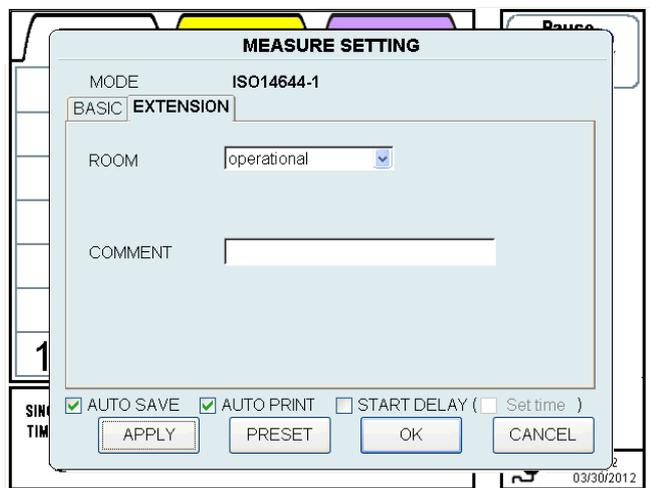

Tap [APPLY] to save the new settings. **(Authentication required).**

Tap [OK] to save the new settings and return to MODE screen. **(Authentication required).**

Tap [CANCEL] to discard the changes and close the window.

Check "AUTO SAVE" to store the data automatically.
 Check "AUTO PRINT" to print the data automatically.
 Check "START DELAY" to use a delay time prior to a measurement.

In the EXTENTION tab, configure the following;

- **ROOM STATUS**
- **AIR DIRECTION** (only for Federal Standard)
- **COMMENT**

[AIR DIRECTION]

- Select **unidirectional** when wind direction is constant.
- Select **nonunidirectional** when wind direction is not constant.


[ROOM STATUS]

Select either **as-built**, **as-rest** or **operational**.

- Select **as-built** when the cleanroom is setting up.
- Select **as-rest** when the cleanroom function is off.
- Select **operational** when the cleanroom function is on.

[COMMENT]

Tap the entry field to display a keypad. Enter comment and tap [Enter].

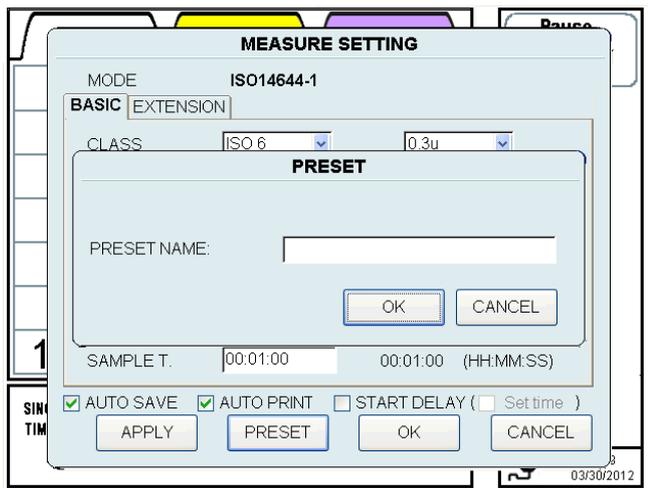


[PRESET]

Tap [PRESET] to display a window asking you to input PRESET NAME.

Tap the entry field to display the keyboard. Enter the file name and tap [Enter].


Tap [OK] to save the current settings on the USB flash drive. You can configure the saved measurement settings by loading a saved PRESET (**Authentication required**).

Refer to **3.5.6 PRESET**.

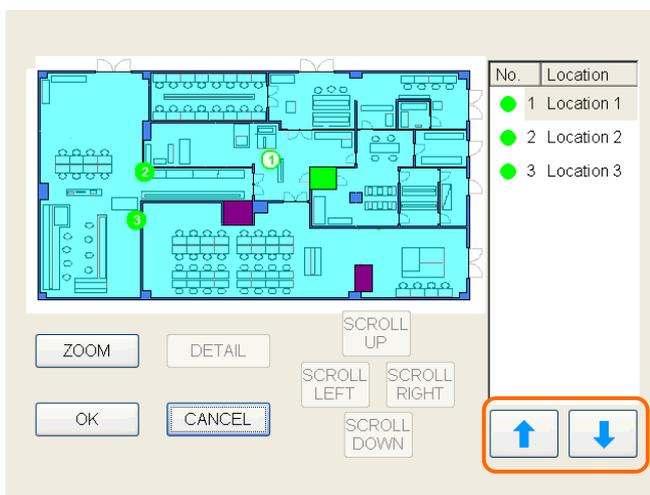

Tap the [MAP] button to display MAP.

You can change the location order by tapping the Location to be changed and then using the  and  buttons.

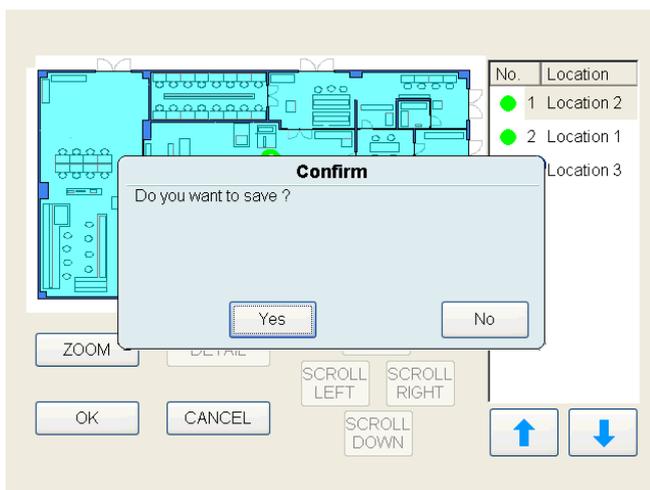

Tap [OK]. Then a window will be displayed asking if you want to save the new order of the Locations. Tap [Yes] or [No].


Tap [Yes] to save the changes and go back to "MEASURE SETTING" screen

(**Authentication required**).

Tap [No] to go back to display MAP.

Tap [CANCEL] to discard the changes and go back to "MEASURE SETTING" screen.

3.5.6 PRESET

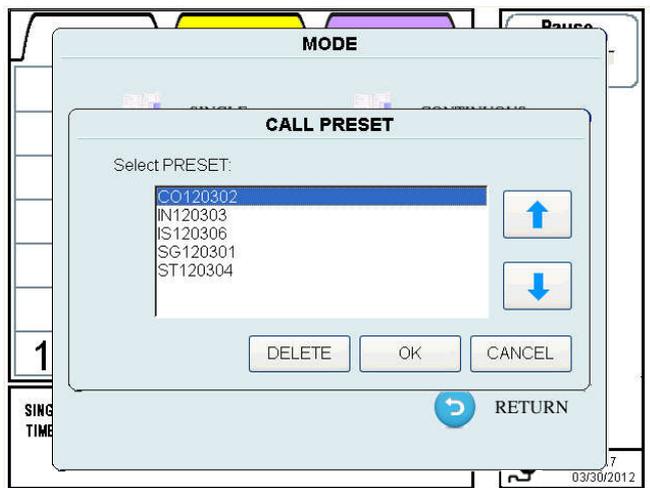

Select the item that you want to load or delete.
 Tap [OK] to load the selected PRESET settings into MODE and MEASURE SETTING (**Authentication required**).
 Tap [DELETE] to delete the selected PRESET setting (**Authentication required**).

3.5.7 REMOTE

Working in REMOTE MODE now.
To return MEASURE MODE, press RETURN button.

COUNTS		OPTION SENSORS:		TIME(s)	ERROR
0.3um	0	Temp(degC)	----	9	0
0.5um	0	Humi(%)	----		
1.0um	0	Velo(m/s)	----		
3.0um	0	Press(Pa)	----		
5.0um	0				
10.0um	0				

STATUS:

Machine ID:

HOST NAME:

Host IP:

Select "PRESET" on the mode screen to display CALL PRESET screen.

The settings in the selected PRESET file will be reflected in the MODE and Measurement Settings.

***User needs to have the authorization (Delete Files) to delete "PRESET" files.**

The first two letters of the file name indicates the mode type.


SG: SINGLE MEASUREMENT
 CO: CONTINUOUS MEASUREMENT
 IN: INTERVAL MEASUREMENT
 ST: STATS MEASUREMENT
 IS: STANDARD MEASUREMENT

Change to REMOTE MODE to perform a measurement from a PC connected via Ethernet using the remote sampling software.

Tap [RETURN] to return to [MODE] screen.

3.6 START

3.6.1 SINGLE, CONTINUOUS, INTERVAL

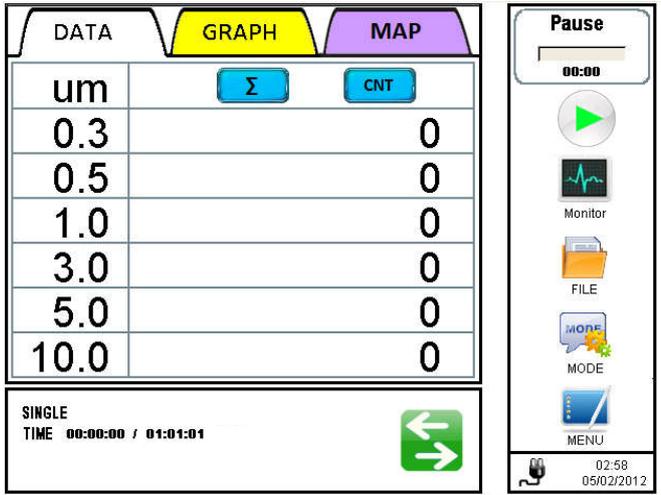

Tap [START] on the main screen to start a measurement using the settings configured in **3.5 MODE** .

- If **"START DELAY"** is **NOT** checked in **"MODE"** setting:

Upon tapping [START], the pump will begin running. After the pump has run for 10 seconds to stabilize, the measurement will begin


- If **only "START DELAY"** is checked in **"MODE"** setting:

Upon tapping [START], the Delay Time begins. During the last 10 seconds of that Delay Time the pump will run to stabilize, after which the measurement will begin.


- If **"START DELAY"** and **"Set time"** are checked in **"MODE"** setting:

- Upon tapping [START], "Input START TIME" dialog box will be displayed. Enter the time when you want to start measuring and tap [OK]. During the last 10 seconds of the [Time left] time the pump will run to stabilize, after which the measurement will begin.

Tap [CANCEL] to go back to the menu screen.

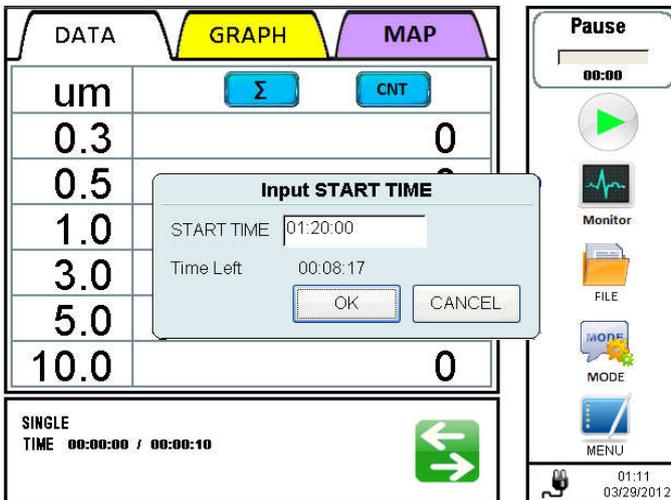

<Input START TIME dialog box>

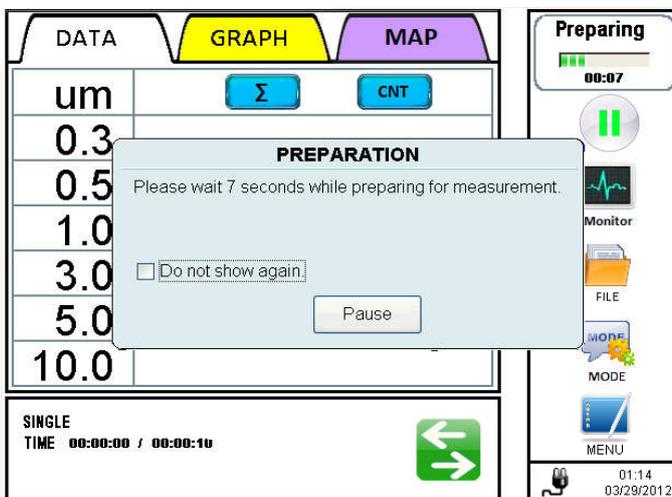


If you fail to press [OK] after entering "START TIME", and the entered START TIME arrives, the instrument will increase the start time in 10 minute intervals until you press [OK].

Display screen example in each Measurement MODE.


To display the chart tap **GRAPH** button while measuring.

<SINGLE MODE>

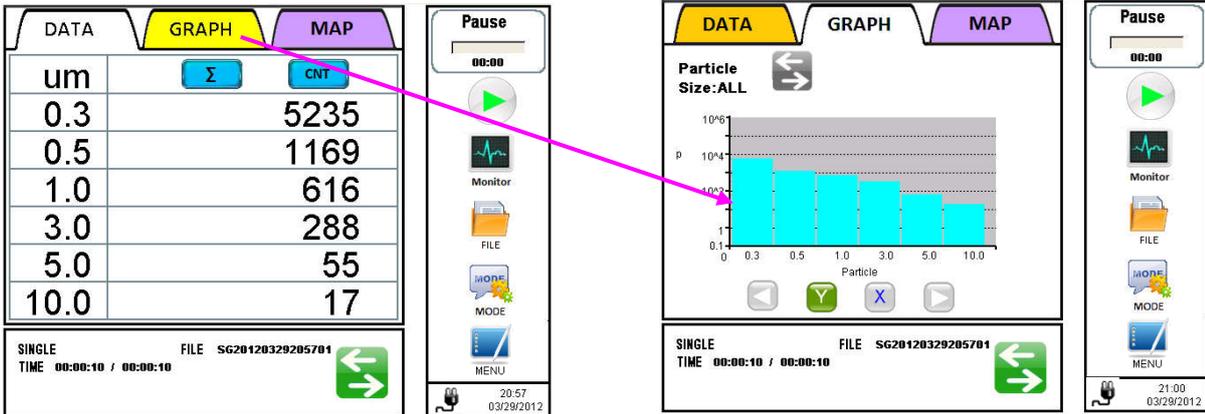


Tap [STOP] to stop a measurement.

<CONTINUOUS MODE>

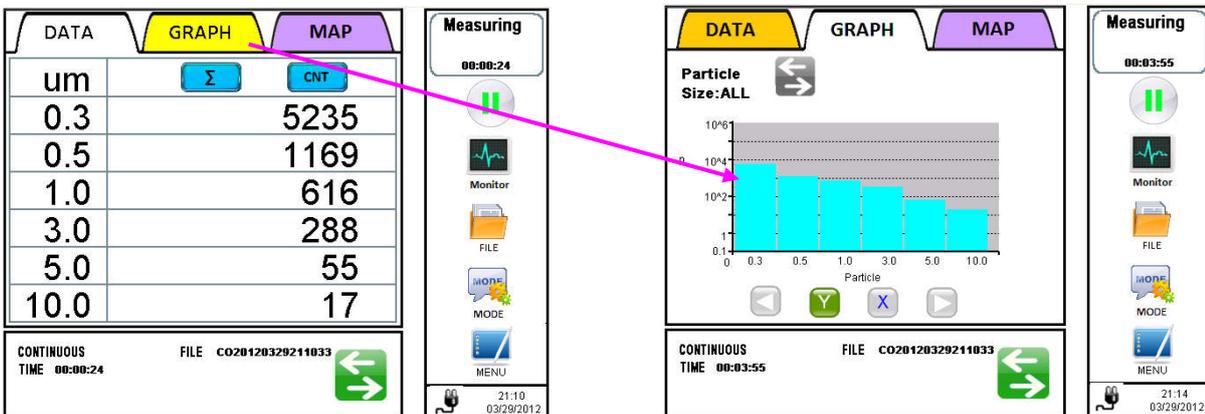


* After a measurement in INTERVAL mode is finished, the measurement results will be displayed.

<INTERVAL MODE>

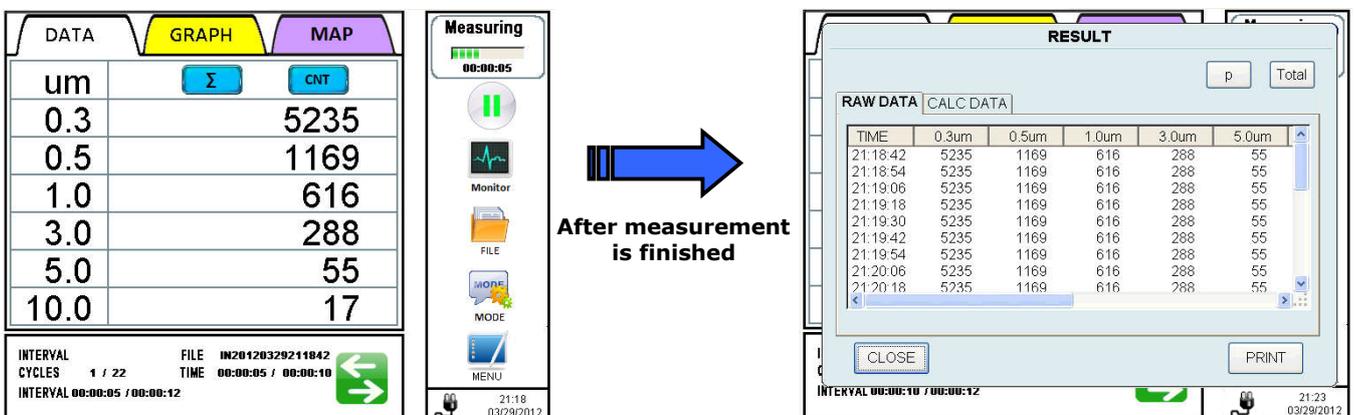

3.6.2 STATS


- When not using a MAP file

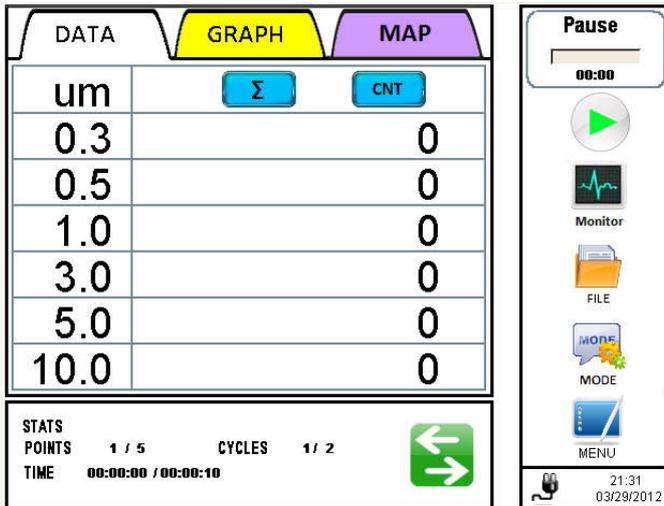

Tap [START] to display "CONFIRM" screen.

A measurement will start based on the setting configured in **3.5 MODE**.

Tap [START] to start a measurement.

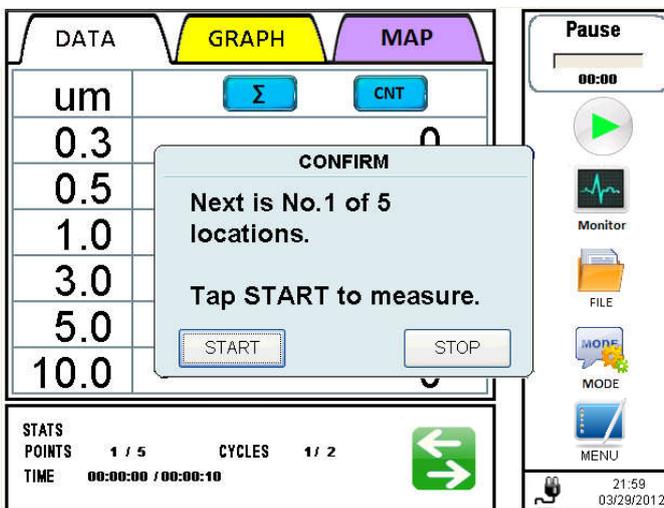


- If "START DELAY" is **NOT** checked in "MODE" setting:

Upon tapping [START], the pump will begin running. After the pump has run for 10 seconds to stabilize, the measurement will begin

- If **only** "START DELAY" is checked in "MODE" setting:

Upon tapping [START], the Delay Time begins. During the last 10 seconds of that Delay Time the pump will run to stabilize, after which the measurement will begin.

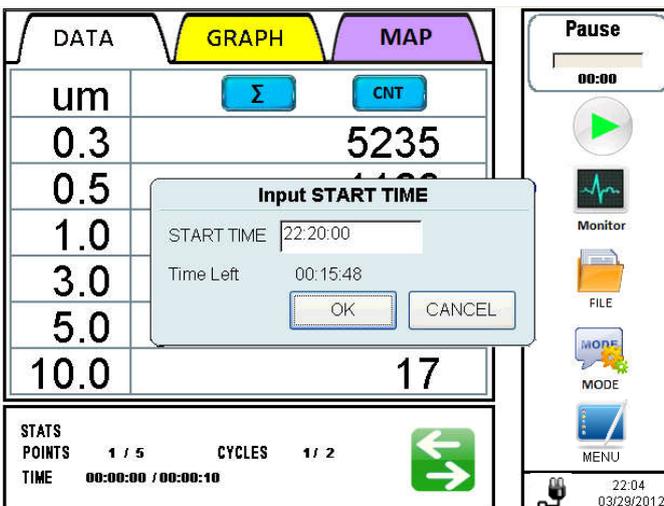


- If "START DELAY" and "Set time" **are** checked in "MODE" setting:

Upon tapping [START], "Input START TIME" dialog box will be displayed. Enter the time when you want to start measuring and tap [OK]. During the last 10 seconds of the [Time left] time the pump will run to stabilize, after which the measurement will begin.

Tap [CANCEL] to stop measuring and go back to the menu screen.


If you fail to press [OK] after entering "START TIME", and the entered START TIME arrives, the instrument will increase the start time in 10 minute intervals until you press [OK].

<Input START TIME dialog box>

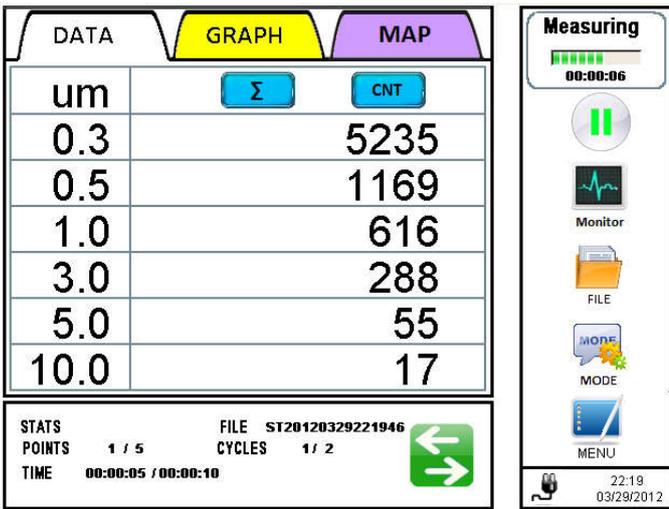

Tap [STOP] to stop a measurement.

Tap **GRAPH** button while measuring to display a chart.

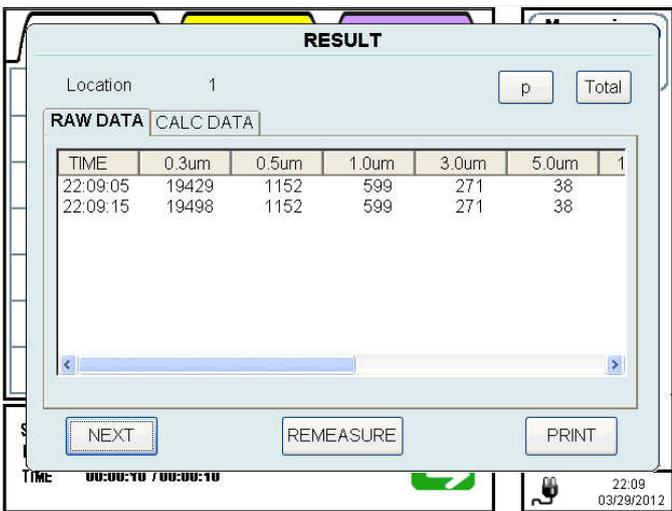


When a measurement at each measurement point is finished, the measurement will be displayed.

Tap [NEXT] to display "CONFIRM" screen which informs you of the next measurement point then wait for the next measurement.

Tap [REMEASURE] to perform another measurement at this measurement point.

Tap [PRINT] to print the measurement results.

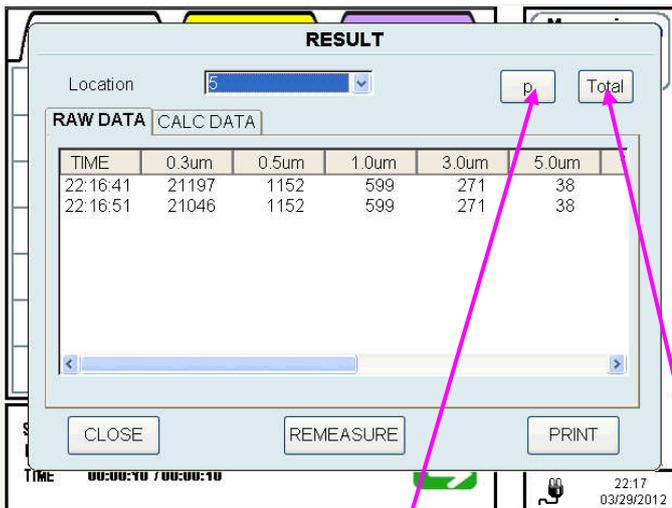

When all of the measurements are finished, a final measurement result will be displayed.

You can view the results of a certain LOCATION by selecting a Location from the dropdown list of [Location].

Tap [CLOSE] to end the measurement.


Tap [REMEASURE] to perform a measurement again at the last measurement point.

Tap [PRINT] to print measurement results of the last measurement point.

Every time you tap this button, the particle unit changes in the order of: **p** → **p/cf** → **p/m³**.


Use this button to select either Total display or Single display. (Only applicable for RAW DATA)

- When using a MAP file

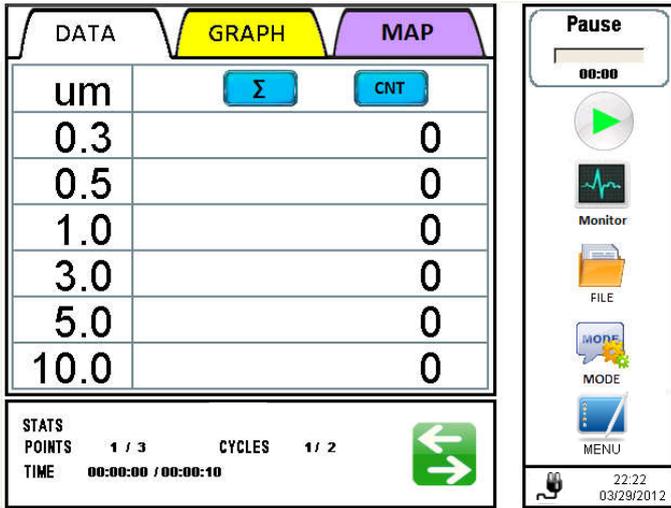

In STATS mode, a MAP will be displayed upon tapping [START].

A measurement will start based on the settings configured in **3.5 MODE**.

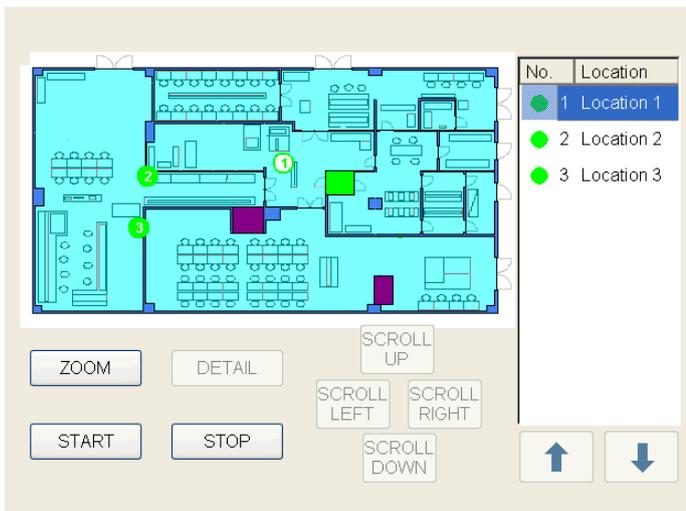

Select a Location and tap [START] to start a measurement.


Tap [STOP] to stop a measurement.

Tap [ZOOM] to enlarge a MAP.


(Press [NORMAL] to return to viewing the entire MAP when a map is enlarged.)

Select a Location and tap [DETAIL] to view the image of the selected Location.


(You need to register the image for the [DETAIL] view when creating a Schedule using the provided PC application.)

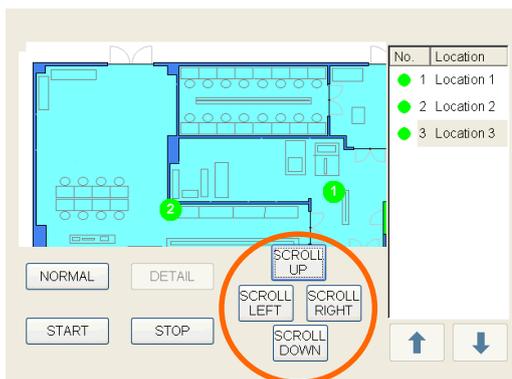

When a MAP is enlarged, [SCROLL UP], [SCROLL DOWN], [SCROLL LEFT] and [SCROLL RIGHT] buttons are activated, which enables you to move the MAP.

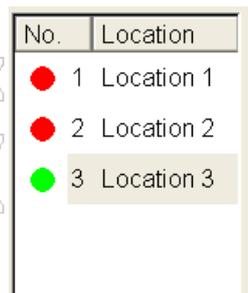

The color of a location changes from green to red once a measurement is done.

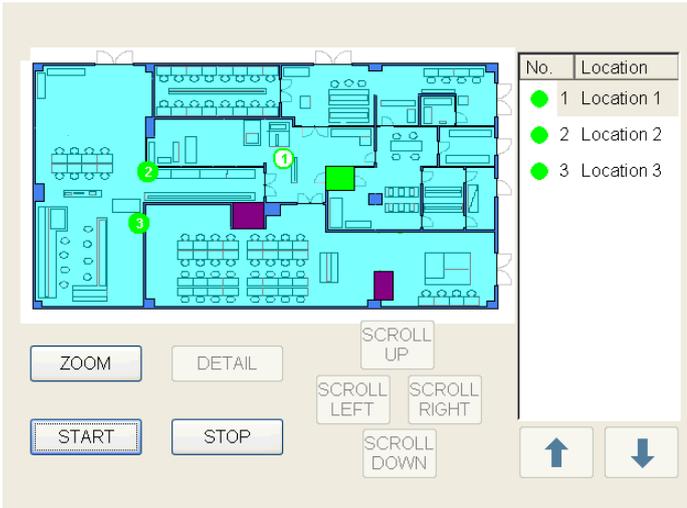

Tap [START] on the MAP to start a measurement

- If "START DELAY" is **NOT** checked in "MODE" setting:


Upon tapping [START], the pump will begin running. After the pump has run for 10 seconds to stabilize, the measurement will begin.

- If **only** "START DELAY" is checked in "MODE" setting:

Upon tapping [START], the Delay Time begins. During the last 10 seconds of that Delay Time the pump will run to stabilize, after which the measurement will begin.


- If "START DELAY" and "SET time" **are** checked in "MODE" setting:

Upon tapping [START], "Input START TIME" dialog box will be displayed. Enter the time when you want to start measuring and tap [OK]. During the last 10 seconds of the [Time left] time the pump will run to stabilize, after which the measurement will begin.

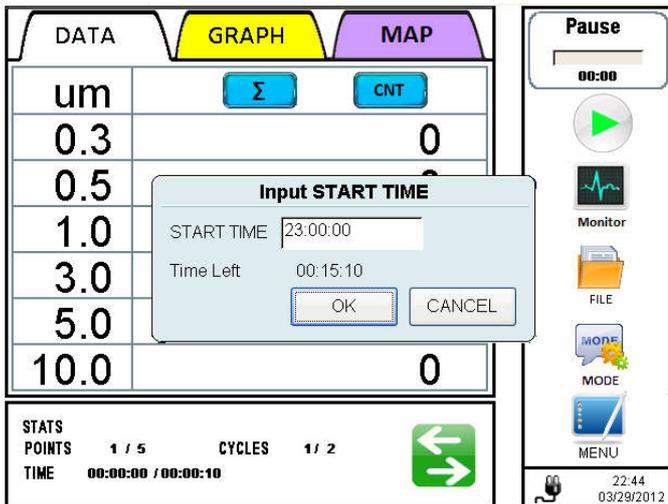


Tap [CANCEL] to stop measuring and go back to the menu screen.

If you fail to press [OK] after entering "START TIME", and the entered START TIME arrives, the instrument will increase the start time in 10 minute intervals until you press [OK].

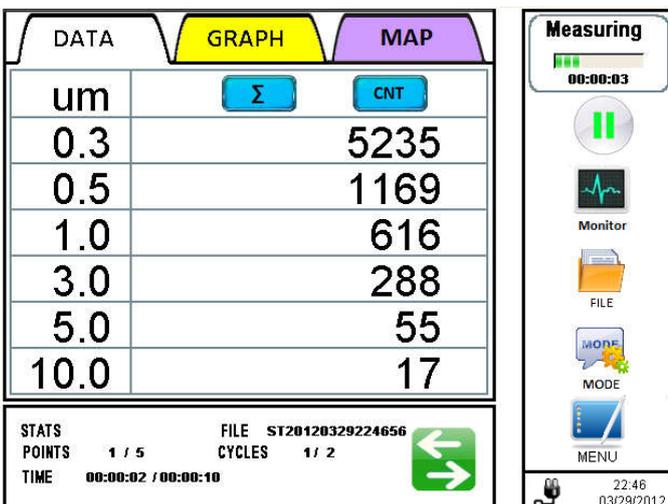

Tap **GRAPH** button while measuring to display a chart.

Tap [STOP] to stop a measurement.

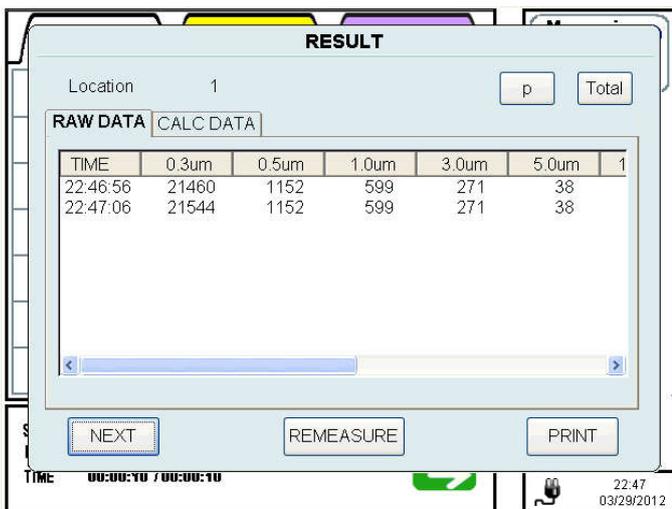


When a measurement is finished, a measurement result window will be displayed.

Tap [NEXT] to display the MAP again. Then the instrument waits for the next measurement point to be selected.

Tap [REMEASURE] to perform a re-measurement at the current location.

Tap [PRINT] to print the measurement results.

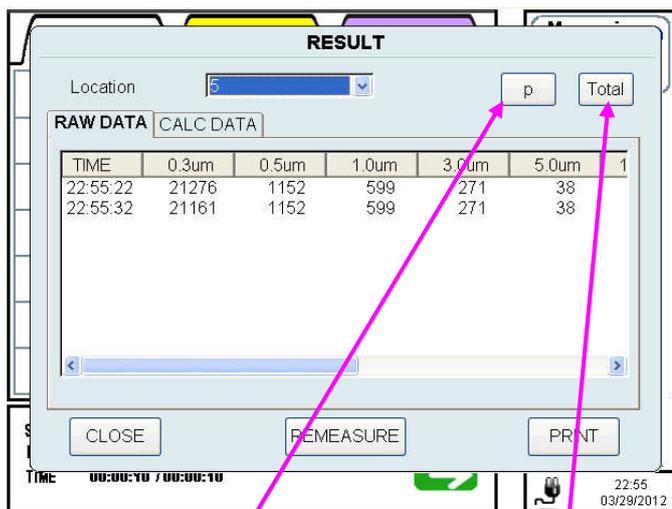

When all measurements are finished, the final measurement results will be displayed.

You can view the results of a certain LOCATION POINT by selecting Location from the dropdown list of [LOCATION].

Tap [CLOSE] to end the measurement.

Tap [REMEASURE] to perform a measurement again at the last measurement point.


Tap [PRINT] to print measurement results of the last measurement point.

Every time you tap this button, the particle unit changes in the order of:
p -> p/cf -> p/m³.

Use this button to select either Total display or Single display.
(Only applicable for RAW DATA)


3.6.3 STANDARD

- When not using a MAP file

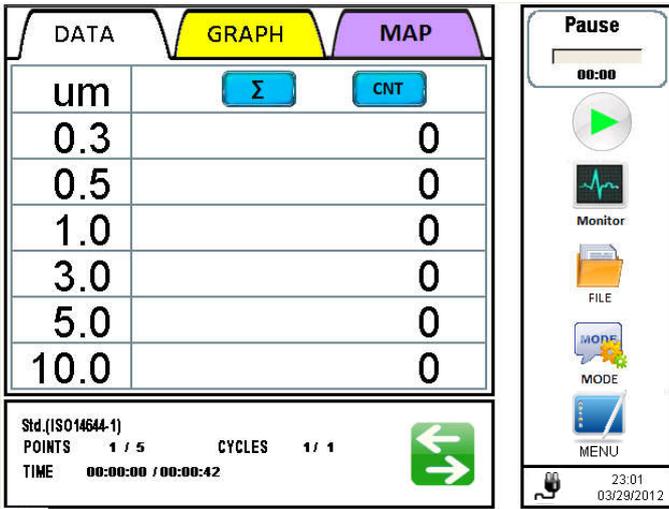

Tap [START] to display "CONFIRM" screen.

A measurement will start based on the settings configured in **3.5 MODE**.

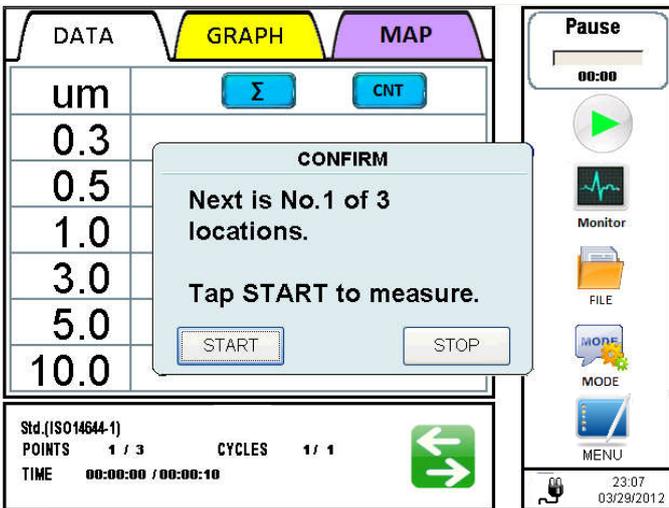

Tap [START] to start a measurement.


- **If "START DELAY" is NOT checked in "MODE" setting:**
Upon tapping [START], the pump will begin running. After the pump has run for 10 seconds to stabilize, the measurement will begin.
- **If only "START DELAY" is checked in "MODE" setting:**
Upon tapping [START], the Delay Time begins. During the last 10 seconds of that Delay Time the pump will run to stabilize, after which the measurement will begin.
- **If "START DELAY" and "Set time" are checked in "MODE" setting:**

Upon tapping [START], "Input START TIME" dialog box will be displayed. Enter the time when you want to start measuring and tap [OK]. During the last 10 seconds of the [Time left] time the pump will run to stabilize, after which the measurement will begin.


Tap [CANCEL] to stop measuring and go back to the menu screen.

If you fail to tap [OK] after entering "START TIME", and the entered START TIME arrives, the instrument will increase the start time in 10 minute intervals until you press [OK].

<CONFIRM window>

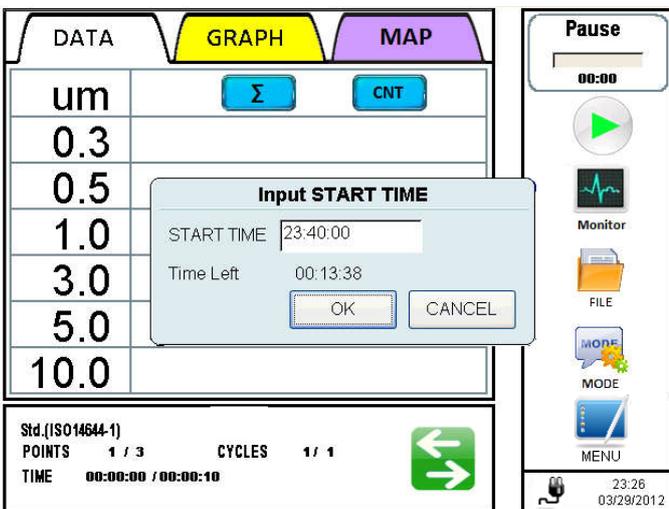

<Input START TIME dialog box>

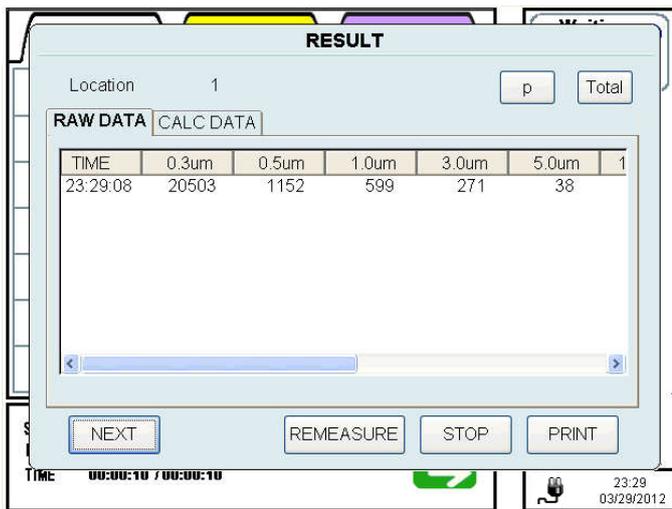


When a measurement at each location is finished, the measurement results will be displayed.

Tap [NEXT] to display a "CONFIRM" window informing you of the next measurement point, and wait for the next measurement.

Tap [REMEASURE] to perform a re-measurement.

Tap [STOP] to stop a measurement.


Tap [PRINT] to print a measurement result.

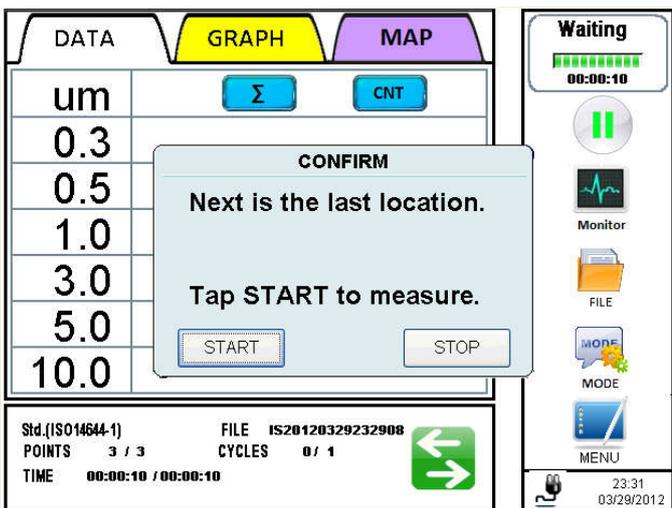

Tap [START] to start a measurement.


Tap [STOP] to stop a measurement.

<CONFIRM window>

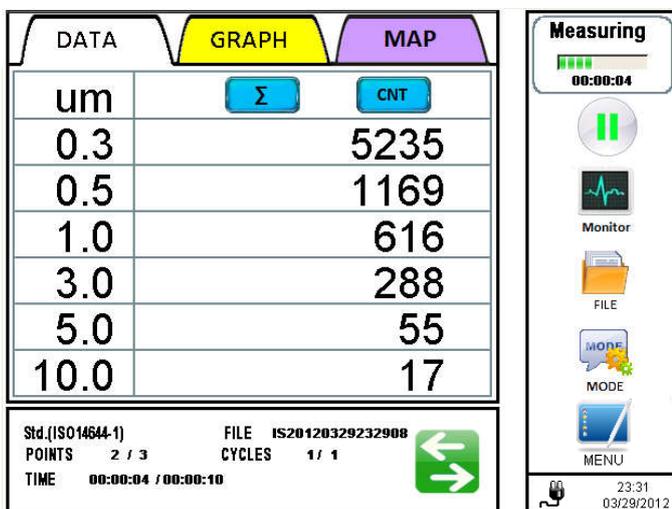

Tap **GRAPH** button while measuring to display a chart.

Tap [STOP] to stop a measurement.

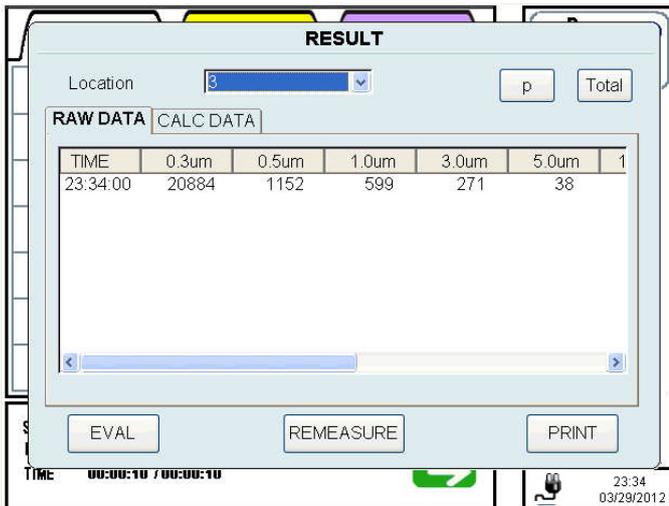


When all measurements are finished, the final measurement results will be displayed. You can view the result of a certain LOCATION POINT by selecting Location from the dropdown list.

Tap [EVAL] to display CLEAN ROOM EVALUATION window.

Tap [REMEASURE] to perform a re-measurement.

Tap [PRINT] to print a measurement result.

<Measurement RESULT>

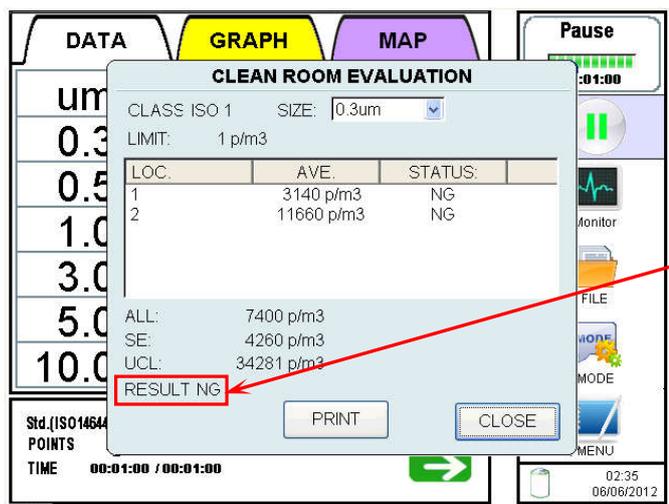


Tap [PRINT] to print a measurement result.

By selecting particle size you can change the particle size of the data to be evaluated. However, the status indicated by RESULT is determined based on the particle size selected in "MODE" settings.

Tap [CLOSE] to close the window.


<CLEAN ROOM EVALUATION>

- When using a MAP file

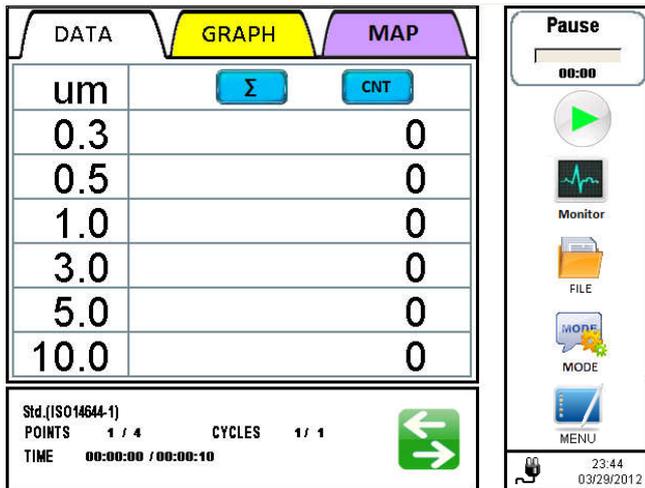

In STANDARD measurement tap [START] to display a MAP.


A measurement will start based on the settings configured in **3.5 MODE** .

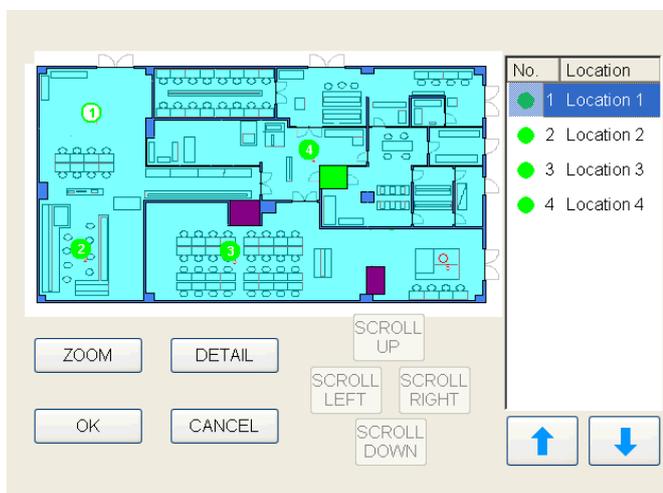


Select a Location and tap [START] to start a measurement.

Tap [STOP] to stop a measurement.

Tap [ZOOM] to enlarge a MAP.
(Press [NORMAL] to return to viewing the entire MAP when a map is enlarged.)

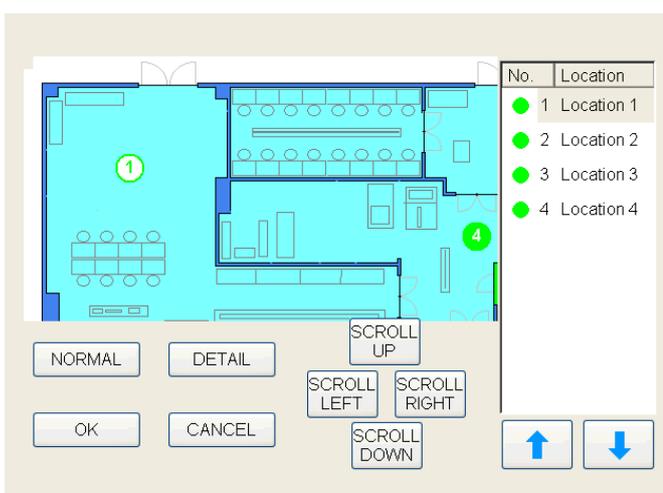

When a MAP is enlarged, [SCROLL UP], [SCROLL DOWN], [SCROLL LEFT] and [SCROLL RIGHT] buttons are activated, which enables you to move the MAP.

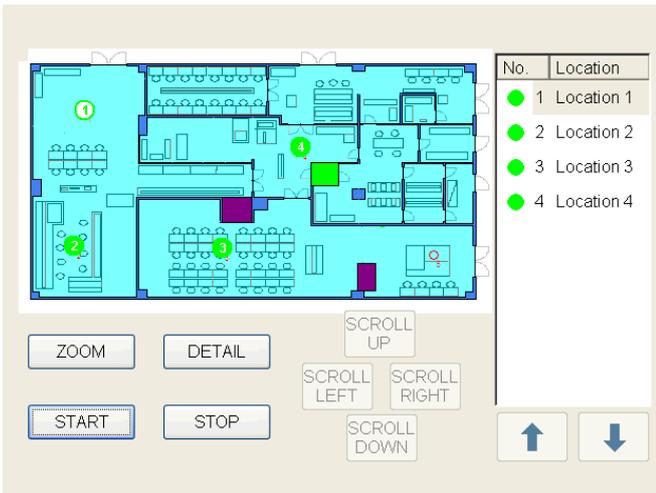

Select a Location and tap [DETAIL] to view the image of the selected Location. (The image of the Location needs to be registered when creating a Schedule using the provided PC application.)

Tap [START] to start a measurement.

- If "START DELAY" is **NOT** checked in "MODE" setting:


Upon tapping [START], the pump will begin running. After the pump has run for 10 seconds to stabilize, the measurement will begin.

- If **only** "START DELAY" is checked in "MODE" setting:

Upon tapping [START], the Delay Time begins. During the last 10 seconds of that Delay Time the pump will run to stabilize, after which the measurement will begin.

- If "START DELAY" and "Set time" are checked in "MODE" setting:

Upon tapping [START], "Input START TIME" dialog box will be displayed. Enter the time when you want to start measuring and tap [OK]. During the last 10 seconds of the [Time left] time the pump will run to stabilize, after which the measurement will begin.

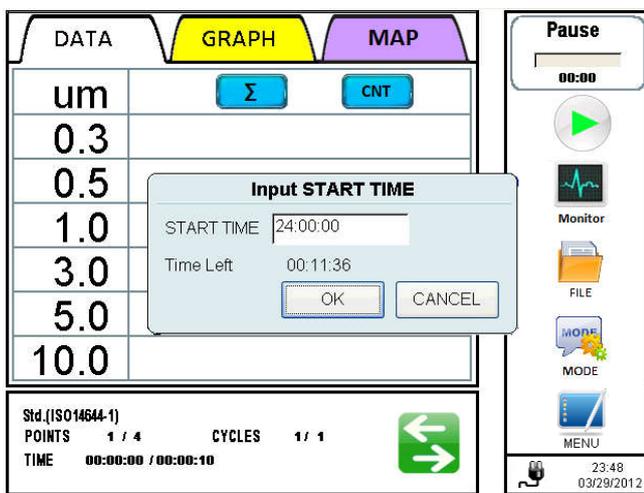


<Input START TIME dialog box>


Tap [CANCEL] to go back to the menu screen.


If you fail to press [OK] after entering "START TIME", and the entered START TIME arrives, the instrument will increase the start time in 10 minute intervals until you press [OK].

After closing the measurement results, tap **GRAPH** button while measuring to display a chart.

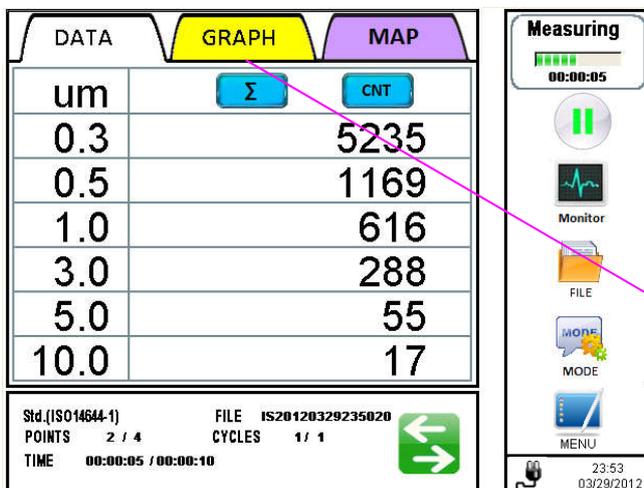

<Screen while measuring>

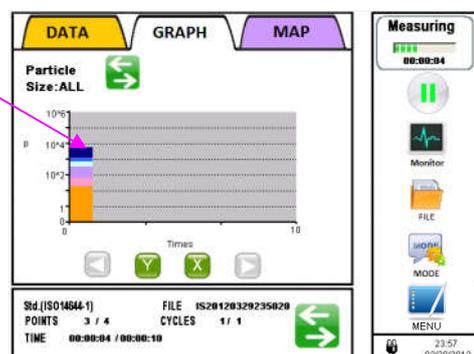

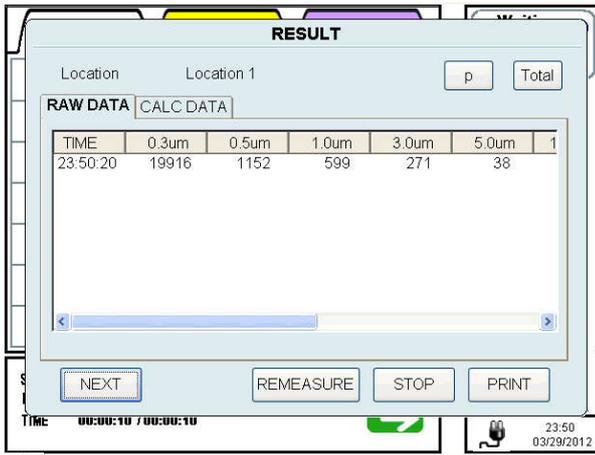

When a measurement at each location is finished, the measurement results will be displayed.

In [RAW DATA] tab, measurement data will be displayed.

In [CALC DATA] tab, data of minimum (MIN), maximum (MAX) and average (AVE) measurements will be displayed.


Tap [NEXT] to display the MAP again and wait for the next point to be selected.

Tap [REMEASURE] to perform a re-measurement.

Tap [STOP] to stop a measurement.

Tap [PRINT] to print measurement results.

The color of a location changes from green to red once a measurement is done.

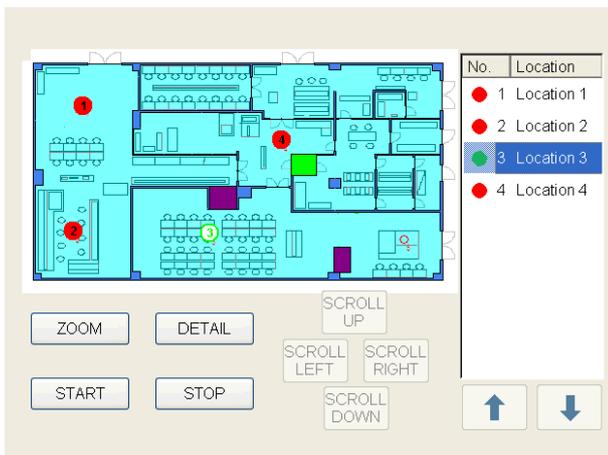

When all measurements are finished, the final measurement results will be displayed.

You can view the result of a certain LOCATION POINT by selecting Location from the dropdown list.


Tap [EVAL] to display "CLEAN ROOM EVALUATION" screen.

Tap [REMEASURE] to perform a re-measurement at the current location.

Tap [PRINT] to print a measurement result.

Tap [PRINT] to print a measurement result.

By selecting particle size you can change the particle size of the data to be evaluated. However, the status indicated by RESULT is determined based on the particle size selected in the "MODE" setting.

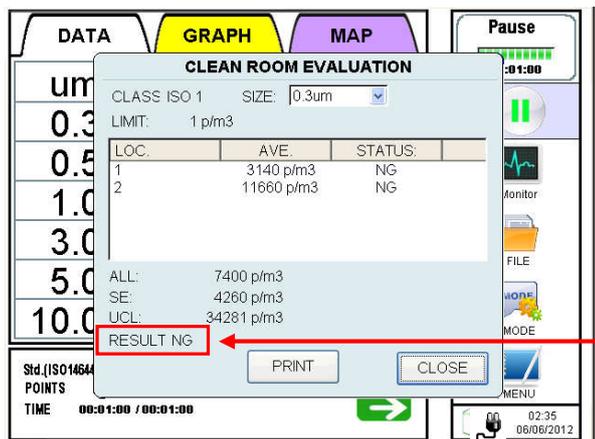

Tap [Close] to close the window.

3.6.4 Interlocking Operations

DATA	GRAPH	MAP
um	Σ	CNT
0.3		5235
0.5		1169
1.0		616
3.0		288
5.0		55
10.0		17

SINGLE FILE SG2012033001284
TIME 00:00:10 / 00:00:10

Every time you tap the particle unit, it changes in the order of: **CNT** → /cf → /m³.

um	Σ	/cf
0.3		31410
0.5		7014
1.0		3696
3.0		1728
5.0		330
10.0		102

Tap a particle size on the screen to display the data for the particular particle size.
Tap **ALL** to return to displaying data for all 6 particle sizes.


DATA	GRAPH	MAP
um	Σ	CNT
1.0		
616		

SINGLE FILE SG20120330024021
TIME 00:00:10 / 00:00:10

<SINGLE and CONTINUOUS mode>

DATA	GRAPH	MAP
um	Σ	CNT
0.3		5235
0.5		1169
1.0		616
3.0		288
5.0		55
10.0		17

SINGLE FILE SG20120330024308
TIME 00:00:02 / 00:00:10

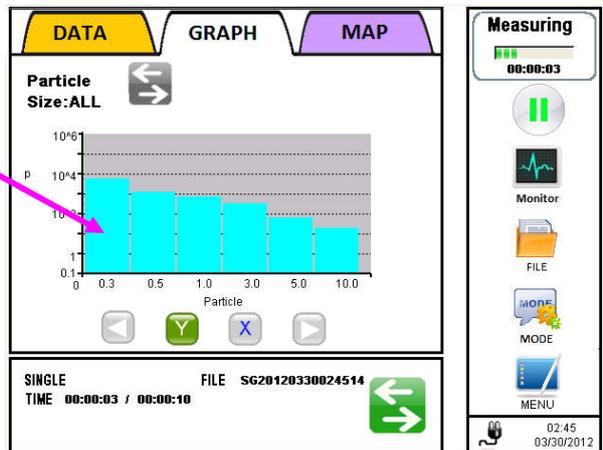

Tap **GRAPH** to switch to displaying a chart while measuring.
A particle-size-based histogram will be displayed in SINGLE and CONTINUOUS modes.
Tap **GRAPH** again to return to displaying data for all 6 particle sizes.

<INTERVAL, STATS and STANDARD modes>

um	CNT
0.3	5235
0.5	1169
1.0	616
3.0	288
5.0	55
10.0	17

Measuring 00:00:03

02:48 03/30/2012

Particle Size: ALL

10⁶
10⁴
10²
1
0.1
0

Times 10

Measuring 00:00:04

02:50 03/30/2012

A time series chart will be displayed in INTERVAL, STATS and STANDARD modes.

um	CNT
0.3	5235
0.5	1169
1.0	616
3.0	288
5.0	55
10.0	17

Measuring 00:00:03

02:48 03/30/2012

um	CNT
0.3	4066
0.5	553
1.0	328
3.0	233
5.0	38
10.0	17

Measuring 00:00:10

03:01 03/30/2012

Tap Σ to switch to the Single display.
 Tap Δ to return to the Total display.
 For details on Total display and Single display, please refer to **P10 Icons in the Status Display**.

STATS in Measurement RESULT

10.0um	T[C]	H[%]	V[m/s]	P[Pa]	STATU...
17	10.8	18.3	0.25	0.0	OK
17	3.1	21.7	0.32	0.0	OK
17	0.0	16.7	0.25	0.0	OK
17	0.0	19.1	0.28	0.0	OK
17	0.0	16.7	0.25	0.0	OK
17	0.0	11.9	0.18	0.0	OK
17	0.0	14.3	0.21	0.0	OK
17	0.0	14.3	0.21	0.0	OK
17	0.0	19.1	0.28	0.0	OK

Interval: 00:00:10 / 00:00:12

03:07
03/30/2012

There are six indications for STATUS;
"OK", "F", "L", "O", "V" and "B".

Each means;

- OK: No error
- F: FLOW error
- L: LD error
- O: OPTION SENSOR error
- V: OVER
- B: BATTERY error

Message when printing

TIME	0.3um	0.5um	1.0um	3.0um	5.0um	1
03:20:33	5235	1169	616	288	55	
03:20:45	5235	1169	616	288	55	
03:20:57	5235	1169	616	288	55	
03:21:09	5235	1169	616	288	55	
03:21:21	5235	1169	616	288	55	

Interval: 00:00:10 / 00:00:12


03:21
03/30/2012

While data is being printed, the message shown to the left will be displayed.

If you tap [STOP], you can cancel the printing. However, the data already transmitted to the printer will be printed.

3.6.5 Saving Data

If AUTO SAVE is not checked on the MODE setting window, data will not be saved to a file after measuring. If you try to change the MODE or start another measurement when AUTO SAVE is not checked, you will get the message shown below.

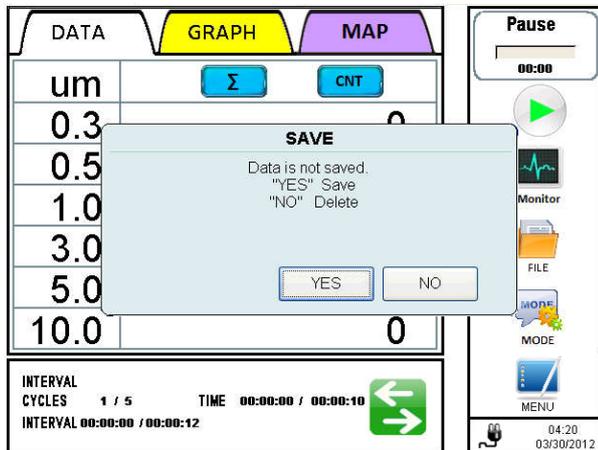

- Tap [YES] to save the data.
- Tap [NO] to discard the data.

If the electricity goes out during a measurement, data will be treated as below.


[SINGLE] and [CONTINUOUS] Mode

Data during a measurement will be discarded when the power goes OFF.

[INTERVAL] Mode

Data taken before electricity goes out remains stored in the instrument.

When restarting the instrument, the message shown below will be displayed.

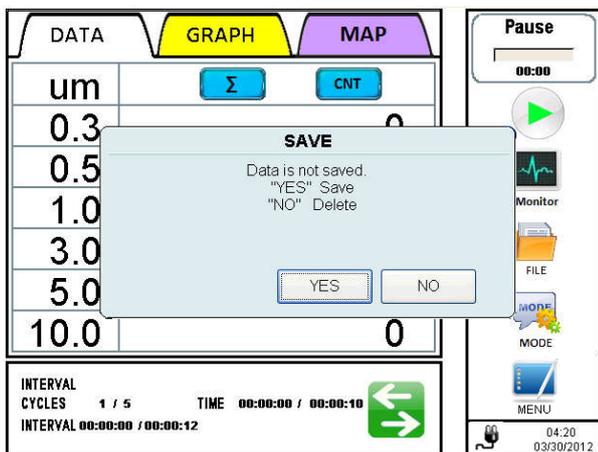

- Tap [YES] to save the data.
- The calculation data will be created using the data collected before the power went out.
- Tap [NO] to discard the data.

[STATS] and [STANDARD] Mode

Data taken before electricity went out remains in the instrument. However, the data from the location where a measurement was being performed when the power went out is not saved.

The measurement will be in a temporary state of suspension.

-> Refer to **3.6.6 In Case that Measurement is Interrupted.**


3.6.6 In Case that Measurement is Interrupted

If you stop a measurement in STATS or STANDARD mode before all measurements complete, and there is more than one location where a determined set of measurements is finished, the instrument will be in a temporary state of suspension.

The instrument will remain in a temporary state of suspension until a measurement restarts or completes. During this period you cannot change the measurement mode or MODE settings.

[STATS]


If you start a measurement when the instrument is in a temporary state of suspension, the message below will be displayed.

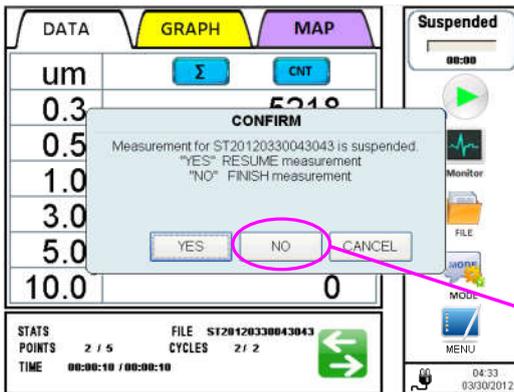

Tap [YES] to resume measuring from the next LOCATION.

If you tap [NO], you will get a message asking if you want to save the data or not.

Tap [CANCEL] to go back to the main screen.

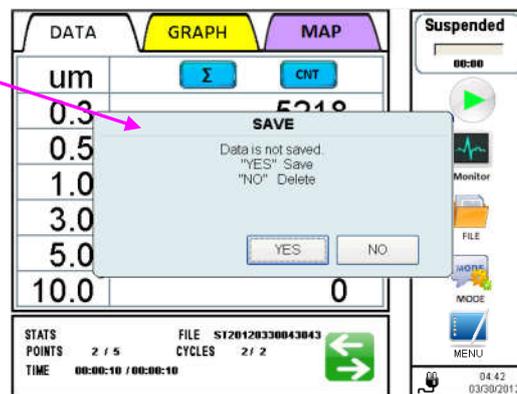


If you tap [NO] on the window above, a confirmation window will be displayed asking if you want to save the data or not.

Tap [YES] to save the data.

Tap [NO] to discard the data.

If you try to switch the mode, the message below will be displayed.

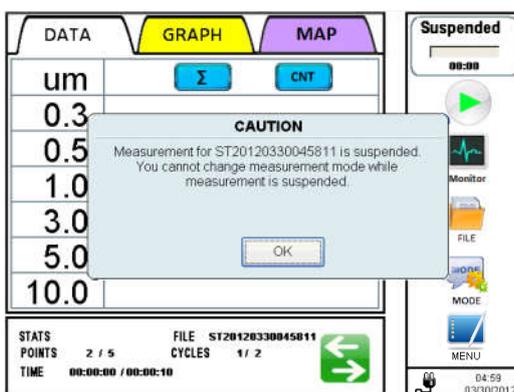


Tap [OK].

You cannot change the mode when a measurement is in a temporary state of suspension.


[STANDARD]

If you start a measurement when the instrument is in a temporary state of suspension, the message below will be displayed.

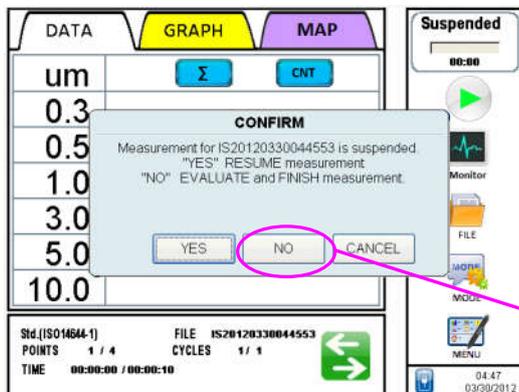

Tap [YES] to resume measuring from the next LOCATION.


Tap [NO] to display CLEAN ROOM EVALUATION. Then the measurement will be completed.

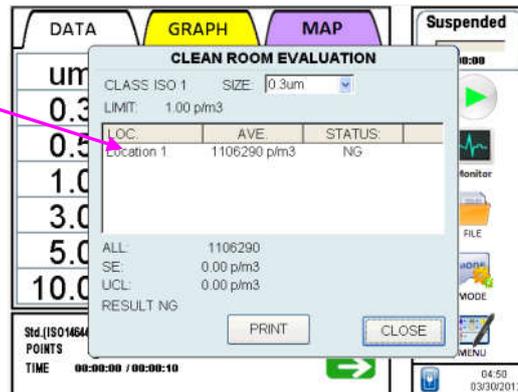

Tap [PRINT] to print out the result.

Tap [CANCEL] to close the CLEAN ROOM EVALUATION window.


If you try to switch the mode, the message below will be displayed.

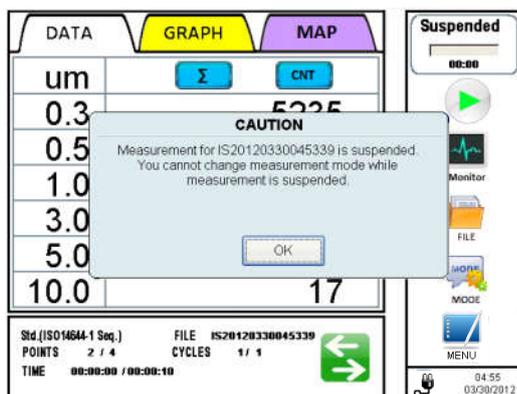

Tap [OK].

You cannot change the mode when a measurement is in a temporary state of suspension.

3.7 FILE

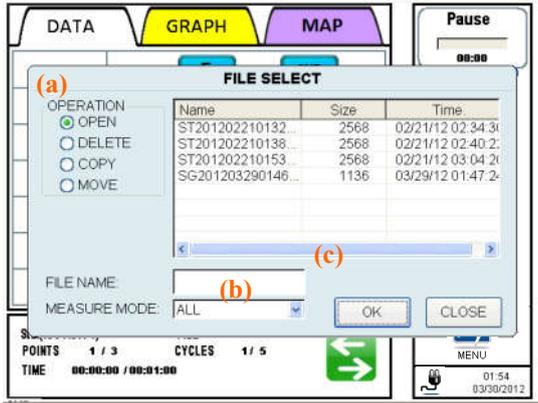

Select [FILE] on the initial screen. Then a screen shown to the left will be displayed. You can display, print and delete data here. You can also display the list of files that has been outputted in the ALARM/ERROR LOG screen.

- *User needs to have authorization to copy files.**
- *User needs to have authorization to delete files.**

The file name consists of an abbreviation of the measurement mode + Date + Time.

The measurement mode abbreviations are;

SG: SINGLE	FS: FEDERAL STANDARD
CO: CONTINUOUS	BS: BRITISH STANDARD
IN: INTERVAL	EC: EC GMP
ST: STATS	GB: GB/T
IS: ISO	

- (a) To display names of every saved file, check "OPEN". (When this screen is open, "OPEN" is selected by default.)
- (b) Use "MEASURE MODE" to narrow down the files to be displayed.
- (c) After you select the file that you want to display, the file name will be displayed in the box for "FILE NAME". Then tap [OK] to open the data display screen as shown below.


Data Display Screen



<RAW DATA TAB>

- Tap CALC DATA tab to display CALC result.
- Tap SETTING tab to display the setting information.

(e) To delete the displayed file, tap [DELETE]. A dialog will be displayed asking you if you want to delete it or not. Tap [YES] to delete the file displayed.

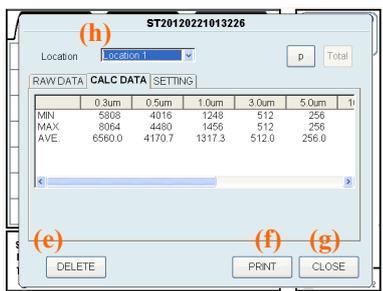


<CALC TAB DATA>


(f) Tap [PRINT] to print the data.

(g) Tap [CLOSE] to close a window.

(h) In STATS mode and STANDARD mode, you can change the data to be displayed by selecting LOCATION.

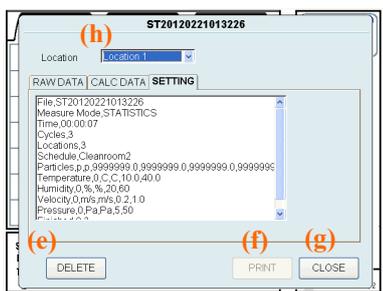


<SETTING TAB>

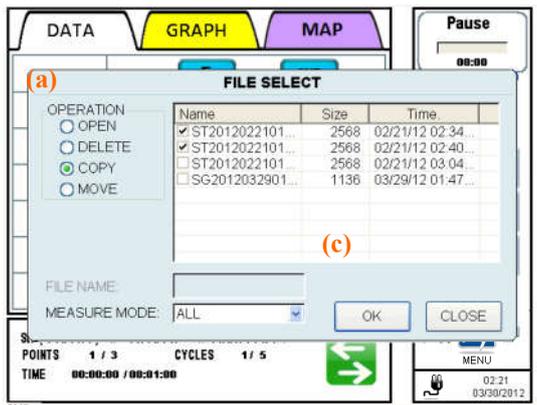

- Select the [COPY] button to copy file and insert an USB flash drive to store the selected file(s).
- Use "MEASURE MODE" to narrow down the files to be copied.
- Select the file(s) to copy and tap [OK] to save. **(Authentication required)**

***The User needs the authorization (Copy Files) to copy files.**


Copied files are encrypted, and can be deciphered with the provided user management software.

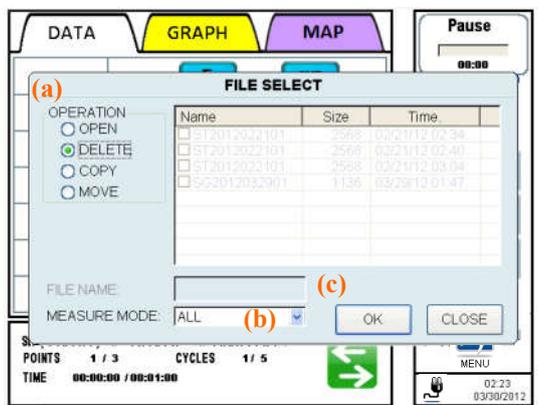

- Select the [DELETE] button to delete files. A check box will be displayed at the beginning of each file name so that you can check the file(s) that you want to delete.
- Use "MEASURE MODE" to narrow down the files to be deleted.
- Select the file(s) that you want to delete and tap [OK] **(Authentication required)**

***The User needs the authorization (Delete Files) to delete files.**


*For data protection purpose, files can be only deleted after they have been copied.

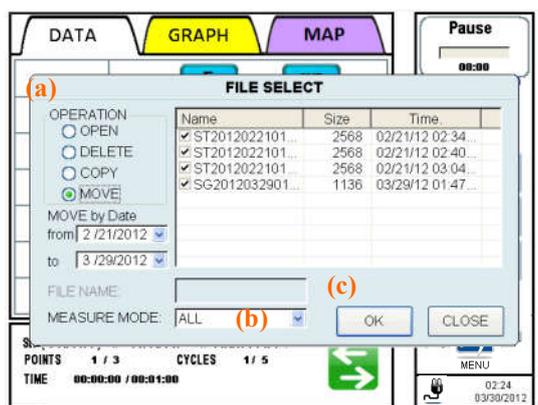

- Select the [MOVE] button to move files from internal data storage. Insert an USB flash drive to store the selected file(s). Select the dates of files to be moved.
- Use "MEASURE MODE" to narrow down the files to be moved.
- Select the file(s) to be moved and tap [OK] to move **(Authentication required)**

***After files are moved to the USB flash drive, they are deleted from the internal data storage.**


3.8 MENU

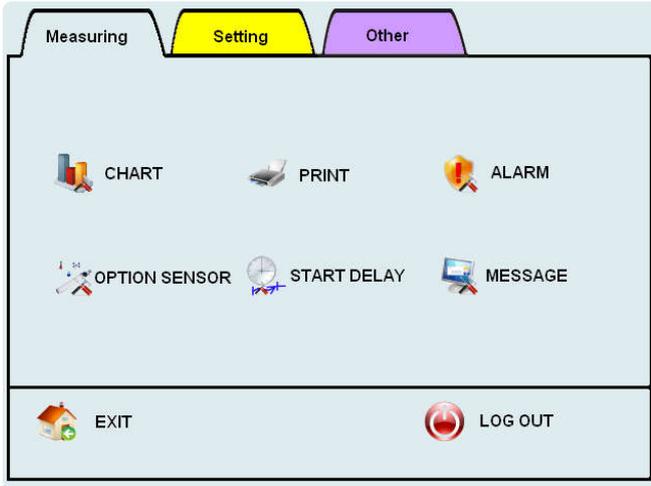

Select "MENU" on the initial screen to display the window.

***User needs to have the authorization (Access Control Panel) to change the settings on the menu.**


3.8.1 Measuring

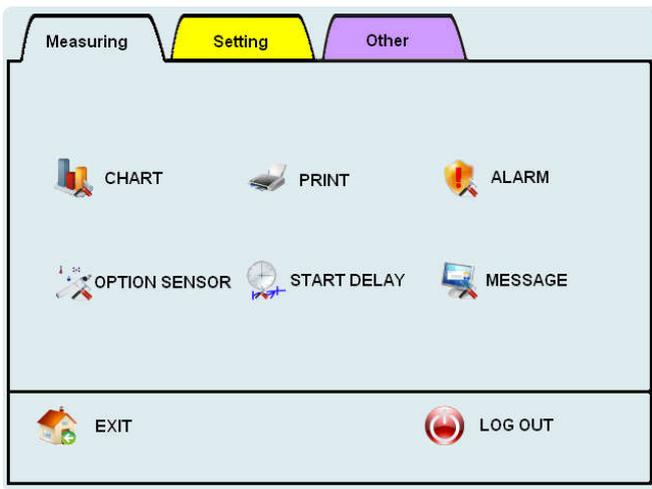

In the Measuring window you can configure the following settings;

- CHART
- PRINT
- ALARM
- OPTION SENSOR
- START DELAY
- MESSAGE

· CHART SETTING

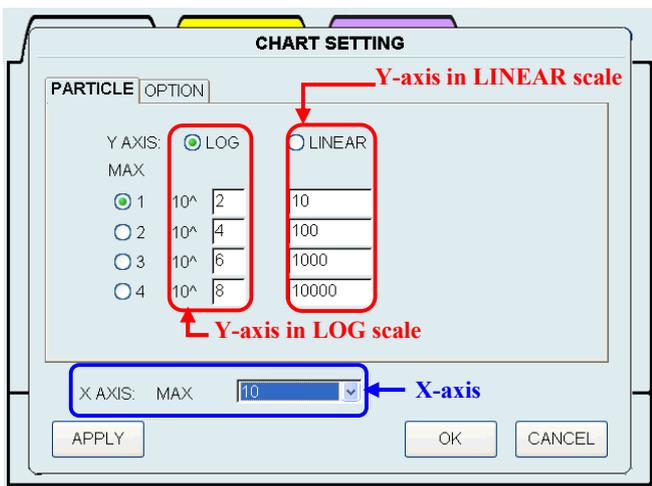

Configure the axis of the chart and range settings.

For **X Axis** select either "10", "20", "50", "100", "150" or "300".

For **Y Axis** in PARTICLE tab select either "LOG" or "LINEAR".

Select 1, 2, 3 or 4 to determine which of the Y AXIS MAX values will be displayed on the chart.

You can set 4 different max values each for "LOG" and "LINEAR".


When you configure the chart settings as shown above, the chart will be shown as below.

Y Axis:

MAX value set in the PARTICLE tab in the CHART SETTING window is applied to the chart.

Tap the **MAX value** to change it.

(It changes in the order of MAX settings 1, 2, 3, and 4.)

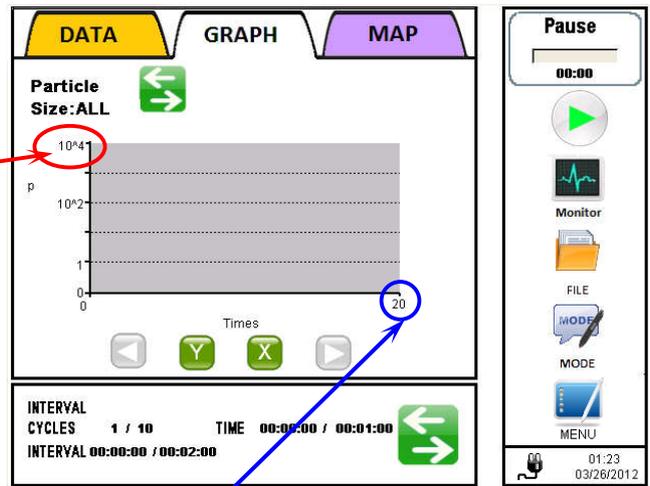

X Axis: MAX value set in the PARTICLE tab in the CHART SETTING window is applied to the chart.

Tap the **MAX value** to change it.

(It changes in the order of "10", "20", "50", "100", "150", and "300".)

	Temp		Humi		Velo		Press	
	MIN	MAX	MIN	MAX	MIN	MAX	MIN	MAX
<input checked="" type="radio"/> 1	0	50	0	100	0.0	1.0	0	100
<input type="radio"/> 2	10	30	20	50	0.0	1.0	0	100
<input type="radio"/> 3	10	30	40	70	0.0	1.0	0	100

X AXIS: MAX

APPLY OK CANCEL

In the OPTION tab, configure the "MIN" and "MAX" settings for each sensor.

For each sensor you can set three different values.

Tap [APPLY] to save the values that are currently displayed in the tab


(Authentication required). The window is not closed.

Tap [OK] to save the values and close the window **(Authentication required)**.

Tap [CANCEL] to discard any changes you've made to the values and close the window. The previous values will be applied.

Select 1, 2 or 3 to determine which of the 3 value settings will be displayed on the chart.

When you configure the chart settings as shown above, the chart will be shown as below.

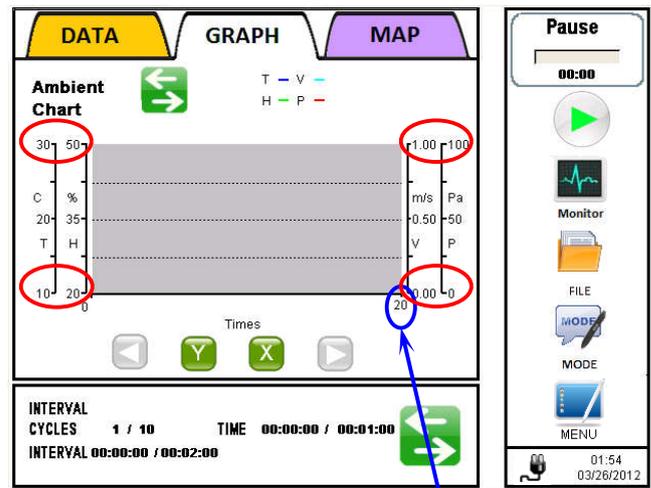


The MAX and MIN values set for each sensor in the OPTION tab in the CHART SETTING window is applied in the chart.

Tap **MAX or MIN value** to change it.
(It changes in the order of MIN & MAX settings 1, 2, and 3.)

The MAX value set in the OPTION tab in the CHART SETTING window is applied to the chart.

Tap **MAX value** to change it.
(It changes in the order of "10", "20", "50", "100", "150", and "300".)

• PRINT SETTING

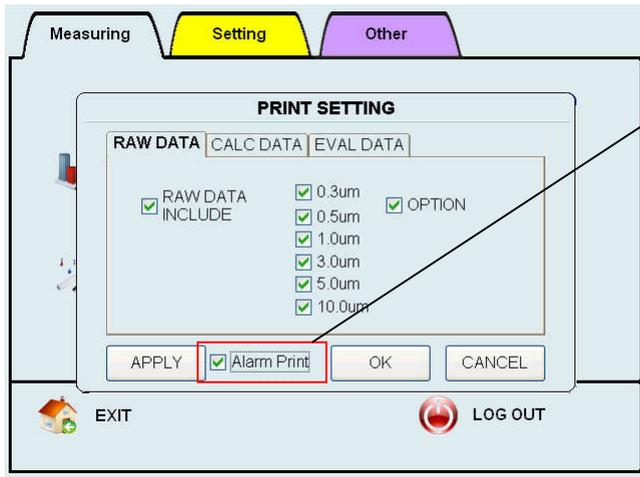


In the PRINT SETTING screen you can set output items for printing.

Check "Alarm Print" to print the data at the moment of an alarm being issued and when it is lifted. In RAW DATA tab, you can configure the following settings:

- RAW data printing ON/OFF
- Particle size(s) to be printed
- Option sensor data printing ON/OFF

Check "RAW DATA INCLUDE" to print RAW data. Check the particle size of the data that you want to print.

Check "OPTION" to output data of the option sensor.

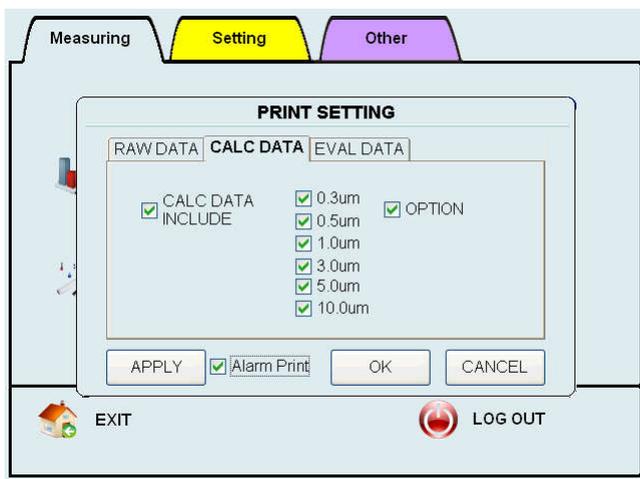


In CALC DATA tab, you can configure the following settings;

- CALC data printing ON/OFF
- Particle size(s) to be printed out
- Option sensor data printing ON/OFF

Check "CALC DATA INCLUDED" to print calculated data (MAX, MIN and AVE).

Check particle size of the data that you want to print out.

Check "OPTION" to output data of the option sensor(s).

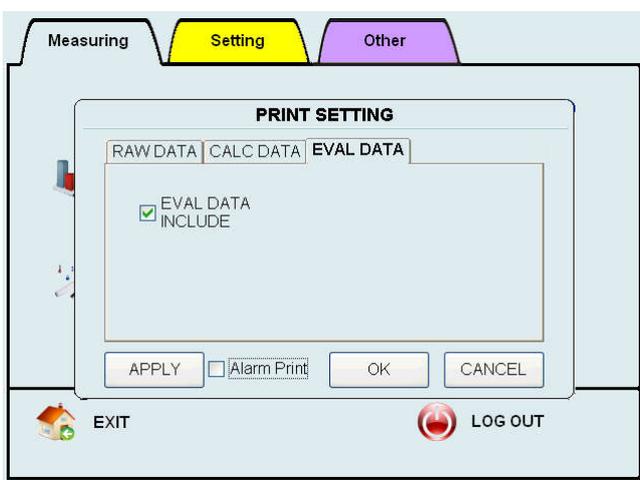

In EVAL DATA tab, configure the following setting;

[EVAL data printing ON/OFF]

Check "EVAL DATA INCLUDED" to print out evaluation data.

Tap [APPLY] to save the settings

(Authentication required).

The window is not closed.

Tap [OK] to save the settings and close the window **(Authentication required).**

Tap [CANCEL] to discard the settings and close the window. The previous configuration will be applied.

ALARM SETTING

ALARM SETTING

PARTICLE OPTION

UNIT: p

ENABLE	ALARM LEVEL
<input checked="" type="checkbox"/> 0.3	9999999
<input checked="" type="checkbox"/> 0.5	9999999
<input checked="" type="checkbox"/> 1.0	9999999
<input checked="" type="checkbox"/> 3.0	9999999
<input checked="" type="checkbox"/> 5.0	9999999
<input checked="" type="checkbox"/> 10.0	9999999

APPLY Alarm Sound OK CANCEL

In ALARM SETTING you can set thresholds for the particle alarm and option sensor alarm.

In the PARTICLE tab, configure the unit and threshold for each particle.

Check the particle size that you want to alarm by external contact output and audible alarm*.

(* Note that audible alarm will be activated only when "Alarm Sound" is checked.)

Also enter the threshold that you want to trigger the alarm.

To enter the threshold, tap the entry field to display a numeric keypad. Enter a value and tap [Enter].

ALARM SETTING

PARTICLE OPTION

	Temp	Humi	Velo	Press
UNIT	C	%	m/s	Pa
MIN	10.0	20.0	0.2	5.0
MAX	40.0	60.0	1.0	50.0

APPLY Alarm Sound OK CANCEL

In the OPTION tab, you can set an alarm threshold for TEMPERATURE, HUMIDITY, VELOCITY and DIFFERENTIAL PRESSURE.

Tap the entry field to display a numeric keypad. Enter a value and tap [Enter].

To activate the audible alarm check "Alarm Sound".

Tap [APPLY] to save the settings **(Authentication required)**.

The window is not closed.

Tap [OK] to save the settings and close the window. **(Authentication required)**.

Tap [CANCEL] to discard the settings and close the window. The previous configuration will be applied.

OPTION SENSOR SETTING

	Temp	Humi	Velo	Press
USE/NOUSE	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
UNIT	C	%RH	m/s	Pa
MIN	0.0	0.0	0.0	0.0
MAX	50.0	100.0	1.0	100.0
INSTANT	INSTANT	INSTANT	INSTANT	INSTANT

In the OPTION SENSOR SETTING screen you can confirm if the option sensor is connected or not, and whether or not to use the sensor.

You can also set the unit and MIN/MAX measuring range for each sensor. MIN/MAX value should be the spec range for each sensor.

A sensor will be displayed in blue if it is connected or in gray if it is not.

To use an option sensor, check USE/NO USE box.

Tap [OK] to save the settings and close the window (**Authentication required**).

Tap [CANCEL] to discard entries and close the window.

UNIT:

Set the unit for TEMPERATURE and VELOCITY.

For TEMPERATURE, select °C or °F

For VELOCITY, select m/sec or FPM.

MIN/MAX:

Set the measurable range of the sensor according to the specifications of each option sensor.

Tap an entry field to display a numeric keyboard. Enter a value and tap [Enter].


INSTANT/ AVERAGE:

Select INSTANT or AVERAGE for measurement display format.

CHECK button:

Tap [CHECK] to confirm if the option sensor(s) are connected or not.


· START DELAY

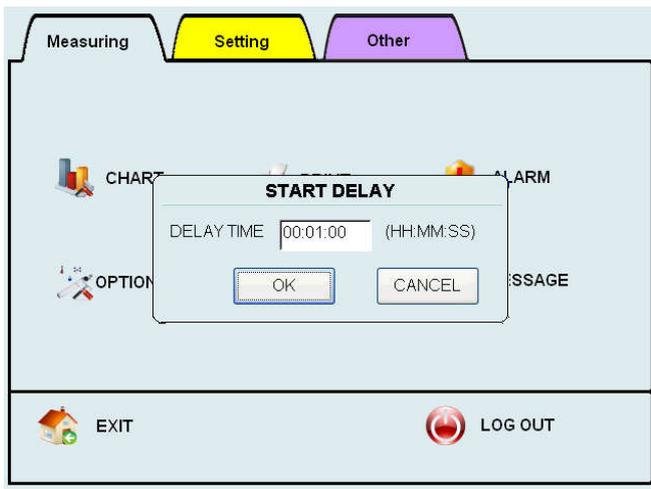

In the START DELAY window set a measurement delay time.

Tap the entry field to display a keyboard. Enter "hours", "minutes" and "seconds" then tap [OK] to activate the settings **(Authentication required)**.

· MESSAGE SETTING

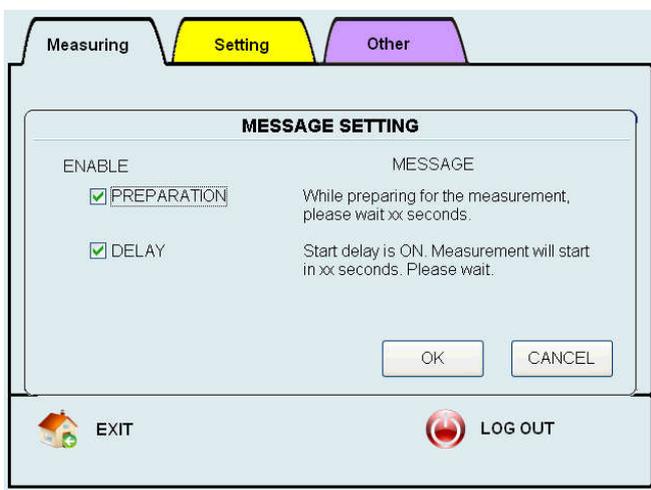


In the MESSAGE SETTING window, you can choose whether or not to display messages for "PREPARATION" and "DELAY".

Tap [OK] in order to activate the settings **(Authentication required)**.

- PREPARATION:
will display a message after the pump is ON before sampling starts.
- DELAY:
will display a message before sampling starts when START DELAY function is ON.


3.8.2 Setting

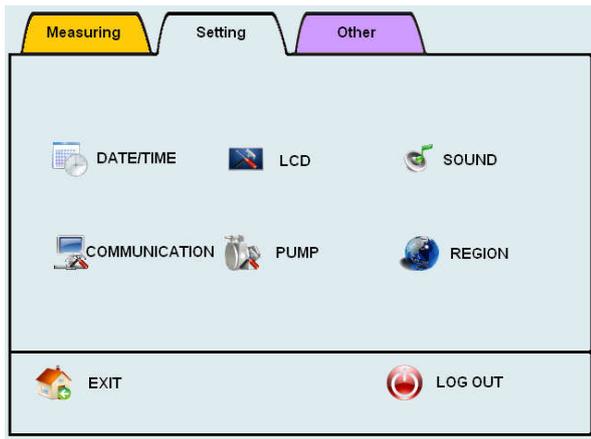

In the Setting window you can configure the following;

- DATE/TIME
- LCD
- SOUND
- COMMUNICATION
- PUMP
- REGION

· DATE/TIME

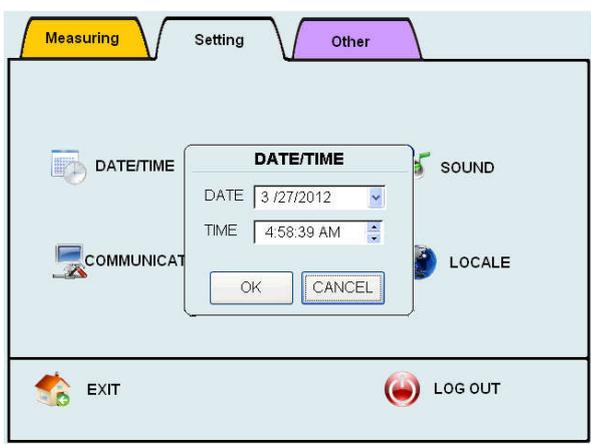


DATE/TIME setting;

To adjust DATE, tap [▼] to display a calendar and set the date.

To change the TIME, tap "hours", "minutes" and "seconds" then use the [▲/▼] buttons to adjust the selected number.

Tap [OK] to activate the settings **(Authentication required)**.

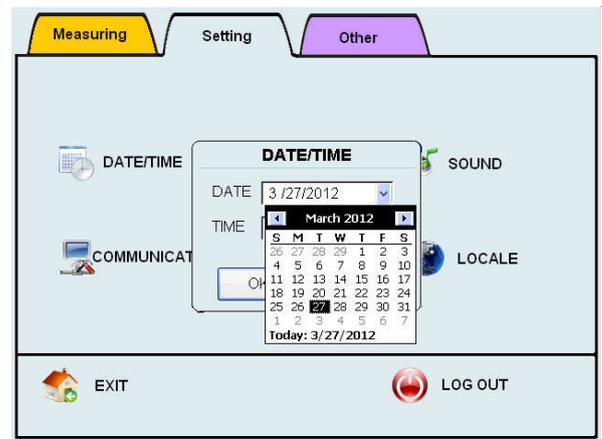

· LCD




In the LCD settings, configure the Power saver time-out and Brightness setting. Also the LCD displays the power state of the unit (battery level, power source (AC/battery), battery charging, etc.).

For the Power saver time-out setting, select one among 1min, 2min, 5min, 10min, 15min, & 30min.

To configure the brightness setting, move the slider to the desired setting.

Tap [OK] to save the settings **(Authentication required)**.

• SOUND

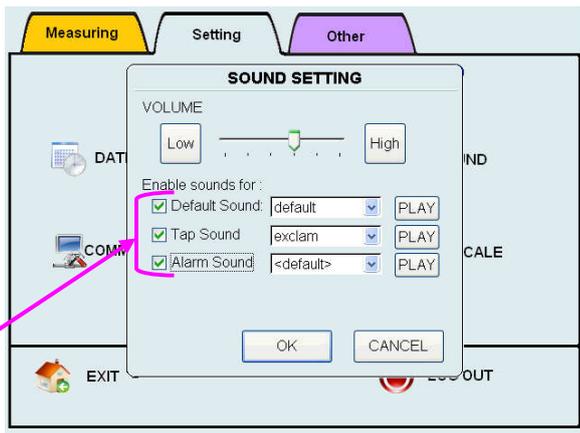

In the SOUND settings, you can configure the sound volume and sound type.

You can use any Windows standard WAV format file for the sound functions.

Create a folder named "Sound" on the USB flash drive. Then copy the WAV file(s) in the folder. You will be able to select the file from the list as long as the USB flash drive is installed (* is added to all of the WAV file names on the USB flash drive).

Selected WAV files are transferred to internal data storage. Therefore, after selecting the files and choosing

Default Sound:

Set the sound for erroneous operation. When this item is unchecked, this sound function will be off.

Tap Sound:

Set the tap sound on the screen. When this item is unchecked, there will be no tap sound.


Alarm Sound:

Set the sound for the Alarm. When this item is unchecked, there will be no alarm sound.

Tap [OK] to save the settings and close the window (**Authentication required**).

Tap [CANCEL] to discard the configured settings (Previous settings will be applied).

• COMMUNICATION

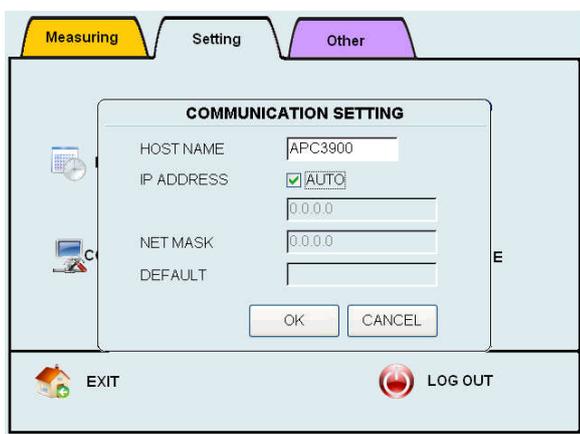

In the COMMUNICATION SETTING, configure the settings for Ethernet connection. This settings need to be configured when connecting the instrument to a PC using remote console or remote mode.


For the HOST NAME, enter a name to identify the instrument when it is connected to a network or workgroup by Ethernet. (Be sure not to use the same name as other PCs or devices on the network or workgroup.)

For IP ADDRESS, check AUTO to acquire an IP ADDRESS automatically. If AUTO is unchecked, enter IP Address, NET MASK and DEFAULT Gateway.

Tap [OK] to save the settings and to close the window (**Authentication required**).

Tap [CANCEL] to discard the configured settings (Previous settings will be applied).

• PUMP SETTING

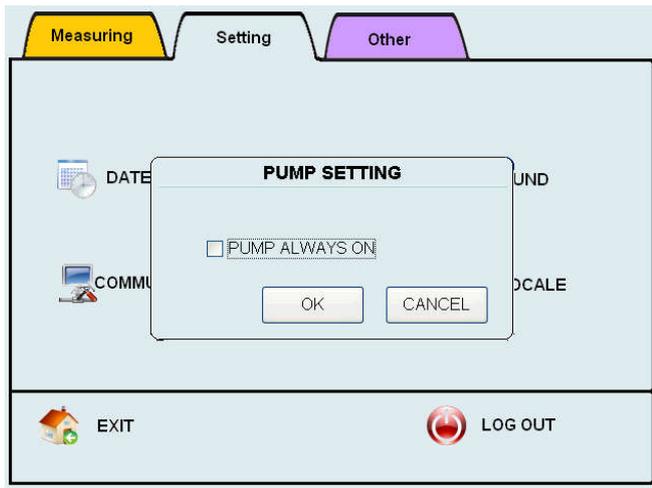

In the PUMP setting, you can decide if the pump is ON all the time or not.


To have the pump running all the time, check the box for "PUMP ALWAYS ON".

Tap [OK] to save the settings and close the window. **(Authentication required)**

Tap [CANCEL] to discard any changes.

Having the pump always on eliminates the PREPARATION time before sampling. However, it increases the chances of the vane becoming worn and the motor deteriorating as the shaft of the motor may go off-center from constant use. We recommend the pump not be left running during general use to extend the life of pump.

• REGION

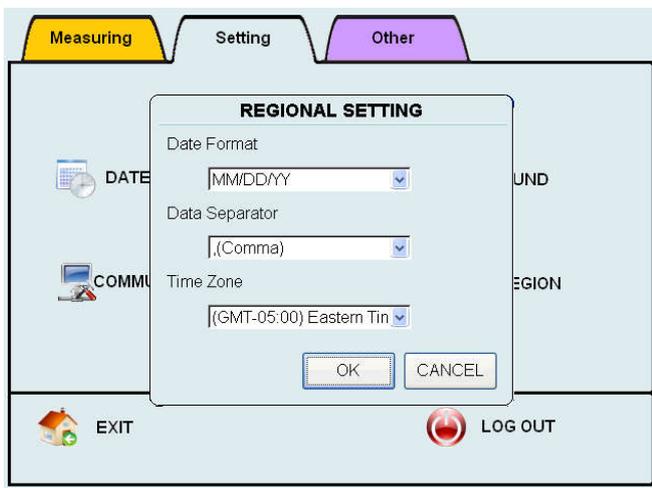


In REGIONAL SETTING you can set the date display format to be used when saving files.

Tap [OK] to save the settings and close the window. **(Authentication required)**

Tap [CANCEL] to discard the current settings.

***When transferring data and other files to a PC, different date/time or timestamp will be displayed if the setting of time zone is different from the one in the PC.**


3.8.3 Other

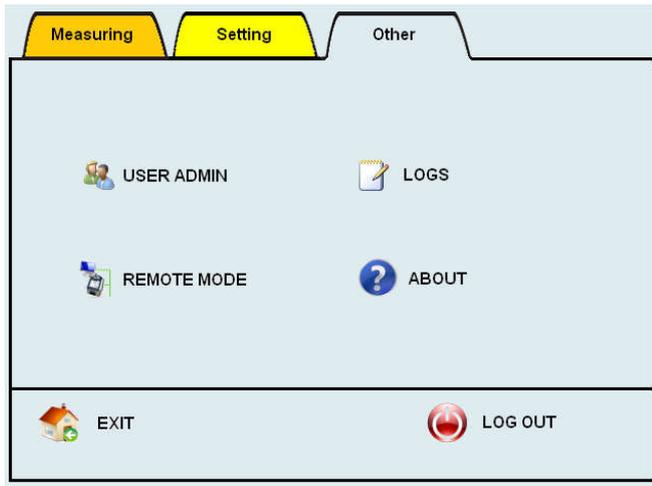

In the Other window you can configure the following settings;

- USER ADMIN
- LOGS
- ABOUT
- REMOTE MODE

• User Management

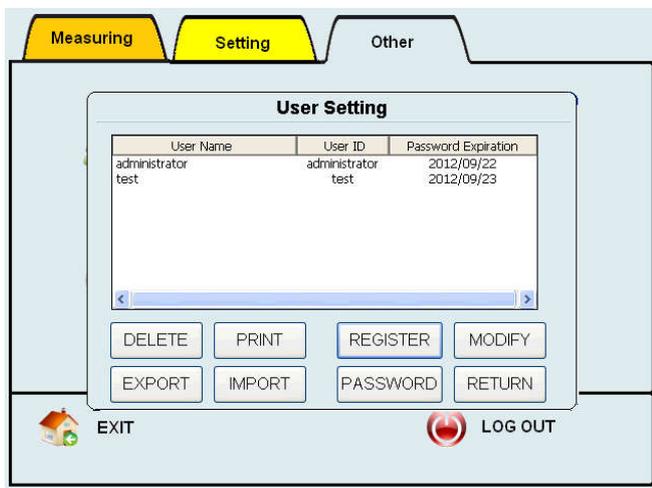

“User Setting” screen shows up by choosing “USER ADMIN” menu on the control panel. Registering a user, modifying user information, deleting an account, importing/exporting user information, printing user information, and changing a user password can be done from the “User Setting” window.

***Registering, modifying, and deleting user information has to be done by an Administrator user.**

***A user needs to have the authorization (Copy Files) to import and export user information.**

User Setting window shows registered users.

Select one of the registered users displayed on the screen and tap [DELETE] to delete the selected user (**Authentication required**).

Select one of the registered users displayed on the screen and tap [PRINT] to print out the selected user information.

Tap [REGISTER] to register a new user (**Authentication required**).

Select one of registered users and tap [MODIFY] to edit the selected user information (**Authentication required**).

Tap [EXPORT] to copy the selected user information into storage (**Authentication required**, insert USB flash drive). Exported user information can be modified by PC software.

Tap [IMPORT] to import user information from the USB flash drive (**Authentication required**).

Tap [PASSWORD] to change the selected user’s password.

Tap [RETURN] to go back to the control panel.

User Information Window

NO. 1 (a)
Name: administrator (b)

Information | Qualification

(c) ID: administrator
(d) Password: *****
(e) Password reenter: *****
(f) Company/Division: [dropdown]
(g) Memo: [text area]

Password expires on 2012/09/23
Registered by administrator on 2012/03/27
Last modified by administrator on 2012/03/27

OK CANCEL

In the User Information Window you can add users and edit user information.

“Information” tab contains user information
“Qualification” tab is for setting user authorizations.

- (a) User Number: automatically assigned
- (b) User Name: up to 40 characters
- (c) User ID: up to 16 characters. Duplicate IDs are not allowed
- (d) Password: 4 to 16 characters
- (e) Password Re-enter: confirmation of password
- (f) Company / Division: up to 99 characters
- (g) Memo: up to 99 characters

NO. 1
Name: administrator

Information | Qualification

(h) Administrator
 Manage Users
 Access Control Panel
 Change Measurement Mode
 Copy Files(Include Remote Access)
 Delete Files
 View Logs

(i) Password expires on 2012/09/23
(j) Registered by administrator on 2012/03/27
(k) Last modified by administrator on 2012/03/27

OK CANCEL

- (h) Qualification:
Check the items to set user authorizations.
Administrators automatically have authorization to perform all tasks.

Items (i), (j), and (k) show when a user edits user information.

- (i) Password expiration:
Shows the expiration date of the password. Passwords expire every 180 days.
The default Administrator password needs to be changed within 60 days.
- (j) Registration date:
Shows the registration date and the User ID which registered the information
- (k) Last modified date:
Shows the latest modified date and the User ID which modified the information

Tap [OK] to register the information and go back to “User Setting” window.

Tap [CANCEL] to cancel the registration and go back to “User Setting” window.

➤ Qualification

Administrator: An administrator automatically has authorization to perform all tasks. "Manage Users" is only assigned to the administrator.

Manage Users: Allows a user to add, edit, delete, and activate / deactivate users.

Access Control Panel: Allows a user to change settings in the control panel.


Change Measurement Mode: Allows a user to change the measurement mode.

Copy Files: Allows a user to copy data, such as measurement data, log data, and user information. Data can be copied via network.

Delete Files: Allows a user to delete data, such as measurement data and user preset files.

View Logs: Allows a user to review the log data.

Input Password

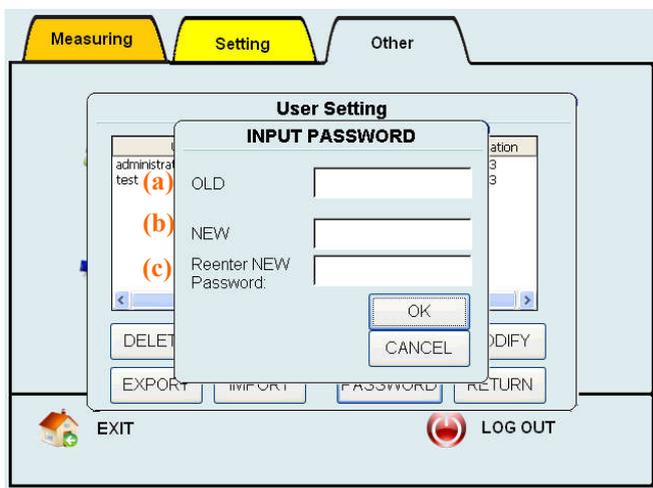

Edit password from "INPUT PASSWORD" screen.


The keyboard shows up when the user taps entry fields.

- (a) OLD Password: type in the current password.
- (b) NEW Password: type in the new password.
- (c) Reenter NEW Password: confirm the new password

Tap [OK] to renew your password and go back to "Manage Users" window.

Tap [CANCEL] to cancel the process and go back to "Manage Users" window.

• Log Maintenance

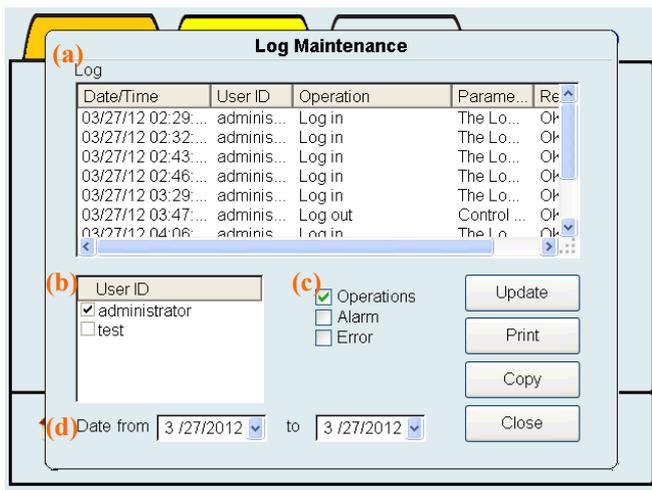

The "Log Maintenance" screen shows up when you select "LOGS" on the control panel. Users can review and print-out the log files, such as the operation log, alarm log, and error log

***User needs the authorization (View Logs) to view logs.**

***User needs the authorization (Copy Files) to copy files.**

(a) Log List

Shows following information; Date/Time, User ID, Operation (requests and results), and Parameters

(b) User ID

Select user ID to review the user's logs.

(c) Operation / Alarm / Error

Select the type of log from the following:

Operation: shows operation logs.

Alarm: shows alarm logs.

Error: shows error logs.

(d) Date

Select start date and end date for logs


Tap [Update] to refresh the log list, which is based on the criteria you select in (b), (c) and (d).

Tap [Print] to print out the current information from the log list.

Tap [Copy] to copy the selected log files to the USB flash drive (**Authentication required**).


Tap [Close] to go back to the control panel.

- ABOUT

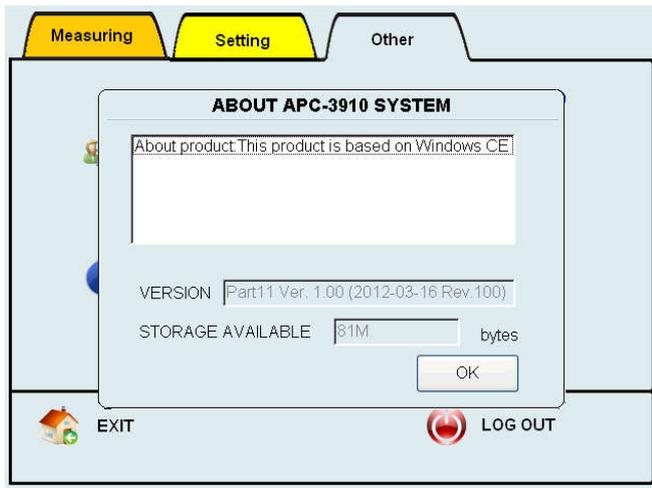

Tap [ABOUT] to view the firmware version of the instrument and the remaining capacity of the internal data storage.

- REMOTE MODE SETTING

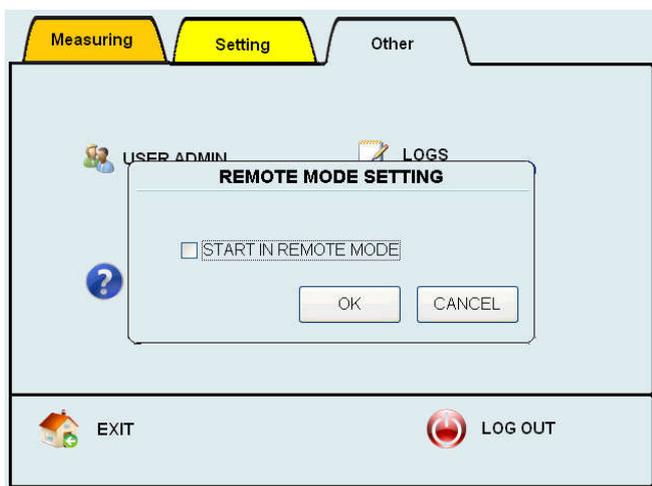

In the REMOTE MODE SETTING, check "START IN REMOTE MODE" to activate remote mode automatically when the instrument is turned ON.

Enter remote address in the entry field for ID.

Tap [OK] to save the settings and close the window.

Tap [CANCEL] to discard changes.

3.8.4 LOG OUT

The screenshot shows an 'Authentication' window with two input fields: 'USER:' containing 'administrator' and 'PASSWORD:' which is empty. Below the fields is a virtual keyboard with the following layout:

1	2	3	4	5	6	7	8	9	0	CLR
Q	W	E	R	T	Y	U	I	O	P	BS
A	S	D	F	G	H	J	K	L	+	/
Z	X	C	V	B	N	M	.	-	=	
CAPS	SPACE	SWITCH					ShutDown	OK		

Tap [LOG OUT] to return to the "LOG IN" screen.

At this screen, you can switch the user and also can shut-down the instrument.

When the [OK] button is tapped after a user ID and password are inputted, you return to MENU screen.

Tap [SHUTDOWN]. A window will be displayed asking "Do you want to shut down the power?"

5 seconds after tapping [YES], the instrument will shut down.

***Make sure to turn the power off at the "LOG IN" screen. If the power is not turned off from the "LOG IN" screen, settings or data loss, as well as hardware errors may occur.**

3.8.5 EXIT

Go back to the main screen.

4. PC Applications

The provided PC applications allow you to process measurement data and to operate the instrument from a Windows computer via network.

This section describes important settings when using the PC applications.

For details of each application, refer to the operation manual "AIRBORNE PARTICLE COUNTER SOFTWARE".

4.1 User Management

You can transfer files from the instrument and edit them on PCs. In addition to the management of data and log files, you can also edit user information files.

Data and log files may be converted into text files, so that they can be used with other applications.

- To transfer files via network, connect the instrument to the network and enter the appropriate settings in the COMMUNICATION SETTING screen.
- To access the instrument from a PC, enter the HOST NAME specified in the COMMUNICATION SETTING.
- User authentication is required when connecting to the instrument via PC. Enter your User ID and Password as registered in the instrument.
- To transfer data to a PC using the USB flash drive, select "COPY" in the "FILE SELECT" window to transfer data files, and "COPY" in the "LOG MANAGEMENT" window to transfer log files. Select "EXPORT" in the "USER MANAGEMENT" window to transfer user information files. User needs the authorization (Copy Files) to copy files.
- To update the user information file on the instrument, in the "USER MANAGEMENT" window, import the user information file edited on a PC.

4.2 Remote Console

The program allows remote operation of the instrument from a PC via network.

- Connect the instrument to the network and enter the appropriate settings in the COMMUNICATION SETTING screen.
- To access the instrument from a PC, enter the HOST NAME specified in the COMMUNICATION SETTING.
- User authentication is required when connecting to the instrument via PC. Enter your User ID and Password as registered in the instrument. Authentication is required for remote control.

4.3 Create Schedule

You can create schedules to be used for STATS mode and STANDARD mode, and upload them to the instrument.

- Connect the instrument to the network and enter the appropriate settings in the

COMMUNICATION SETTING screen.

- To access the instrument from a PC, enter the HOST NAME specified in the COMMUNICATION SETTING.
- User authentication is required when connecting to the instrument. Enter your User ID and Password as registered in the instrument. User needs the authorization (Copy Files) to copy files.

4.4 Remote Measurement


You can read data stored in the instrument directly from PCs connected via network to take measurements.

- You need to connect the instrument to the network and make appropriate settings in the COMMUNICATION SETTING.
- Before taking remote measurements, "START IN REMOTE MODE" needs to be checked in the REMOTE MODE SETTING window, which can be displayed from the CONTROL PANEL screen of the instrument.
- Enter the HOST NAME specified in the COMMUNICATION SETTING for the destination.

5. Connecting Option Sensors

Two types of sensors plus an alarm function are available as optional extras for this instrument. By connecting the sensors or an alarm to three different connectors on the rear of the unit, you can perform two different kinds of measurement and one contact output for the alarm simultaneously.

Temperature, Humidity, Velocity Probe - Model 6531	
Temp. Range	-20 to 70 °C
Temp. Accuracy	±0.5 °C
Humidity Range	2 to 98 %RH
Humidity Accuracy	±2 %RH (when in the range of 2-80%RH, other ±3 %)
Velocity Range	0.01 to 30 m/s
Velocity Accuracy	±2% of reading or ±0.015m/s, whichever is greater
Dimension	Φ10 to 16 x212 mm Length of the probe cable: 2m

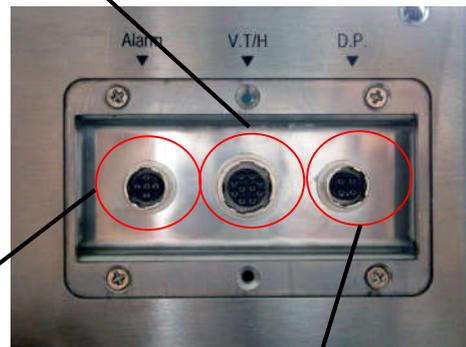

Contact Output Cable - Model 3910-03	
When the alarm function is ON and the threshold is exceeded, the alarm will be turned ON.	
Spec	Photocoupler Maximum rating: 60V/400 mA Red: + / Black: -

*The alarm output is a single set of contacts that activates upon any sensor threshold being exceeded. It can be used to activate an alarm light etc.

Pressure Transmitter - Model C264 0-100Pa	
Pressure Range	0 ~ 100 Pa
Pressure Accuracy	±1 %F.S.
Guaranteed Temp	5 to 65 °C
Output	4 to 20 mA

*When connecting the pressure transmitter, cable MODEL 3900-02 is required separately. Please check with your sales representative.

6. Printing Examples

6.1 Printing Example for Each Measurement Mode

6.1.1 SINGLE

```
[SG20101201120000]
Ser.No. = 654321
Measured by kanomax
Measured on 12/01/2010
Sample Time = 00:01:00
Repeats = 1
Printed by kanomax

Particle [p][Total]
TIME 0.3um 0.5um 1.0um
12:00:00 8000 5000 3000
TIME 3.0um 5.0um 10.0um
12:00:00 1000 500 100
TIME T[C] H[%] V[m/s] P[Pa]
12:00:00 25.2 68.5 0.1 15
```

6.1.2 CONTINUOUS

```
[C020101201120000]
Ser.No. = 654321
Measured by kanomax
Measured on 12/01/2010
Sample Time = 00:01:00
Repeats = 1
Printed by kanomax

Particle [p][Total]
TIME 0.3um 0.5um 1.0um
12:00:00 8000 5000 3000
TIME 3.0um 5.0um 10.0um
12:00:00 1000 500 100
TIME T[C] H[%] V[m/s] P[Pa]
12:00:00 25.2 68.5 0.1 15
```

6.1.3 INTERVAL

[IN20101201120000]

Ser. No. = 654321
 Measured by kanomax
 Measured on 12/01/2010
 Sample Time = 00:00:06
 Repeats = 10
 Printed by kanomax

Start at 12/01/2010 12:00:00
 Sample Time = 00:00:06
 Repeats = 10

Particles [p]

0.3um
 Min= 15623 Max= 16136
 Ave= 15848.3

0.5um
 Min= 389 Max= 521
 Ave= 441.9

1.0um
 Min= 57 Max= 103
 Ave= 90.9

3.0um
 Min= 3 Max= 12
 Ave= 7.4

5.0um
 Min= 0 Max= 4
 Ave= 1.4

10.0um
 Min= 0 Max= 2
 Ave= 0.2

Temperature [C]

Min= 24.8 Max= 25.3
 Ave= 25.2

Humidity [%]

Min= 64.3 Max= 68.2
 Ave= 65.4

Velocity [m/s]

Min= 0.1 Max= 0.3
 Ave= 0.2

Pressure [Pa]

Min= 13 Max= 21
 Ave= 15

Particles [p][Total]

TIME	0.3um	0.5um	1.0um	
12:00:00	15924	389	92	
12:01:00	15623	439	102	
...	
12:09:00	15759	521	103	
TIME	3.0um	5.0um	10.0um	
12:00:00	6	2	0	
12:01:00	5	0	0	
...	
12:09:00	10	2	2	
TIME	T[C]	H[%]	V[m/s]	P[Pa]
12:00:00	24.8	64.3	0.2	13
12:01:00	24.5	64.0	0.2	13
...
12:09:00	25.1	68.1	0.3	20

Raw data

Stat. data

6.1.4 STATS


```
[ST20101201120000]
Ser. No. = 654321
Measured by kanomax
Measured on 12/01/2010
Sample Time = 00:01:00
Repeats = 5
Printed by kanomax
1:Location1 (1/5)
Start at 12/01/2010 12:00:00
Sample Time = 00:00:06
Repeats = 10
```

```
Particles [p]
0.3um
Min= 15623 Max= 16136
Ave= 15848.3
0.5um
Min= 389 Max= 521
Ave= 441.9
1.0um
Min= 57 Max= 103
Ave= 90.9
3.0um
Min= 3 Max= 12
Ave= 7.4
5.0um
Min= 0 Max= 4
Ave= 1.4
10.0um
Min= 0 Max= 2
Ave= 0.2
```

```
Temperature [C]
Min= 24.8 Max= 25.3
Ave= 25.2
Humidity [%]
Min= 64.3 Max= 68.2
Ave= 65.4
Velocity [m/s]
Min= 0.1 Max= 0.3
Ave= 0.2
Pressure [Pa]
Min= 13 Max= 21
Ave= 15
```

```
2:Location2 (2/5)
Start at 12/01/2010 12:25:00
Sample Time = 00:00:06
Repeats = 10
```

(Print 5 locations)

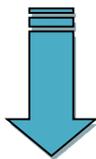

Stat. data

```
Particles [p][Total]
TIME 0.3um 0.5um 1.0um
12:00:00 15924 389 92
12:01:00 15623 439 102
(Print 25 points)
12:45:00 15759 521 103
TIME 3.0um 5.0um 10.0um
12:00:00 6 2 0
12:01:00 5 0 0
(Print 25 points)
12:45:00 10 2 2
TIME T[C] H[%] V[m/s] P[Pa]
12:00:00 24.8 64.3 0.2 13
12:01:00 24.5 64.0 0.2 13
(Print 25 points)
12:45:00 25.1 68.1 0.3 20
```

Raw data

6.1.5 STANDARD

```
[IS20101201120000]
Ser. No. = 654321
Measured by kanomax
Measured on 12/01/2010
Sample Time = 00:01:00
Repeats = 5
Printed by kanomax
Class = ISO 6
Sizes = 0.3um
```

```
1:Location1 2887279 p/m3 NG
2:Location2 2848409 p/m3 NG
3:Location3 2793992 p/m3 NG
4:Location4 2904593 p/m3 NG
5:Location5 2840989 p/m3 NG
```

```
ALL : 2855053 p/m3
SE : 19317 p/m3
UCL : 2896198 p/m3
```


```
Limit : 102000 p/m3
Result : NG
```

```
1:Location1 (1/5)
Start at 12/01/2010 12:00:00
Sample Time = 00:00:06
Repeats = 10
```

```
Particles [p]
0.3um
Min= 15623 Max= 16136
Ave= 15848.3
0.5um
Min= 389 Max= 521
Ave= 441.9
1.0um
Min= 57 Max= 103
Ave= 90.9
3.0um
Min= 3 Max= 12
Ave= 7.4
5.0um
Min= 0 Max= 4
Ave= 1.4
10.0um
Min= 0 Max= 2
Ave= 0.2
```

```
Temperature [C]
Min= 24.8 Max= 25.3
Ave= 25.2
Humidity [%]
Min= 64.3 Max= 68.2
Ave= 65.4
Velocity [m/s]
Min= 0.1 Max= 0.3
Ave= 0.2
Pressure [Pa]
Min= 13 Max= 21
Ave= 15
```

```
2:Location2 (2/5)
Start at 12/01/2010 12:25:00
Sample Time = 00:00:06
Repeats = 10
```

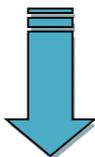

(Print 5 locations)

Eval. data

```
Particles [p][Total]
TIME 0.3um 0.5um 1.0um
12:00:00 15924 389 92
12:01:00 15623 439 102
```



(Print 25 points)

```
12:45:00 15759 521 103
TIME 3.0um 5.0um 10.0um
12:00:00 6 2 0
12:01:00 5 0 0
```



(Print 25 points)

```
12:45:00 10 2 2
TIME T[C] H[%] V[m/s] P[Pa]
12:00:00 24.8 64.3 0.2 13
12:01:00 24.5 64.0 0.2 13
```



(Print 25 points)

```
12:45:00 25.1 68.1 0.3 20
```

Raw data

Stat. data

7. Battery Charge

7.1 Charging Battery


When the AC adapter is connected, you can charge the battery (one or two) when it is installed in the instrument.

When the battery is fully charged, the Power state LED becomes red.

When the battery is charging, the power state LED will blink.

Note: if the battery is charging now, you should not pull the battery out or insert another battery.

It may damage the battery or the instrument.

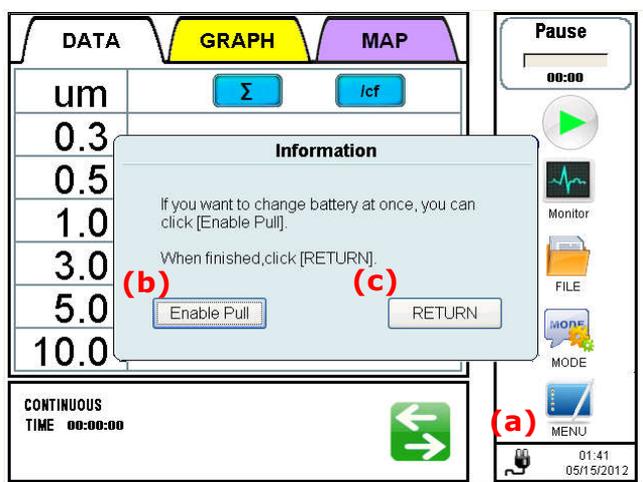

If you must exchange the battery when the power is on and the battery is charging, you can follow this instruction:

First, tap the Power Icon (a) on the main screen.

Tap [Enable Pull] (b), and then you can pull the batteries out or insert them.

When you are finished, you must tap [RETURN] (c) to finish it.



You may also charge the battery with the provided charger instead of using the instrument and AC adapter:

Open the battery compartment cover on the rear of the instrument by hand.

Connect the battery to the provided charger to recharge the battery. It takes about 4 hours to charge one battery fully.

After the battery is charged, install it into the instrument (Refer to **2.1 Power Supply** for installing the battery).

8. Main Specifications

Product Name	Airborne Particle Counter
Model	Model 3910
Optical Source	Laser Diode (two-year warranty)
Particle Size Distribution	0.3 / 0.5 / 1.0 / 3.0 / 5.0 / 10.0 μm (6 Channels)
Rated Flow	50L/min.
Counting Efficiency	50 \pm 20% (Compliant with ISO 21501-4)
Spurious Count	0.2 counts/cf or less (Compliant with ISO 21501-4)
Max Detectable Concentration	500,000 counts/cf (=17,667.8 counts/L)
Sampling Time	6sec ~ 23hours 59min 59sec (Configurable)
Interval Time	6sec ~ 23hours 59min 59sec (Configurable)
Delay Time	11sec ~ 1hour (=3,600sec) (Configurable)
Repeat Times	1 ~ 9,999 times (Continuous) (Configurable)
Location Number	Configurable in the range of 0~999 (Schedule can also be configured.)
Alarm Setting	1 ~ 9,999,999 count (= count/cf, count/m ³) (Unit is Configurable)
Measurement Mode	SINGLE Mode, CONTINUOUS Mode, INTERVAL Mode, STATS Mode, STANDARD Mode
Display	Color LCD Dot Matrix
Data Storage Capacity	80MB (Internal data storage) 1 unit of data = Approx.100 bytes (For example, Repeat measurement \times 1,000 times → 100 bytes \times 1,000 times = 100k bytes) Up to 10,000 files can be stored.
Printer	Built-in (Compatible with Dust-free Paper)
Interface	Ethernet
Power Supply	- AC adapter (100 to 240V) - Rechargeable Lithium-ion battery (2 battery slots, Provides 5+ hours of continuous usage from 2 fully charged batteries, User replaceable)
Operating Environment	This model can be used in the environment described below: - Temperature 10 ~ 35 $^{\circ}\text{C}$ / Humidity 20 ~ 85 %RH (Non condensing) - This instrument is for indoor use only - This instrument cannot be used if the altitude is higher than 2,000 m. - AC Supply voltage : AC100 ~ 240V \pm 10%. - Overvoltage Category II - Pollution Degree: Class 2
Storing Environment	Temperature -20~50 $^{\circ}\text{C}$ / Humidity 0~85%RH (Non condensing)
Dimension	W 200 \times D 205 \times H 200 mm (Excluding Handle)
Weight	Approx. 5.5kg with 2 batteries
Standard Accessories	Manual(All, Quick-start guide), test-report, Zero filter, Li-ion battery \times 1, Printer Paper \times 2, AC adaptor, Tygon tube \times 2m, Isokinetic probe, Software, USB flash drive
Optional Extras	Carry case, Battery charger, Li-ion battery, Option Sensors (6531 Probe, Pressure-sensor, Alarm-output), Tripod, Filter Scan Probe *For specifications for the Option Sensors, please refer to 5. Connecting Option Sensors.

9. Troubleshooting

Symptom	Possible Cause	Maintenance
Cannot obtain Zero Count (When using a filter)	1) The inside of the optical system may be dirty.	Attach the zero filter and perform purging for a prolonged time. After performing a measurement in a highly concentrated environment, attach the zero filter and perform purging.
	2) The filter's air tightness may be deteriorated.	Replace your zero filter.
	3) Leaks may be occurring inside the instrument.	Return the instrument to your distributor or to your KANOMAX service center for repair.
Count value is too high (Higher than the expected)	1) The particle concentration at the measurement site may be high.	-
	2) The inside of the optical system may be dirty.	Attach a zero filter and perform purging for a prolonged time. After performing a measurement in the highly concentrated environment, attach the zero filter and perform purging.
	3) The instrument may be being used outside the operating environment defined in the specifications. (Measurement Environment Temperature / Humidity / Concentration etc) If you have checked the above 1), 2) and 3), and the instrument readings are still too high, the instrument may require calibration or repair.	Use the instrument under the environmental conditions set in the specifications. Contact your distributor or your KANOMAX service center for repair or calibration.
Count value is too low (Lower than the expected)	1) The particle count at the measurement site may be low.	-
	2) The pump vacuum is low.	Pay attention to the pump performance. Check if an error status is displayed on the screen.
	3) The instrument may be being used outside the operating environment defined in the specifications. (Measurement Environment Temperature / Humidity / Concentration etc)	Use the instrument under the environmental conditions set in the specifications.
	4) If you have checked the above 1), 2) and 3), and the instrument readings are still too low, the instrument may require calibration or repair.	Contact your distributor or your KANOMAX service center for repair or calibration..
The output of the option sensors is not displayed.	1) The sensor may not be connected properly.	Check the option sensor connection.
Touch panel becomes unresponsive	1) The touch panel may be damaged.	Return the instrument to your distributor or to your KANOMAX service center for repair.

Symptom	Possible Cause	Maintenance
【LD ERR】 	The laser may be damaged.	Return the instrument to your distributor or to your KANOMAX service center for repair.
【FLOW ERR】 	The flow channel may be interrupted.	Make sure that the inlet and outlet are not blocked.
	The pump may be damaged.	Return the instrument to your distributor or to your KANOMAX service center for repair.
【BATTERY ERR】 	Power capacity is low.	<p>If using a rechargeable battery, charge the battery.</p> <p>If using the AC line, the line may have problems.</p>
【OVER ERR】 	The operating environment may be outside the range defined in the specifications.	<p>The inside of the optical system may be dirty.</p> <p>Attach the zero filter to the inlet and perform purging.</p>

10. Warranty and After-sales Service

KANOMAX Limited Warranty

The limited warranty set below is given by KANOMAX with respect to the KANOMAX brand Airborne Particle Counter, its attachment parts including Probe and other accessories (hereafter referred to as "PRODUCT") that you have purchased. PRODUCT you have purchased shall be the only one that the limited warranty stated herein applies to.

Your PRODUCT, when delivered to you in new condition in its original container, is warranted against defects in materials or workmanship as follows: for a period of two (2) years from the date of original purchase, defective parts or a defective PRODUCT returned to your sales representative, as applicable, and proven to be defective upon inspection, will be exchanged for a new or comparable rebuilt parts, or a refurbished PRODUCT as determined by your sales representative. Warranty for such replacements shall not extend the original warranty period of the defective PRODUCT.

This limited warranty covers all defects encountered in normal use of the PRODUCT, and does not apply to the following cases:

- (1) Use of parts or supplies other than the PRODUCT sold by your sales representative, which cause damage to the PRODUCT or cause abnormally frequent service calls or service problems.
- (2) If any PRODUCT has its serial number or date altered or removed.
- (3) Loss of damage to the PRODUCT due to abuse, mishandling, improper packaging by the owner, alteration, accident, electrical current fluctuations, failure to follow operating, maintenance or environmental instructions prescribed in the PRODUCT's instruction manual provided by KANOMAX, or service performed by a party other than KANOMAX.

NO IMPLIED WARRANTY, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, APPLIES TO THE PRODUCT AFTER THE APPLICABLE PERIOD OF THE EXPRESS LIMITED WARRANTY STATED ABOVE, AND NO OTHER EXPRESS WARRANTY OR GUARANTY, EXCEPT AS MENTIONED ABOVE, GIVEN BY ANY PERSON OR ENTITY WITH RESPECT TO THE PRODUCT SHALL BIND KANOMAX. KANOMAX SHALL NOT BE LIABLE FOR LOSS OF STORAGE CHARGES, LOSS OR CORRUPTION OF DATA, OR ANY OTHER SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES CAUSED BY THE USE OR MISUSE OF, OR INABILITY TO USE, THE PRODUCT, REGARDLESS OF THE LEGAL THEORY ON WHICH THE CLAIM IS BASED, AND EVEN IF KANOMAX HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES. IN NO EVENT SHALL RECOVERY OF ANY KIND AGAINST KANOMAX BE GREATER IN AMOUNT THAN THE PURCHASE PRICE OF THE PRODUCT SOLD BY KANOMAX AND CAUSING THE ALLEGED DAMAGE. WITHOUT LIMITING THE FOREGOING, THE OWNER ASSUMES ALL RISK AND LIABILITY FOR LOSS, DAMAGE OF, OR INJURY TO THE OWNER AND THE OWNER'S PROPERTY AND TO OTHERS AND THEIR PROPERTY ARISING OUT OF USE OR MISUSE OF, OR INABILITY TO USE, THE PRODUCT NOT CAUSED DIRECTLY BY THE NEGLIGENCE OF KANOMAX. THIS LIMITED WARRANTY SHALL NOT EXTEND TO ANYONE OTHER THAN THE ORIGINAL PURCHASER OF THE PRODUCT, OR THE PERSON FOR WHOM IT WAS PURCHASED AS A GIFT, AND STATES THE PURCHASER'S EXCLUSIVE REMEDY.

After-sales Service

If the PRODUCT is malfunctioning, please see "Troubleshooting" page 79 to find possible causes first.

Repair parts are retained for a minimum period of five (5) years after production cessation of the PRODUCT. This storage period of repair parts is considered as the period during which KANOMAX can provide repair service.

For more information, please contact your sales representative. When you call, please have the following information at hand:

- (1) PRODUCT name;
- (2) Model number;
- (3) Serial number;
- (4) Probe number;
- (5) Description of Symptom, and;
- (6) Date of purchase



KANOMAX

USA & Europe

KANOMAX USA, INC.

PO Box 372, 219 US Hwy. 206, Andover, NJ 07821 U.S.A.

TEL: 1-800-247-8887 / 1-973-786-6386 **FAX:** 1-973-786-7586

URL: <http://www.kanomax-usa.com/>

E-Mail: info@kanomax-usa.com

Japan & Asia

KANOMAX JAPAN INC.

2-1 Shimizu Suita City, Osaka 565-0805, Japan

TEL: 81-6-6877-0183 **FAX:** 81-6-6877-5570

URL: <http://www.kanomax.co.jp/>

E-Mail: sales@kanomax.co.jp

China

Shenyang Kano Scientific Instrument Co., Ltd

No. 12, 4 Jia Wencui Road Heping District

Shenyang City, PRC

TEL: 86-24-23845309 **FAX:** 86-24-23898417

URL: <http://www.kanomax.com.cn/>

E-Mail: sales@kanomax.com.cn

Copyright © Kanomax Japan Inc. All rights reserved.

2016

No copying, distribution, publication, modification, or incorporation of this document, in whole or part, is permitted for commercial purposes without the express written permission of Kanomax.

The contents of this document may be changed without prior notice.

02001/16.05